

Township of Madawaska Valley

Asset Management Plan for Tax-Supported Assets

SUBMITTED BY

Ontario Clean Water Agency 2085 Hurontario Street, 5th Floor Mississauga, ON L5A 4G1

Date: June 14, 2024



| AMP Issue and Revision Record | | | | | | | | | |
|-------------------------------|---------------|--|--------------------------|-------------------|---|--|--|--|--|
| Rev. No. | Date | Prepared by: | Reviewed by: | Approved by: | Rev. Description | | | | |
| 1 | June 17, 2022 | Nick Larson, OCWA | Natalie Colantonio, OCWA | Nick Larson, OCWA | Current Performance as at Year- End 2021 | | | | |
| 2 | June 14, 2024 | Nick Larson, OCWA Amanda Hudder, Towns | | Nick Larson, OCWA | Current Performance as at Year- End 2023 | | | | |



Executive Summary

Tax-Supported Asset Portfolio

The scope of this AMP includes all tax-supported assets. The infrastructure portfolio has an estimated replacement value of approximately \$122 million in eight (8) asset groups.



Figure ES1: Asset Portfolio Summary

Note: Actual costing values are subject to market forces at the time of infrastructure construction / improvement activity, above values are based on historical averages and industry standards.

Current Asset Performance

The best available asset information combines with the judgement of subject matter experts to establish the current performance of each of the individual asset records represented in the asset portfolio. The performance of individual assets aggregates to the performance distribution of each asset group.

The tables below provides the performance rating scale and current asset performance results are in Figure ES2 and Table ES2.

Table ES1: Asset Performance Rating Descriptions

| Performance Category | Description | State of Asset | | |
|-------------------------|--|-------------------------------|--|--|
| Good | Asset performance meets or exceeds its objectives/requirements. | No Deficiencies | | |
| Fair | Asset performance is nearing the point where it will not meet its objectives/requirements. | Has Deficiencies | | |
| Poor | Asset performance is not meeting its objectives/requirements. | Requires Treatment (Spending) | | |



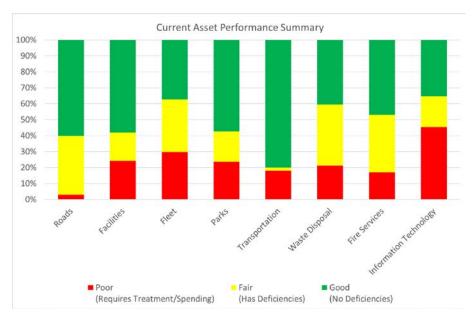


Figure ES2: Current Asset Performance Distribution by Asset Group

The total replacement cost of the assets in the poor performance category is of approximately \$11 million, which represents approximately 9% of the total asset portfolio. For comparison purposes, the 2022 AMP identified 10% of the asset portfolio in the poor performance category. The spending required to restore these assets to the good performance category is not necessarily equal to the replacement costs, since some assets only require rehabilitation while others require replacement with a more expensive asset.

Table ES2: Current Asset Performance by Replacement Value and Asset Group

| | Asset Perfor | mance Distribution by R | Replacement Cost | |
|---------------------------|---------------------------|----------------------------|--|---------------|
| | Good (No Deficiencies) | Fair (Has Deficiencies) | Poor (Requires Treatment/Spending) | Total |
| Roads | \$53,506,564 | \$32,739,708 | \$2,595,186 | \$88,841,458 |
| Facilities | \$11,849,168 | \$3,634,750 | \$4,912,058 | \$20,395,977 |
| Fleet | \$3,522,151 | \$3,116,263 | \$2,804,893 | \$9,443,307 |
| Parks | \$672,124 | \$220,800 | \$276,000 | \$1,168,924 |
| Transportation | \$1,004,799 | \$25,157 | \$224,710 | \$1,254,665 |
| Waste Disposal | \$190,495 | \$178,765 | \$99,470 | \$468,731 |
| Fire Services | \$137,831 | \$106,238 | \$50,000 | \$294,070 |
| Information Technology | \$57,091 | \$31,233 | \$73,235 | \$161,559 |
| Total | \$70,940,223 | \$40,052,915 | \$11,035,553 | \$122,028,690 |



Spending Forecast

Figure ES3 summarizes the spending forecast results. An average of \$1.2 million per year over the long term is required to achieve asset performance requirements.

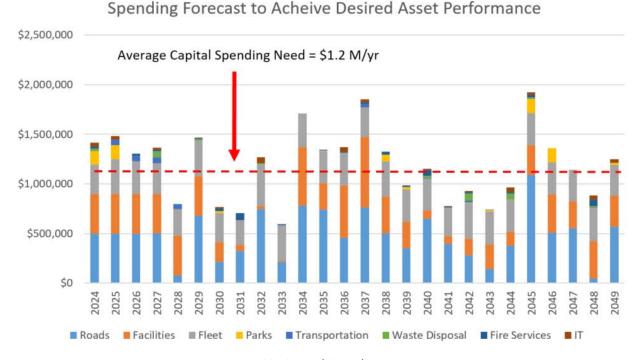


Figure ES3: Capital Spending Forecast

Funding Gap

The long-term funding needs are generally consistent with recent capital spending levels. If unconditional Provincial grants continue in step with inflation pressures, then the Township should have sufficient revenue to maintain the performance of their current infrastructure portfolio over the long term.

Financial Strategy

The objective of the Township's financing strategy for these projects should be to maximize new assessment growth at the lowest real cost impact to tax payers (i.e. maximize net revenue growth, minimize tax levy or user fee increases). This would prioritize the following options:

- 1. Provincial/Federal Government Grants
- 2. Internal Financing using Reserves
- 3. Debt
- 4. Development Charges
- 5. Tax Levy/User Fee Increases

Future budgets will present the optimal balance of the available financing options to fund the Township's desired infrastructure program.



Table of Contents

| 1 | INT | RODUCTION | 1 |
|----|------|---|-----|
| | 1.1 | Overview | 1 |
| | 1.2 | Defining Asset Performance | 1 |
| | 1.3 | Provincial Asset Management Planning Requirements | 1 |
| | 1.4 | AMP Development Approach | 1 |
| | 1.5 | Updating the Asset Management Plan | 2 |
| | | Asset Management Plan Scope | |
| | 1.7 | Growth Planning | 3 |
| 2 | OVE | ERVIEW OF ASSET PORTFOLIO | 4 |
| 3 | ASS | ET PERFORMANCE ASSESSMENT | 5 |
| | 3.1 | Measuring Asset Performance | 5 |
| | 3.2 | Current Asset Performance | 5 |
| 4 | ASS | ET LIFECYCLE MANAGEMENT | 7 |
| | 4.1 | Asset Lifecycle Activities Overview | 7 |
| | 4.2 | Spending and Performance Forecast Approach | 7 |
| | 4.3 | Spending and Performance Forecast Results | 8 |
| | 4.4 | Funding Gap Summary | 17 |
| | 4.5 | Risk Management | 18 |
| | 4.6 | Managing Climate Change | 18 |
| 5 | FIN | ANCING STRATEGY | .19 |
| 6 | DISC | CUSSION AND NEXT STEPS | .20 |
| | 6.1 | Monitoring Asset Performance | 20 |
| | 6.2 | Roadmap for Enhancing Asset Management Processes | 20 |
| Αŗ | pend | dix A – Performance Metrics | |
| Ar | pend | dix B – Asset Inventories | |

Appendox C-Planned Program



1 INTRODUCTION

1.1 Overview

This Asset Management Plan (AMP) builds a structured relationship between infrastructure spending and asset performance. Periodic (annual) updates ensure it reflects changing circumstances and actively supports infrastructure decision-making processes.

1.2 Defining Asset Performance

The definition of Asset Performance is "the ability of an asset to fulfill the organization's objectives or requirements".

The performance of an asset directly relates to the level of service it provides:

- An asset in the good or fair performance category is one which is meeting the expectations of the community (i.e. providing an appropriate level of service); and
- An asset in the poor performance category is one which is not meeting expectations (i.e. not providing an appropriate level of service), and requires spending to have it meet expectations.

The community's asset performance expectations balance costs and affordability and are therefore unique to each community based on its infrastructure inventory, financial status and community/corporate priorities.

1.3 Provincial Asset Management Planning Requirements

The Province of Ontario developed Regulation 588/17 under the Infrastructure for Jobs and Prosperity Act (2015). The following points summarize the requirements of O.Reg. 588/17:

- An AM policy is required to articulate specific principles and commitments that will guide
 decisions around when, why and how to spend money on the Town's infrastructure assets. The
 Policy is required by July 1, 2019. The Township successfully adopted their AM Policy in 2019.
- By July 1, 2022 the AMP will be required to establish the spending that is required to maintain current asset performance expectations for water, wastewater, stormwater, roads and bridges.
- By July 1, 2024 the AMP will be required to establish the spending that is required to maintain current asset performance expectations for all asset groups.
- By July 1, 2025 the AMP will be required to establish the spending that is required to achieve
 desired asset performance expectations, and the financial strategy to fund the required
 spending.

1.4 AMP Development Approach

OCWA's Asset Stewardship Quality Management System (ASQMS), depicted in Figure 1, guides the approach to develop this AMP. The ASQMS Framework shows how technical asset lifecycle strategies



connect to community priorities to develop optimized spending plans that balance service levels and costs. An AMP is a tactical output of the ASQMS.

The ASQMS aligns with Ontario Regulation 588/17 Asset Management Planning for Municipal Infrastructure and the international standard for infrastructure asset management (ISO 55000).





Figure 1: ASQMS Framework

The development of this AMP leverages the Township's best available asset and financial information, staff input, subject matter expert professional judgement, and AM best practices, to complete the following steps:

- 1. Develop a complete listing of infrastructure assets to be included in the AMP.
- 2. Assess current performance (level of service) of the assets based on existing information.
- 3. Prepare an asset lifecycle management strategy (i.e. spending plan) that maintains the current performance of the Town's infrastructure assets.
- 4. Understand the gap between required spending levels to achieve asset performance objectives versus historic spending.

1.5 Updating the Asset Management Plan

A periodic update to the AMP ensures it reflects the latest information and responds to evolving asset performance expectations in the community. Ideally, this update occurs annually in conjunction with the Township's budget processes, or more frequently if required to support funding applications.



1.6 Asset Management Plan Scope

This AMP includes all of the assets in the Township funded via property taxes (i.e. everything other than water and wastewater assets). Section 2 summarizes the infrastructure portfolio.

1.7 Growth Planning

As seen in Table 1, the population of Madawaska Valley has been slowly decreasing from 1996 to 2021. However, recent trends are showing an increase in demand for new development. The Township should prepare formal growth plans to provide some indication of the expected population growth over the next 20 years.

Table 1: Madawaska Valley Population History

| YEAR | POPULATION* |
|------|-------------|
| 1996 | 4,342 |
| 2001 | 4,406 |
| 2006 | 4,381 |
| 2011 | 4,282 |
| 2016 | 4,123 |
| 2021 | 3,927 |

^{*}Population from Statistics Canada.



2 OVERVIEW OF ASSET PORTFOLIO

The tax-supported infrastructure portfolio has an estimated replacement value of approximately \$122 million.



Figure 2: Madawaska Valley's Tax-Supported Infrastructure Portfolio

Note: Actual costing values are subject to market forces at the time of infrastructure construction / improvement activity, above values are based on historical averages and industry standards.

The following points summarize the assets that are included in the categories listed in Figure 2:

- Roads all roads in the community including ditches, culverts and shoulders.
- Facilities all buildings that support the community such as Municipal Hall, PYJCC Arena, Fire Halls and Works Yards.
- Fleet vehicles and major equipment such as dump trucks, fire trucks and snow removal machinery.
- Parks recreational assets such as playground equipment, boat launches, beach change rooms and sports fields.
- Transportation sidewalks, paved trials, public parking lots and streetlights.
- Waste Disposal fencing, steel plates and containers associated with landfills.
- Fire Services asset such as bunker gear, uniforms, extrication and communication equipment.
- Information Technology both hardware and software assets.



3 ASSET PERFORMANCE ASSESSMENT

As described in Section 1, the new landscape of AM that aligns with ISO 55000 defines asset performance as the ability for an asset to fulfill its objectives or requirements. This means that the performance of an asset is directly proportional to the level of service it provides. Levels of service are also at the core of O.Reg. 588/17, which requires municipalities to understand the cost to achieve higher or lower levels of service.

3.1 Measuring Asset Performance

The Township's asset inventory contains performance information for all infrastructure assets. This includes information related to both asset condition and asset function. The performance information is collected from a variety of sources, ranging from sophisticated technologies to investigate the assets to visual observations from qualified professionals.

All asset performance data combines with the professional judgment of subject matter experts to establish the current performance of each asset as defined in Table 2 below.

| PERFORMANCE CATEGORY | DESCRIPTION | STATE OF ASSET | | |
|-------------------------|--|-------------------------------|--|--|
| Good | Asset performance meets or exceeds its objectives/requirements. | No Deficiencies | | |
| Fair | Asset performance is nearing the point where it will not meet its objectives/requirements. | Has Deficiencies | | |
| Poor | Asset performance is not meeting its objectives/requirements. | Requires Treatment (Spending) | | |

Table 2: Asset Performance Rating Descriptions

3.2 Current Asset Performance

Figure 2 and Table 3 provide the current performance distribution of each asset group. The total replacement cost of the assets in the poor performance category is approximately \$11 million, which represents approximately 9% of the total asset portfolio. For comparison purposes, the 2022 AMP identified 10% of the asset portfolio in the poor performance category.

Note that the spending required to restore these assets to the good performance category is not equal to the replacement costs, since some assets only require rehabilitation while others require replacement with a more expensive asset.

The performance category of each asset updates on a continual basis to reflect actual spending on assets, new asset data, and changing asset performance objectives or requirements.

Appendix A provides detailed performance metrics.



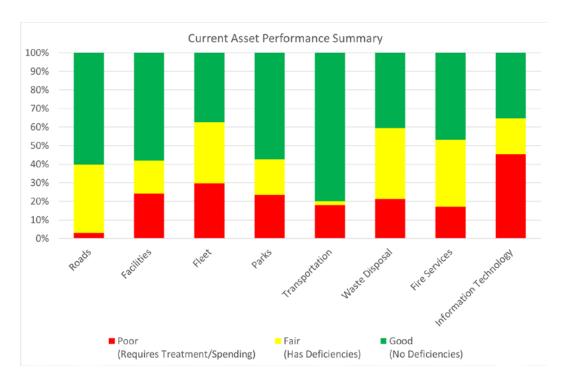


Figure 2: Current Asset Performance Distribution by Asset Group

Table 3: Current Asset Performance by Replacement Value and Asset Group

| | Asset Perfor | mance Distribution by R | eplacement Cost | |
|---------------------------|---------------------------|----------------------------|--|---------------|
| | Good (No Deficiencies) | Fair (Has Deficiencies) | Poor (Requires Treatment/Spending) | Total |
| Roads | \$53,506,564 | \$32,739,708 | \$2,595,186 | \$88,841,458 |
| Facilities | \$11,849,168 | \$3,634,750 | \$4,912,058 | \$20,395,977 |
| Fleet | \$3,522,151 | \$3,116,263 | \$2,804,893 | \$9,443,307 |
| Parks | \$672,124 | \$220,800 | \$276,000 | \$1,168,924 |
| Transportation | \$1,004,799 | \$25,157 | \$224,710 | \$1,254,665 |
| Waste Disposal | \$190,495 | \$178,765 | \$99,470 | \$468,731 |
| Fire Services | \$137,831 | \$106,238 | \$50,000 | \$294,070 |
| Information Technology | \$57,091 | \$31,233 | \$73,235 | \$161,559 |
| Total | \$70,940,223 | \$40,052,915 | \$11,035,553 | \$122,028,690 |



4 ASSET LIFECYCLE MANAGEMENT

4.1 Asset Lifecycle Activities Overview

Table 4 provides an overview of typical asset lifecycle activities applied to public infrastructure. The spending forecasts in this section represent a combination of major maintenance, rehabilitation and replacement treatments. Appendix C contains the detailed spending plan.

Table 4: Typical Asset Lifecycle Activities

| LIFECYCLE ACTIVITY | DESCRIPTION |
|---------------------|--|
| Operational | Operational activities, routine preventative maintenance, studies on asset performance |
| (Major) Maintenance | Repairs and component replacement to maintain asset performance, typically costing between 5-10% of asset replacement value. |
| Rehabilitation | Project to extend asset service life, typically costing between 15% - 40% of asset replacement value. |
| Replacement | A project resulting in a replacement of an asset with one asset that meets top industry and community expectations. |
| New Asset | Construction or purchase of new assets that results in net growth of the asset inventory and an enhancement in service levels provided to the community. |

4.2 Spending and Performance Forecast Approach

The analysis approach involves connecting real planned projects against specific assets where feasible and iteratively adjusting annual spending levels until the forecasted performance distribution will be relatively stable (i.e. the proportion of the asset network in the poor performance category is consistent).

For example, Figure 4 shows a scenario where there is not sufficient spending, resulting in the proportion of assets in the poor performance category increase from 5% in 2021 to 90% in 2040, and a declining trend in the Network Average performance index. This indicates that additional spending is required. Analysis updates continue to achieve a suitable performance forecast.

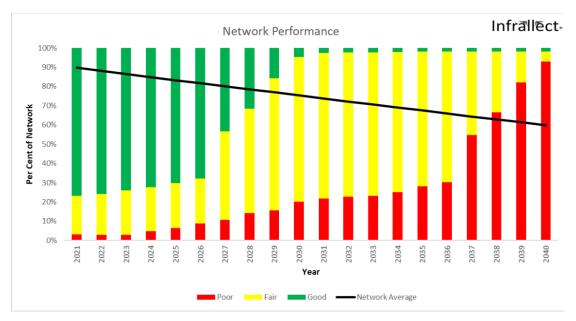


Figure 4: Sample Performance Forecast


4.3 Spending and Performance Forecast Results

Figure 5 to Figure 12 provide the performance forecasts for each of the asset groups. Figure 13 summarizes the capital spending required to achieve infrastructure performance objectives.

The analysis demonstrates that average annual spending levels of approximately \$1.2 million are required to achieve desired asset performance expectations over the long term for all asset groups.



Figure 5: Roads Performance Forecast

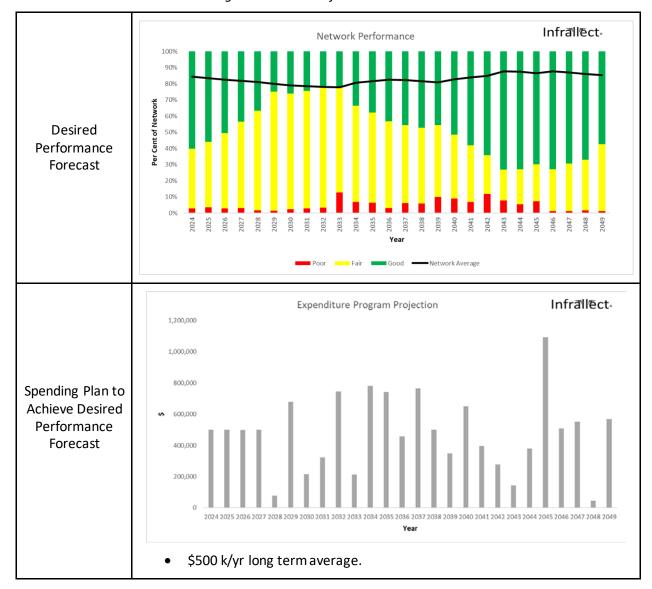



Infrällect. Network Performance 100% 90% 80% Per Cent of Network 60% Desired Performance 40% **Forecast** Fair Good ----Network Average Infrällect. Expenditure Program Projection 800,000 700,000 600,000 Spending 500,000 Plan to Achieve • 400,000 Desired 300,000 Performance **Forecast** 200,000 100,000 2024 2025 2026 2027 2028 2029 2030 2031 2032 2033 2034 2035 2036 2037 2038 2039 2040 2041 2042 2043 2044 2045 2046 2047 2048 2049 Year \$400 k/yr until 2029. Long term average spending from 2030 to 2049 is \$275k/yr.

Figure 6: Facilities Performance Forecast



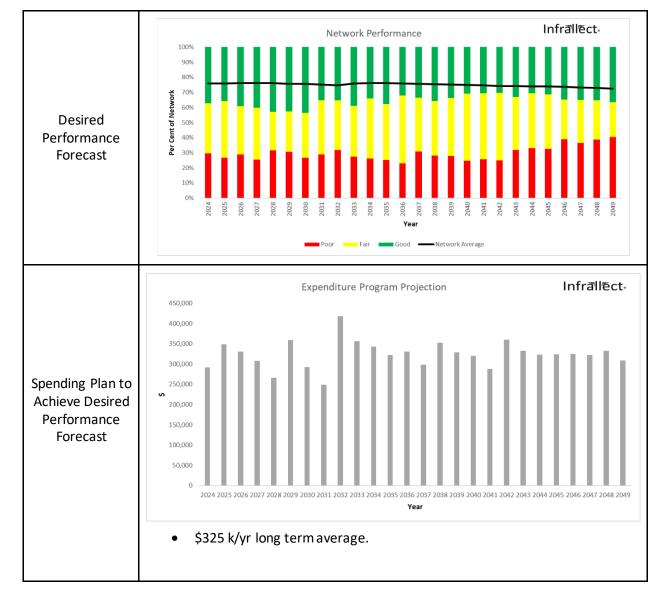


Figure 7: Fleet Performance Forecast



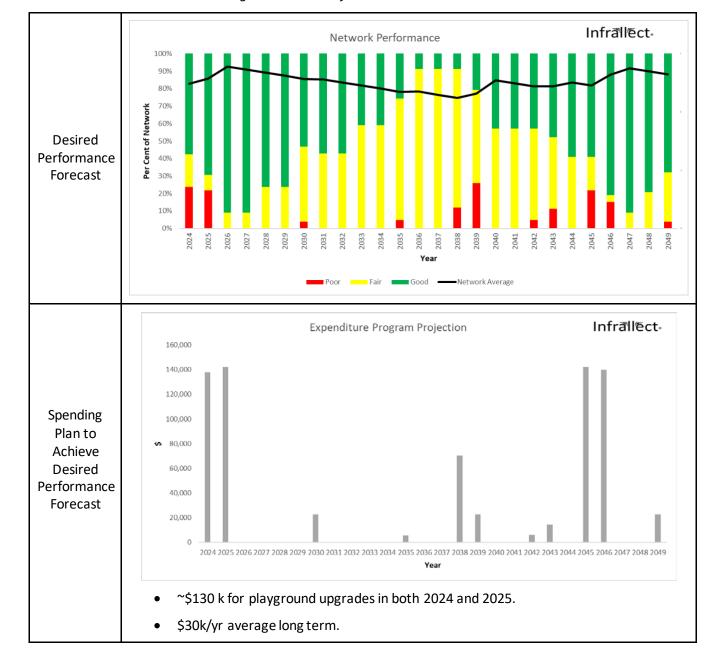


Figure 8: Parks Performance Forecast



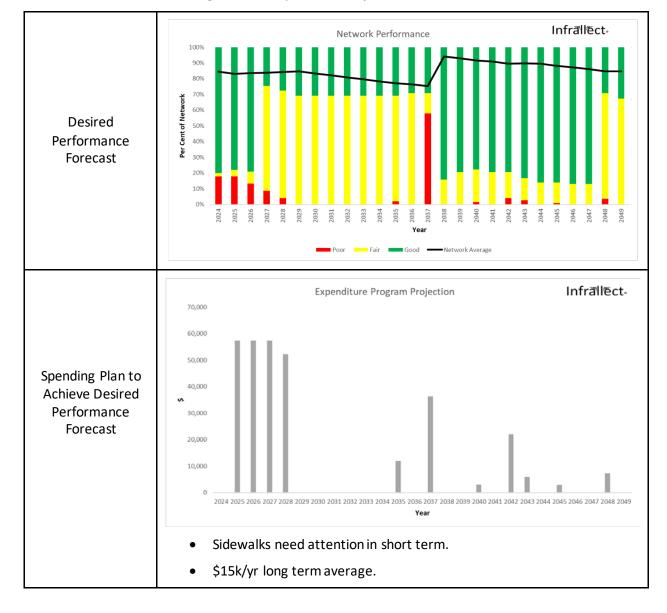


Figure 9: Transportation Performance Forecast

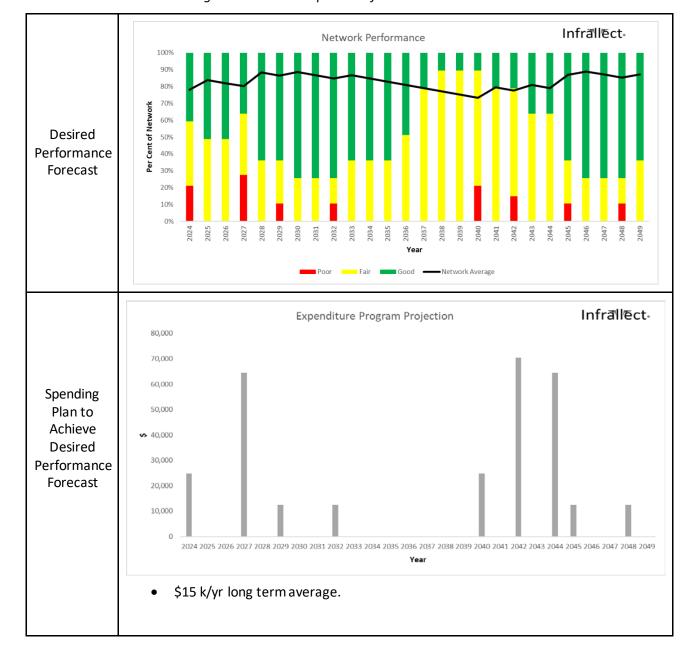


Figure 10: Waste Disposal Performance Forecast



Infrällect. Network Performance 100% 90% Per Cent of Network 60% Desired Performance 40% **Forecast** 30% 10% Fair Good ——Network Average Infrällect. Expenditure Program Projection 80,000 70,000 60,000 50,000 Spending Plan to Achieve **4**0,000 Desired 30,000 Performance **Forecast** 20,000 10,000 2024 2025 2026 2027 2028 2029 2030 2031 2032 2033 2034 2035 2036 2037 2038 2039 2040 2041 2042 2043 2044 2045 2046 2047 2048 2049 \$20 k/yr long term average.

Figure 11: Fire Services Performance Forecast



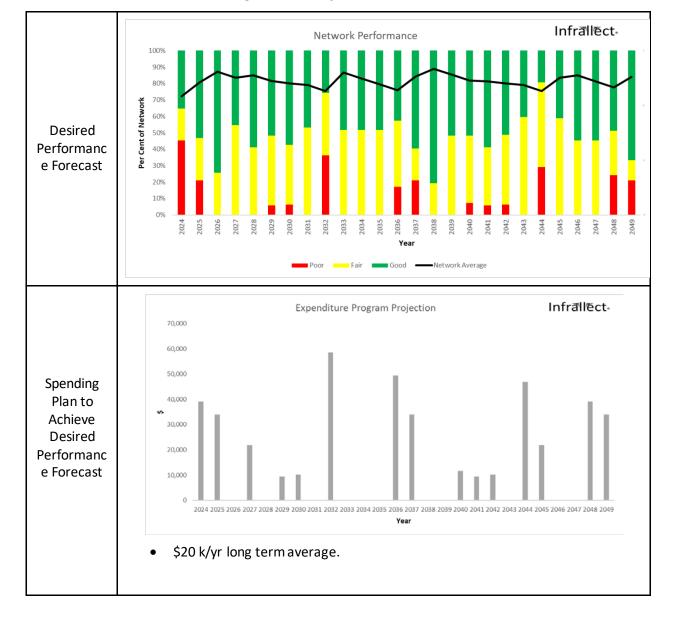


Figure 12: IT Performance Forecast



Figure 13 shows the combined spending plan. An average of \$1.2 million (in 2024 \$) per year over the long term is required to achieve the Township's desired asset performance expectations.

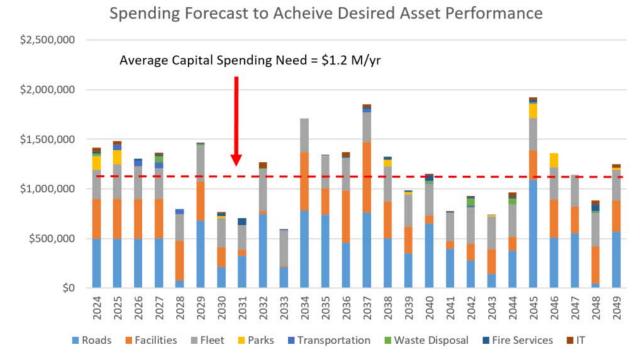


Figure 13: Combined Expenditure Forecast to Achieve Desired Asset Performance

4.4 Funding Gap Summary

The analysis demonstrates that average spending levels of approximately \$1.2 million are required to achieve desired asset performance expectations over the long term for all asset groups. The long-term funding needs are generally consistent with recent capital spending levels. However, grants from the Provincial/Federal government have funded portions of this spending. Continued receipt of unconditional Provincial grants will ensure sufficient revenues are available to fund the long-term infrastructure needs in the community.

The current performance of assets and performance forecasts are updated on a continual basis to reflect new information or changing organizational performance objectives or requirements.



4.5 Risk Management

The approach to managing risk in this AMP is to consider the overall criticality of each asset related to the role it plays in providing services to the community (by understanding the required performance of each asset based on its location, function, size, etc.). This understanding establishes when an asset is not meeting its objectives or requirements based on the available technical performance indicators and subject matter expert judgement. Assets that are more critical have higher performance expectations, while less critical assets have lower performance expectations.

4.6 Managing Climate Change

The expected impacts of climate change have been considered and included throughout the analysis in this AMP. This includes consideration of climate change when establishing the current performance of an asset, forecasting the performance deterioration rate of an asset, or establishing the lifecycle activities completed on an asset.

The most prominent climate impacts on the Township's tax-support infrastructure are severe wet weather events and forest fire risk:

Climate Impact 1 - Severe Wet Weather Events

There are some localized areas of the Township where roads flood during severe wet weather or spring flood events. However, bridges in the Township are owned by Renfrew County and therefore any issues related to creek flooding events are not managed by Madawaska Valley. The Township should continue to monitor areas of localized flooding during severe wet weather or spring flood events.

The Township should ask developers to consider climate change in their designs for stormwater management, which may result in larger areas for stormwater ponds or other infrastructure design changes.

Climate Factor 2 – Forest Fires

The magnitude of risk increase for forest first expected from the changing climate is uncertain. The Canadian Climate Atlas indicates that the number of heat waves in the community is expected to increase from a historical average of 1 per year to a future average of 2.5 per year, however the number of dry days is expected to remain constant at approximately 201 per year. The Township's forest fire risk management plan should understand the relationship between forest fire risk and relevant climate factors such as heat waves or dry days to understand the expected impacts of climate change on forest fire risk.

¹ https://climateatlas.ca/map/canada/hwnum 2030 45#z=9&lat=44.99&lng=-77.73&grid50k=031F05



5 FINANCING STRATEGY

There are several options that the Township uses to financing their expenditures:

- Provincial/Federal Government specific conditional grants one-off grants to rehabilitate
 existing or build new infrastructure. This is challenging for financial planning processes due to
 the ad-hoc nature of these programs.
- Provincial Government unconditional grants annual grants provided by the Ontario
 government using a funding formula approach. This reliable funding stream allows for confident
 financial planning, but can have certain rules around what the money can be spent on or when it
 can be spent by.
- Internal Financing internal transfers from reserves to fund projects. This can have more flexibility than external debt since the Township can set their own repayment terms.
- Debt borrow money to fund large infrastructure improvement projects. This is challenging due to the limited options available, but does allow the Township to build more infrastructure in a shorter time period.
- Development Charges raise funds on each lot developed. This requires a Development Charges Background Study and a new bylaw.
- User Fee Increases increase costs paid by users of Township services, amenities or facilities.
- Tax Levy fund the spending increases through the Tax Levy. For perspective, in 2024 an additional \$47,000 in spending would result in a 1% increase to the Tax Levy.

The Township uses a number of these options to finance the capital program. If unconditional Provincial grants continue to increase with inflation pressures then the Township should have sufficient revenue to maintain the performance of their current infrastructure portfolio over the long term.

The objective of the Township's financing strategy for these projects should be to maximize new assessment growth at the lowest real cost impact to tax payers (i.e. maximize net revenue growth, minimize tax levy or user fee increases). This would prioritize the following options:

- Provincial/Federal Government Grants
- 2. Internal Financing using Reserves
- 3. Debt
- 4. Development Charges
- 5. Tax Levy/User Fee Increases

Future budgets will present the optimal balance of the available financing options to fund the Township's desired infrastructure program.



6 DISCUSSION AND NEXT STEPS

This AMP represents the tactical output of a corporate management system. The corporate management system is the series of interconnected processes that work together to realize value from assets. This AMP uses the best available asset and financial information. The AMP is a living document that requires periodic updates to reflect new information and changing community priorities.

6.1 Monitoring Asset Performance

Moving forward, Provincial Regulation requires the Township to provide an annual update on the progress of the AMP. The practical steps to complete these activities are as follows:

- 1. Each year, update the asset inventory with the best available asset data. This adds/removes assets as appropriate.
- 2. Each year, update current asset performance based on the best available information.
- 3. Each year, update the spending analysis to record completed spending, and to connect planned spending to assets or asset networks.

These three steps enable updates the forecast performance versus spending analysis. Over time, the Township will be able to see connections between the changing performance distribution and annual spending levels. This will increase the confidence of the Township's AMPs each year.

6.2 Roadmap for Enhancing Asset Management Processes

The following points provide a roadmap to enhance asset management planning processes in the Town:

- 1. Continue to maintain the inventory of all assets owned. Asset inventories should be comprehensive of all assets in an asset network.
- 2. Continue to strengthen the connection between actual or planned spending and specific assets (or asset networks). This will provide greater line of sight from the current or planned spending and the resulting performance improvement in an asset or asset network.
- 3. Continue to strengthen the quality of asset-centric performance indicator data that is available to measure the current performance of assets and asset networks.
- 4. Engage the community to understand their current perspective on the performance of assets and asset networks. This understanding calibrates the current performance of the asset networks and prioritizes the allocation of funding to improve the performance of asset networks relative to community expectations.



Appendix A – Performance Metrics

| O. Reg. 588/ | /17 Additional Metrics | | |
|---------------------------|--|---|---|
| Asset Group | Metric | Result | Comment |
| Roads | Road network in the municipality and its level of connectivity | Roads of various classifications exist through the Township and connect our community. | |
| Roads | Description of the different levels of road class pavement condition | Township has Hot Mixed Paved, Surface Treated and Gravel roads. Surface condition ranges from like-new to fully distressed. | |
| Roads | # of lane-kilometres of arterial roads as a proportion of square kilometres of land area of the municipality. | 0 | 2019 Road Needs Study (RNS) vs Area of 672km2 |
| Roads | # of lane-kilometres of collector roads and local roads as a proportion of square kilometres of land area of the municipality. | 0.00005 | 2019 RNS vs Area of 672km2 |
| Roads | # of lane-kilometres of local roads as a proportion of square kilometres of land area of the municipality | 0.003 | 2019 RNS vs Area of 672km2 |
| Roads | Average pavement condition index for paved roads | 70.5 | 2019 RNS |
| Roads | Average surface condition (e.g. excellent, good, fair or poor) for unpaved roads | Fair | 2019 RNS |
| Stormwater Management | User groups or areas of Madawaska Valley that are protected from flooding, including the extent of the protection provided by the municipal stormwater management system | Some urban areas protected from flooding through urban ditch system or underground storm collection, some with defined outlets. Most rural areas protected from flooding through provision of municipal drains or rural ditch systems, some with defined outlets. | |
| Stormwater Management | Percentage of properties in municipality resilient to a 100-year storm | 100% | Reslience is defined as the ability to recover to pre-even performance after an event/shock/storm occurs. |
| Stormwater Management | Percentage of the municipal stormwater management system resilient to a 5-year storm | 100% | Reslience is defined as the ability to recover to pre-even performance after an event/shock/storm occurs. |
| Roads | Average Age | 28 Years | |
| Facilities | Average Age | 30 Years | |
| Fleet | Average Age | 15 Years | |
| Parks | Average Age | 17 Years | |
| Transportation | Average Age | 21 Years | |
| Waste Disposal | Average Age | 22 Years | |
| Fire Services | Average Age | 7 Years | |
| Information Technology | Average Age | 10 Years | |



Appendix B – Asset Inventories

| Doods | | | | | | | | | l | |
|----------|-----------------|--|---|---------------|----------------------------|--------------|----------|--------------|---------------|-----------------------------------|
| Roads | | | | Length | \$88,841,458 2024 | Updated | 28 | Construction | 2024 | |
| Index | Sect. No. | Road Name | Location - From, to | (km) | Replacement Cost | Rating (100) | Age | Year | Performance | Performance Score Rationale |
| 1 2 | OPE1 OPE2C | Opeongo Line Opeongo Road East Wilno | Hwy 60 Connecting Link Krezel Road to 911-11761 | 1.37 0.97 | \$635,679 \$264,773 | 96 89 | 29 | 1993 2004 | 1.00 0.58 | \$353k in 2023 |
| 3 | MAS1A | Mask Island Drive | Island Lane & Cemetery Lane | 0.25 | \$77,506 | 87 | 18 25 | 1997 | 0.62 | |
| 5 | PAU1B1 PET3 | Paugh Lake Road Peter Street North | 911-2337 to Wilno North Peter Street-to-911-15 End | 1.90 0.70 | \$722,266 \$249,241 | 100 87 | 36 7 | 1986 2015 | 0.87 0.57 | Done in 2020 |
| 6 | OPE2B | Opeongo Road East Wilno | Hwy 60 to Krezel Road | 0.80 | \$237,498 | 86 | 25 | 1997 | 0.53 | |
| 7 8 | OLD1A BAY1C | Old Barry's Bay Road Bay Street | From Hwy 60 to 911-1697 Lakeshore Drive To Queen ST | 10.10 0.23 | \$3,502,394 \$89,283 | 86 85 | 18 29 | 2004 1993 | 0.65 0.56 | |
| 9 | OLD1B | Old Barry's Bay Road | 911-1697 to Burbidge Lane | 3.45 | \$1,211,234 | 85 | 18 | 2004 | 0.54 | |
| 10 | OLD1C HOP1 | Old Barry's Bay Road Hopefield Road | From Burbidge Lane to Combermere Rd Old Barry's Bay Rd-Dombroskie Rd | 5.20 1.40 | \$1,795,326 \$426,578 | 85 84 | 18 15 | 2004 2007 | 0.56 0.02 | |
| 12 | MIT1 WIL5B | Mitchell Road Wiloski Drive | Hwy 60-to-911-782 End From 911- 855 to End | 0.90 3.15 | \$269,035 \$1,064,670 | 83 83 | 29 | 1993 2000 | 0.49 | e00 l |
| 13 14 | ONT1 | Ontario Street | Ohio Road-to-911-224 End | 0.13 | \$34,048 | 82 | 22 15 | 2007 | 0.81 0.49 | \$88 k refurb in 2021 |
| 15 16 | DOM1 MIS1 | Dombroskie Road Mission Road | Hopefield Road-to-911-962 Mill Street to 911-65 End | 1.17 0.30 | \$323,944 \$85,779 | 82 82 | 35 32 | 1987 1990 | 0.45 0.46 | |
| | PER1 | Perrier Road | Dafoe Road-to-Mullen Road - Hastings | 2.40 | \$658,261 | 82 | | 1987 | | |
| 17 | ARE1 | Arena Road | Cty Border Hwy 60-to-911-65 | 0.26 | \$103,928 | 81 | 35 15 | 2007 | 0.59 | |
| 19 | CYB1A1 | Cybulski Road | Pioneer Road to 911-889 Siberia Road-to-Wiltom Drive & Weglarz | 2.40 | \$650,379 | 81 | 36 | 1986 | 0.44 | |
| 20 | MAT1 | Matcheski Road | Road | 2.05 | \$609,992 | 80 | 32 | 1990 | 0.51 | |
| 21 | TAM1 WIL6 | Tamarack Road Wiltom Drive | Chippawa Road-to-911-966 End Matcheski Road-to-911-336 End | 2.32 1.67 | \$672,372 \$480,701 | 80 80 | 32 25 | 1990 1997 | 0.50 0.48 | |
| 23 | RIV1 | Riverside Drive | Palmer Road-to-Palmer Road | 1.80 | \$501,871 | 79 | 36 | 1986 | 0.46 | |
| 24 25 | WIL3B LEP1 | Wilno North Road Lepinski Road | 911-1344 to Murak Flis Rd Old Barry's Bay Road-to-Hwy 60 | 1.00 0.15 | \$313,125 \$45,418 | 79 78 | 39 18 | 1983 2004 | 1.00 0.41 | \$523k in 2023 |
| 26 | SPE1A | Spectacle Lake Road | Hwy 60 front portion maintained by | 1.28 | \$395,536 | 78 | 50 | 1972 | 0.41 | |
| | WEG1A | Weglarz Road | South Algonquin Matcheski Rd & Wiltom Drive-to-911-440 | 0.13 | \$35,734 | 78 | | 2004 | | |
| 27 | | | to End maintained portion Siberia Road-to-end of pavement @911- | | | | 18 | | 0.37 | |
| 28 | BIE2A | Biernacki Mountain Road | 300 | 2.48 | \$731,565 | 77 | 29 | 1993 | 0.43 | |
| 29 | BRA2 | Billings Street | Stafford Street-to-end of pavement 911- 17 | 0.06 | \$20,457 | 77 | 25 | 1997 | 0.37 | |
| 30 31 | WIL3C WIL3D | Wilno North Road Wilno North Road | Winnie Rd to start of pavement Start of pavement to Paugh Lake Rd | 6.16 1.50 | \$1,889,421 \$429,881 | 77 77 | 35 15 | 1987 2007 | 0.69 0.34 | |
| 32 | BLA1 | Blackfish Bay Road | Combermere Road-to-911-259 AB | 1.28 | \$362,592 | 76 | 18 | 2004 | 0.35 | |
| 33 34 | ARB1C CHI2 | Arbor Vitae Road Chippawa Road | Chris Mullen - End at 911-796A Combermere Road-to-911-873 End | 1.82 2.40 | \$494,399 \$658,194 | 76 76 | 29 29 | 1993 1993 | 0.40 0.95 | \$36k in 2022 |
| 35 | THE1 | Theresa Trail | Bleski Road-to-91-36 End | 0.17 | \$47,826 | 75 | 39 | 1983 | 0.38 | |
| 36 37 | AIR1A BLE1A | Airport Road Bleski Road | Hwy 60 to 911-1368 Kartuzy Rd-911-157 | 0.80 | \$244,284 \$235,966 | 75 75 | 18 36 | 2004 1986 | 0.34 | |
| 38 | FRA1 | Fran-Stell Drive | Rockingham Road-to-911-80 End | 0.40 | \$107,368 | 75 | 15 | 2007 | 0.29 | |
| 39 40 | PAU1A WIL3A | Paugh Lake Road Wilno North Road | Hwy 60 to 911-443 Hwy 60 to 911-1344 | 2.20 1.20 | \$833,498 \$392,822 | 100 75 | 25 22 | 1997 2000 | 0.87 0.32 | \$336k in 2021 |
| 41 | BAS1 | Basin Depot Road | KHR border-Gunn&Turners Rds-to-Camp Edlau Lane | 1.00 | \$330,034 | 74 | 35 | 1987 | 0.68 | |
| 42 | LAK2 | Lakeshore Drive | Combermere Road-to-Bay Street | 0.90 | \$315,902 | 74 | 29 | 1993 | 0.53 | |
| 43 | OAK1 | Oak Street | Turnaround-to-911-56 Combermere Road-to-911-926 Hastings | 0.20 | \$64,879 | 74 | 29 | 1993 | 0.52 | |
| 44 | OHI1 PIN2 | Ohio Road | County Border | 4.50 | \$1,286,560 \$50,965 | 74 | 15 | 2007 | 0.32 | |
| 45 46 | WAS1 | Pinecrest Avenue Waska Way | Sandhill Drive-to-911-38 Hwy 60 to End | 0.20 | \$72,058 | 74 74 | 36 32 | 1986 1990 | 0.35 0.28 | |
| 47 | СНАЗВ | Chapeski Mill Drive | Into #704 - Chapeskie Mill drive to turnaround @ gate | 0.35 | \$130,663 | 73 | 35 | 1987 | 0.61 | |
| 48 | COV1 | Coveleski Street | Biernacki Street-to-911-39 | 0.15 | \$50,331 | 73 | 18 | 2004 | 0.29 | |
| 49 50 | CYB1A HIL1 | Cybulski Road Hildebrandt Street | Hildebrandt Street-to-Pioneer Road Paugh Lake Road-to-911-124 Dead End | 2.00 0.62 | \$578,317 \$166,420 | 73 73 | 18 39 | 2004 1983 | 0.31 | |
| 51 52 | LON1A SUN2 | Long Lake Road | Combermere Road-to-911-682 | 3.41 | \$906,448 \$745,127 | 73 73 | 22 | 2000 | 0.27 | |
| 53 | CON2 | Sunny Hill Road Conway Street | Siberia Road-to-911-532 Hwy 60-to-Inglis Street | 2.60 0.13 | \$50,186 | 72 | 29 29 | 1993 1993 | 0.48 | |
| 54 55 | DRO1 HOP3 | Drohan Street Hopefield Road | Hwy 60-to-Peter Street Kuiack Lake Rd-Opeongo Rd | 0.30 2.63 | \$115,335 \$782,650 | 72 72 | 32 22 | 1990 2000 | 0.48 -0.17 | On RNS 1-5 yr list, not done yet |
| 56 | MIN1 | Mintha Street | Hwy 60-to-911-104 End | 0.45 | \$153,006 | 72 | 22 | 2000 | 0.27 | Off RNS 1-5 yr list, not done yet |
| 57 58 | PAU1B PAU1B2 | Paugh Lake Road Paugh Lake Road | 911-443 to 911-2337 Wilno North to Basin Depot Road | 9.10 11.84 | \$2,925,612 \$3,723,611 | 100 72 | 29 32 | 1993 1990 | 0.91 0.67 | Done in 2020 |
| 59 | PEC1 | Pecarski Road | Hwy 60-to-911-148 End | 0.74 | \$233,159 | 72 | 35 | 1987 | 0.67 | |
| 60 61 | STA2 UPP1 | Stafford Street Upper Rosenthal Road | County Road 62 to Inglis Street Jewellville Road-to-Guiney Road | 0.25 4.50 | \$102,951 \$1,362,777 | 72 72 | 29 35 | 1993 1987 | 0.23 | |
| 62 | WAL2 | Walker Street | Old Barry's Bay Road-to-911-190 | 0.25 | \$83,420 | 72 | 36 | 1986 | 0.50 | |
| 63 | DOV1 | Dovetail Road | Rockingham Road-to-Prince Road 911- 192 | 0.90 | \$266,089 | 71 | 35 | 1987 | 0.65 | |
| 64 65 | KAR2B LOW1 | Kartuzy Road Lower Craigmont Road | 2.0km from start To End From Dafoe Rd - for 1.4 km | 3.40 1.40 | \$974,206 \$375,788 | 71 71 | 15 32 | 2007 1990 | 0.23 0.44 | |
| 66 | SCH1 | Schweig Road | Combermere Road-to-911-172 End | 0.83 | \$216,373 | 71 | 35 | 1987 | 0.69 | |
| 67 68 | BAY1B BEA2 | Bay Street Beanish Street | Queen ST To CR 62 Casey Street-to-911-20 | 0.25 0.10 | \$93,259 \$37,296 | 70 70 | 15 23 | 2007 1999 | 0.15 0.20 | |
| 69 | FAR1 | Farmer Road | Mill Street-to-Renfrew County Road 62 | 0.43 | \$151,183 | 70 | 29 | 1993 | 0.30 | |
| 70 71 | HOP2 KIT1 | Hopefield Road Kitts Street | Dombroskie Rd-Kuiack Lake Rd Bay Street-to-Dunn Street | 2.23 0.09 | \$646,226 \$36,325 | 70 70 | 25 9 | 1997 2013 | -0.26 0.35 | On RNS 1-5 yr list, not done yet |
| 72 | OLS2 | Olsheski Service Road | Hwy 60-to-911-29 End | 0.14 | \$47,140 | 70 | 15 | 2007 | 0.16 | |
| 73 | PIN1 | Pine Cliff Road | Renfrew County Road 62-to-Bobolink Lane | 0.47 | \$123,714 | 70 | 15 | 2007 | 0.18 | |
| 74 | AIR1B | Airport Road | from 911-1368 to 1487 (1 to 126) Lower Craigmont Road-to- | 0.32 | \$89,222 | 69 | 39 | 1983 | 0.14 | |
| 75 | MAI1 | Maika Road | Malovic Lane | 0.63 | \$180,928 | 69 | 15 | 2007 | 0.20 | |
| 76 77 | MIL1 PET1 | Mill Street Peter Street | Combermere Road-to-Farmer Road Paugh Lake Road-to-911-99 End | 0.35 0.41 | \$116,937 \$161,912 | 69 69 | 32 15 | 1990 2007 | 0.29 0.17 | |
| 78 | PET2 | Peterson Place | Palmer Road-to-911-46 End | 0.22 | \$60,771 | 69 | 27 | 1995 | 0.64 | |
| 79 80 | ROC3 CAM1 | Rocky Ridge Road Cameron Track Road | Stanley Olsheski Road-to-911-148 Hwy 60-to-911-294 End | 0.74 1.46 | \$205,847 \$420,312 | 69 68 | 27 19 | 1995 2003 | 0.65 0.60 | |
| 81 | COU3 ISL1 | Country Forest Lane | Airport Road-to-911-150 End | 0.74 0.35 | \$218,784 \$115,605 | 68 68 | 35 | 1987 1997 | 0.60 | 77k in 2022 |
| 82 | KEL1 | Island Lane Kelly Street | Lakeshore Drive-to-Mask Island Dr. Hwy 60/Opeongo Line-to-Paugh Lake | 0.35 | \$115,605 | 68 | 25 | 1997 | 0.95 | 77k in 2022 |
| 83 84 | LON1B | Long Lake Road | Road 911-682-to-911-753 | 0.46 | \$78,778 | 68 | 29 35 | 1987 | 0.31 | |
| 85 | MAS1B | Mask Island Drive | Causeway end for 100m | 0.10 | \$31,314 | 68 | 35 | 1987 | 0.63 | |
| 86 87 | PAR1A PRI1 | Parcher Road Prince Road | Chippawa Road-to-911-150 911-501-to-Brudenell Twp. Boundary | 0.74 1.61 | \$210,160 \$447,857 | 68 68 | 35 35 | 1987 1987 | 0.95 0.64 | \$54k in 2022 |
| 88 | SAN1 SMA1 | Sandhill Drive | Opeongo Line-to-Yantha Crescent | 0.83 | \$311,033 | 68 | 36 | 1986 | 0.33 | dono in 2020 f 6272 ; |
| 89 90 | SPR1 | Smaglinski-Stoppa Pkway Sprucedale Avenue | Wilno North Road-to-Hwy 60 Sandhill Drive to 911-48 | 3.52 0.25 | \$1,115,777 \$79,302 | 100 68 | 25 36 | 1997 1986 | 0.89 | done in 2020 for \$272 k |
| 91 92 | SPR2 STA1 | Sprucedale Avenue Stafford Street | From 911-48 to Lakeview Parkway Lakeshore to County Road 62 | 0.25 0.40 | \$79,302 \$134,824 | 68 68 | 22 29 | 2000 1993 | 0.13 0.29 | |
| | STA4 | Stafford Street Stanley Olsheski Road | Old Barrys Bay Rd-Dam Lake intersection | 0.40 | \$134,824 | 68 | | 1993 | | |
| 93 | | | , - = , = ann cane mensection | 2.45 | | 3-0 | 35 | -507 | 0.95 | \$117k in 2022 |

| | T | T | I (4. 445) OUD | 1 | | ı | T | I | | |
|------------|-----------------|--|--|--------------|--------------------------|-----------|----------|--------------|----------------|------------------------------|
| 94 | WIL1 | William Street | (1 to 115) Old Barry's Bay Road-to-911- 115 end | 0.13 | \$44,388 | 68 | 36 | 1986 | 0.33 | |
| 95 96 | BLE1B FRA2 | Bleski Road Frank Street | from 911-157 to End Peter St to End | 0.60 | \$163,366 \$49,536 | 68 67 | 27 15 | 1995 2007 | 0.19 0.11 | |
| | KED1 | Kedroski Road | Chapeski Mill Dr &Yandreski Rd-to-911- | 0.58 | \$153,453 | 67 | | 1987 | | |
| 97 98 | LEH1 | Lehovitch Road | 124 Dead End Old Barry's Bay Road-to-911-277 | 1.39 | \$383,959 | 67 | 35 35 | 1987 | 0.64 | |
| 99 | MUR3 | Murray Park Street | Paugh Lake Road-to-911-96 End | 0.48 | \$129,157 | 67 | 32 | 1990 | 0.15 | |
| 100 | OLS1 RIT1 | Olsheski Road Ritza Road | Old Barry's Bay Road-to-911-394 Old Barry's Bay Road-to-911-36 End | 1.96 0.10 | \$503,338 \$25,680 | 67 67 | 35 27 | 1987 1995 | 0.63 | |
| 102 | SER1 | Serran Road | Dafoe Road-to-911-102 End | 0.45 | \$124,303 | 67 | 27 | 1995 | 0.65 | |
| 103 | TUR1 CAS1 | Turners Road | KHR Twp-Burns Twp Border-to-Gunns Rd | 0.15 | \$54,838 \$201,070 | 67 | 27 32 | 1995 | 0.64 | |
| 104 105 | CYB1B | Casey Street Cybulski Road | Siberia Road-to-911-133 End 911-889 TO Zaluska Coulas RD | 0.60 1.34 | \$375,354 | 66 66 | 35 | 1990 1987 | 0.61 | |
| 106 | GRU1 | Grunwald Road | Old Barry's Bay Road-to-911-274 End | 1.37 | \$431,659 | 66 | 27 | 1995 | 0.63 | |
| 107 | KUR1 LOE2 | Kurelek Road Lower Craigmont Road | Palmer Road-to-911-120 End 1.4km to end-turnaround | 0.58 2.40 | \$162,467 \$709,571 | 66 66 | 35 27 | 1987 1995 | 0.64 | |
| 109 | PIN1X | Pine Cliff Road | Bobolink Lane-to-911-162 End | 0.31 | \$93,459 | 66 | 35 | 1987 | 0.64 | |
| 110 111 | RUB1 STA3X | Rubyville Road Stanley Olsheski Road | Combermere Road-to-911-120 from Dam Lake intersection to End | 0.55 3.65 | \$155,131 \$1,064,959 | 66 66 | 27 32 | 1995 1990 | 0.63 | |
| 112 | ANN1 | Annie Mayhew Road | Maika Road-to-911-130 | 0.62 | \$161,586 | 66 | 15 | 2007 | 0.09 | |
| 113 114 | ARB1A BIE1 | Arbor Vitae Road Biernacki Street | Hwy 60- Chris Mullen Siberia Road-to-911-45 | 1.90 0.27 | \$509,998 \$96,481 | 100 65 | 18 36 | 2004 1986 | 0.88 | Resurface for \$226k in 2021 |
| 115 | CAR1 | Carmel Hill Road | Dafoe Road-to-911-114 end | 0.56 | \$167,742 | 65 | 35 | 1987 | 0.60 | |
| 116 | CEM1 CYB1C | Cemetery Lane | Siberia Road-to-Island Drive Lane | 0.27 | \$88,951 \$57,188 | 65 | 22 | 2000 | 0.06 | |
| 117 118 | DAM1X | Cybulski Road Dam Lake Road | Cybulski Road-into 911-661 AB 911-35-to-1.3km Length | 0.20 1.30 | \$374,250 | 65 65 | 27 35 | 1995 1987 | 0.59 | |
| 119 | DRE1 | Drevniok Road | Combermere Road-to-911-81AB | 0.38 | \$110,134 | 65 | 23 | 1999 | 0.65 | |
| 120 | MAH1 | Mahon Street | (1 to 23) Stafford Street-to-Ignatius Drive | 0.12 | \$43,123 | 65 | 15 | 2007 | 0.09 | |
| 121 | MIC1 | Micks Road | Dafoe Road-to-911-40 End | 0.20 | \$57,188 | 65 | 35 | 1987 | 0.58 | |
| 122 | OPE2D | Opeongo Road East Wilno | From 911-11775 to Wilno South Intersection | 6.05 | \$1,949,698 | 65 | 35 | 1987 | 0.57 | |
| 123 | PEP2 | Peplinskie Road | Dafoe Road-to-Bangor Township line | 1.08 | \$338,188 | 65 | 35 | 1987 | 0.58 | |
| 124 | QUE1 | Queen Street | Stafford Street-to-Dunn Street | 0.20 | \$71,786 | 65 | 29 | 1993 | 0.22 | |
| 125 | WIL2 | Wilno Street | Dunn Street-to-911-89 & Tower Hill Road | 0.39 | \$143,574 | 65 | 36 | 1986 | 0.38 | |
| 126 127 | ZIL1 CHA1 | Zilney Street Chanonhouse Road | Paugh Lake Road-to-911-78 End Long Lake Road-to-911-286 End | 0.39 1.42 | \$104,471 \$422,588 | 65 64 | 32 35 | 1990 1987 | 0.08 | \$107k in 2022 |
| 128 | CHA2A | Chapel Road | Kopernik Road-to-911-25 | 0.12 | \$35,479 | 64 | 35 | 1987 | 0.60 | |
| 129 | CHA4 | Chapeskie Road | Combermere Road-to-911-3052 End Peplinski Homestead Road-to-Paugh Lake | 0.26 | \$77,706 | 64 | 18 | 2004 | 0.06 | |
| 130 | ETM1 | Etmanski Road | Road | 1.28 | \$343,629 | 64 | 35 | 1987 | 0.63 | |
| 131 | MAR2 MAR3 | Martin Recoskie Road Martin Siding Road | Dam Lake Road-to-911 Hwy 60-to-Cybulski Road | 1.84 | \$526,134 \$598,651 | 64 64 | 35 32 | 1987 1990 | 0.63 | |
| 133 | STO1 | Stoppa Street | Paugh Lake Road-to-911-1534 End | 0.18 | \$53,567 | 64 | 27 | 1995 | 0.60 | |
| 134 | WER1 KUB1A | Wernham Road | Combermere Road-to-911-30 End | 0.12 | \$33,614 \$226,112 | 64 63 | 27 | 1995 | 0.59 | |
| 135 136 | LAK3 | Kubesheski Road Lakeview Parkway | Siberia Road-to-911-156 Sprucedale Avenue-to-911-100 End | 0.75 0.45 | \$139,379 | 63 | 35 25 | 1987 1997 | 0.59 | |
| 137 | MAR1 | Martin Street | Opeongo Line-to-911-20 | 0.11 | \$41,025 | 63 | 18 | 2004 | 0.07 | |
| 138 139 | MUL1B PAU1B3 | Mullen Road Paugh Lake Road | 911-216-to-Perrier Road Into 911-1217 | 1.00 0.15 | \$287,885 \$41,434 | 63 63 | 27 35 | 1995 1987 | 0.58 | |
| 140 | PAU1B4 | Paugh Lake Road | Into 911-1719AB | 0.10 | \$26,457 | 63 | 35 | 1987 | 0.61 | |
| 141 | SHA1 | Shalla Street | Smaglinski-Stoppa Parkway-to-911-14 End | 0.06 | \$16,690 | 63 | 32 | 1990 | 0.58 | |
| 142 | WIL5A | Wiloski Drive | from Paugh Lake Rd to 911-855 | 4.50 | \$1,759,500 | 100 | 29 | 1993 | 0.95 | \$282k in 2022 |
| 143 144 | ROC1 ARB1D | Rock Lane Arbor Vitae Road | 911-1 end-to-911-20 End Into 911-522 AB off of Arbor Vitae Rd | 0.30 0.11 | \$85,328 \$30,385 | 62 62 | 29 32 | 1993 1990 | -0.02 0.62 | |
| 145 | CHA3A | Chapeski Mill Drive | From 911-610 to 911-659 End | 2.54 | \$810,170 | 62 | 35 | 1987 | 0.61 | |
| 146 147 | LAN1A PEP1 | Lane Street Peplinski Homestead | Paugh Lake Road-to-911-50 Wilno North Road-to-Paugh Lake Road | 0.21 5.11 | \$67,944 \$1,530,647 | 62 62 | 29 35 | 1993 1987 | 0.03 | |
| 148 | PIO2 | Pioneer Road | From cemetery to 911-246 | 0.63 | \$174,025 | 62 | 27 | 1995 | 0.61 | |
| 149 | RUM1 WIG1A | Rumleski Road | 911-1-to-911-268 | 1.25 | \$340,431 \$354,468 | 62 62 | 35 | 1987 | 0.61 | |
| 150 | YAN1 | Wigry Road Yandreski Road | From Chippawa ChapeskiMillDr&Kedroski Rd-to-911- | 1.33 2.55 | \$783,639 | 62 | 35 | 1987 1995 | 0.63 | |
| 151 152 | PIO1 | Pioneer Road | 1660 -dead end Cybulski Road-to-cemetery | 0.60 | \$162,561 | 62 | 27 15 | 2007 | 0.27 | |
| 153 | KAR2A | Kartuzy Road | From Siberia Rd to 2.0km | 2.00 | \$571,692 | 61 | 25 | 1997 | 0.06 1.00 | \$277k in 2023 |
| 154 | CHA3 | Chapeski Mill Drive | Paugh Lk to 911 610 | 3.13 | \$900,954 | 100 | 18 | 2004 | 0.84 | \$382 k in 2021 |
| 155 156 | DAW1 JAC1 | Dawson Street Jackpine Street | Inglis Street-to-911-21 End Sprucedale Avenue-to-Sandhill Drive | 0.09 | \$29,993 \$76,245 | 61 100 | 29 29 | 1993 1993 | 0.00 | \$41k in 2021 |
| 157 | KAR1 | Karol Woytyla Street | Bay Street-to-Dunn Street | 0.20 | \$50,786 | 61 | 29 | 1993 | 0.01 | |
| 158 159 | KUI1A LOR1 | Kuiack Road Lorbetski Road | Wilno South Road-to-911-1376 Old Barry's Bay Road-to-#73 | 1.88 0.35 | \$519,312 \$96,680 | 61 61 | 35 27 | 1987 1995 | 0.59 | |
| 160 | MAD1A | Madawaska River Drive | (901 to 912) Ohio Road-to-911-912 | 0.06 | \$13,056 | 61 | 27 | 1995 | 0.63 | |
| 161 | MCP1 | McPhee Bay Road | Palmer Road-to-911-338 911-150-to-Bangor Twp Line - Hastings | 1.68 | \$457,539 | 61 | 35 | 1987 | 0.61 | |
| 162 | PAR1B | Parcher Road | Cty | 2.86 | \$834,461 | 61 | 35 | 1987 | 0.54 | |
| 163 164 | PLE1 SAI1 | Plebon Street St. Francis Memorial Dr | Sherwood Drive-to-911-20 End Siberia Road-to-911-52 End | 0.08 | \$20,544 \$96,093 | 61 61 | 27 15 | 1995 2007 | 0.63 -0.05 | |
| 165 | SZC1 | Szczipior Street | Wilno North Road-to-911-26 End | 0.17 | \$41,747 | 61 | 43 | 1979 | 1.00 | \$42k in 2023 |
| 166 | TRA1 | Trader Lane | Siberia Road-to-911-59 Renfrew County Road 62-to-Renfrew | 0.28 | \$82,783 | 61 | 27 | 1995 | 0.64 | |
| 167 | WHI2 | White Pine Crescent | County Rd 62 | 0.29 | \$107,493 | 61 | 29 | 1993 | 0.04 | |
| 168 | YAN2A | Yantha Crescent | Sprucedale Avenue-to-Sandhill Drive Wilno South Road-to-Burchat Street 911- | 0.22 | \$59,480 | 61 | 43 | 1979 | 0.01 | |
| 169 | BOR1 | Borutski Street | 30 | 0.14 | \$41,429 | 60 | 18 | 2004 | -0.02 | |
| 170 171 | BUR2 CUR1 | Burchat Street Curtiss Road | Hwy 60-to-911-74 Sunny Hill Rd to 91109 | 0.36 0.10 | \$101,205 \$27,099 | 60 60 | 18 32 | 2004 1990 | -0.01 -0.01 | |
| 171 | DAM1 | Dam Lake Road | Stanley Olsheski Road-to- 911-35 | 0.10 | \$70,345 | 60 | 32 18 | 2004 | 0.02 | |
| 173 | JEW1 MUR1 | Jewellville Road Murack-Flis Road | 911-589-to-Guiney Road Wilno North Road-to-911-424 End | 2.36 2.11 | \$761,925 \$644,325 | 60 60 | 35 | 1987 1987 | 0.64 | |
| 174 175 | MUR1 NOR1 | Norlock Road | 911-1 across Cybulski Road-to-911-208 | 1.10 | \$314,536 | 60 | 35 35 | 1987 | 0.54 0.62 | |
| 176 | PHI1 | Philip Street | Paugh Lake Road-to-911-41 | 0.13 | \$38,409 | 60 | 29 | 1993 | -0.05 | |
| 177 178 | STA3 ZAL1 | Stafford Street Zaluska Road | Inglis Street to Opeongo Line Cybulski Road-to-911-130 dead end | 0.15 0.65 | \$53,093 \$168,186 | 60 60 | 15 35 | 2007 1987 | -0.09 0.56 | |
| 179 | MUL1A | Mullen Road | Combermere Road-to-911-65 | 0.40 | \$115,154 | 59 | 27 | 1995 | 0.33 | |
| 180 181 | OPE4 STE2 | Opeongo Square Steffan Road | Opeongo Line-to-Stafford Street Chapeski Mill Drive-to-911-173 | 0.11 0.85 | \$44,742 \$226,540 | 59 59 | 25 35 | 1997 1987 | -0.07 0.31 | |
| 182 | THI1 | Third Street | Paugh Lake Road-to-Rock Lane | 0.07 | \$17,988 | 59 | 29 | 1993 | -0.08 | |
| 183 | TRE1 | Trebinski Road | Paugh Lake Road-to-911-396 End | 1.97 | \$551,826 | 59 | 35 | 1987 | 0.03 | |
| 184 | VIS1 | Vistula Road | (1 to 190) Old Barry's Bay Road-to-911- 190 End | 0.94 | \$259,656 | 59 | 35 | 1987 | 0.61 | |
| 185 | AIR1C CRA1A | Airport Road | from 911-1487-1554 | 0.51 | \$152,467 | 58 | 35 | 1987 | 0.45 | |
| 186 | | Cranberry Creek Road | Wilno North Road-to-911-150 1.3km from 911-35-to-911-614 | 0.74 | \$198,660 | 58 | 35 | 1987 | 0.28 | |
| 187 | DAM1X | Dam Lake Road | Turnaround | 1.50 | \$376,466 | 58 | 35 | 1987 1987 | 0.34 | |
| 188 189 | FIN1A YER1A | Finch Road Yeretch Road | Palmer Road-to-911-426 Airport Road-to-911-118 | 2.13 0.58 | \$613,194 \$155,707 | 58 58 | 35 35 | 1987 1987 | 0.30 | |
| | COU1 | CoulasRd(boundaryBangor | Dafoe Road-to-Raglan Township 911-#47 | 0.83 | \$235,720 | 57 | | 1987 | | |
| 190 | 1 | Twp) | | | | | 35 | | 0.14 | |

| | | | , | | | , | | | | |
|-----|-------|-----------------------|--|------|-------------|-----|----|------|-------|----------------------------------|
| 191 | COU2 | Coulas Road | Cybulski Road-to-911-726 dead end | 1.12 | \$305,026 | 57 | 35 | 1987 | 0.33 | |
| 192 | ING1 | Inglis Street | Stafford to Dunn St | 0.25 | \$84,877 | 57 | 15 | 2007 | -0.09 | 6-10 yr RNS need |
| 193 | ING2 | Inglis Street | Dunn St. to End | 0.25 | \$82,109 | 57 | 29 | 1993 | -0.13 | 6-10 yr RNS need |
| 194 | SHE1 | Sherwood Drive | Hwy 60-to-911-26 End | 0.12 | \$33,218 | 57 | 36 | 1986 | -0.10 | |
| 195 | LUC1 | Luckovitch Road | Old Barry's Bay Road-to-911-126AB End | 0.60 | \$8,662,180 | 56 | 35 | 1987 | 0.30 | |
| 196 | SKI1 | Skidder Trail Road | Stanley Olsheskie Rd-End | 0.27 | \$67,764 | 56 | 31 | 1991 | 0.44 | |
| 197 | YAK1 | Yakabuski Road | Siberia Road-to-911-216 End | 0.60 | \$179,724 | 56 | 27 | 1995 | 0.37 | |
| 198 | BAB1 | Babinski Road | Siberia Road-to-911-354 | 1.77 | \$530,185 | 55 | 35 | 1987 | 0.58 | |
| 199 | DIA1 | Diamond Lake Road | Rockingham Road-to-911-286 | 1.30 | \$359,099 | 55 | 35 | 1987 | 0.44 | |
| 200 | KOP1 | Kopernik Road | Hopefield Road-to-Old Barry's Bay Road | 1.64 | \$437,088 | 55 | 35 | 1987 | 0.60 | |
| 201 | KOW1 | Kowal Road | Dafoe Road-to-911-110 End | 0.54 | \$158,605 | 55 | 27 | 1995 | 0.39 | |
| 202 | KRE1 | Krezel Road | Hwy 60-to-Opeongo Road | 0.84 | \$240,191 | 55 | 35 | 1987 | 0.32 | |
| 203 | NEE1 | Needham Street | Bay Street-to-911-89 | 0.35 | \$114,776 | 55 | 29 | 1993 | -0.11 | On RNS 1-5 yr list, not done yet |
| 204 | STA4 | Stans Cottage Road | Palmer Road-to-911-68 End | 0.24 | \$71,423 | 55 | 35 | 1987 | 0.38 | |
| 205 | CAR3 | Carson Grove Road | Carson Heights Road-to-911-62 End | 0.30 | \$94,524 | 54 | 27 | 1995 | 0.45 | |
| 206 | CHI3 | Chippawa Road | 911-873 to End | 0.50 | \$145,885 | 54 | 27 | 1995 | 0.46 | |
| 207 | MUR2 | Murray Drive | Rock Lane-to-911-22 | 0.33 | \$84,491 | 54 | 29 | 1993 | -0.03 | |
| 208 | OPE3 | Opeongo Road West | Hwy 60 West to Hwy 60 | 2.12 | \$552,663 | 54 | 27 | 1995 | 0.32 | |
| 209 | CHR1 | Chris Mullin Lane | Arbor Vitae Road-to-911-112 End | 0.51 | \$143,849 | 52 | 27 | 1995 | 0.33 | |
| 210 | KUI2A | Kuiack Lake Road | Hopefield Road-to-911-178 | 0.88 | \$234,535 | 52 | 35 | 1987 | 0.45 | |
| 211 | MAD1B | Madawaska River Drive | (912 to 936) 911-912-to-911-936 end | 0.11 | \$27,180 | 52 | 27 | 1995 | 0.42 | |
| 212 | BRO1A | Brotton Road | Peplinski Homestead Road to End | 0.35 | \$71,255 | 50 | 27 | 1995 | 0.29 | |
| 213 | TIL1 | Tilleman Road | Palmer Road-to-Kunkle Lane | 0.61 | \$183,904 | 50 | 35 | 1987 | 0.04 | |
| 214 | CAR4 | Carson Heights Road | Hwy 60-to-911-148 End | 0.75 | \$230,482 | 49 | 27 | 1995 | 0.14 | |
| 215 | GRO1 | Grouse Road | Brudenell boundary 911-39-to-911-508 Dead End | 2.11 | \$562,352 | 48 | 35 | 1987 | 0.35 | |
| 216 | ZAP1 | Zappa Road | Old Barry's Bay Road-to-911-288 End | 1.43 | \$367,231 | 48 | 27 | 1995 | 0.36 | |
| 217 | KOS1 | Kosnaski Road | Hwy 60-to Dead End | 0.40 | \$112,046 | 47 | 35 | 1987 | 0.29 | |
| 218 | MEA1 | Meadowlark Road | Combermere Road to 911- 54 | 0.18 | \$46,924 | 47 | 35 | 1987 | 0.28 | |
| 219 | SPE1B | Spectacle Lake Road | 911-257 border-to-911-588 End | 0.93 | \$231,461 | 47 | 25 | 1997 | -0.01 | |
| 220 | CRA1B | Cranberry Creek Road | (150 to 310) 911-150-to-911-310 End | 0.80 | \$220,984 | 39 | 27 | 1995 | 0.36 | |
| 221 | YER1B | Yeretch Road | 911-118-to-911-280 End | 0.82 | \$194,652 | 35 | 27 | 1995 | 0.37 | |
| 222 | ONT1 | Finch Road | 911-426-to-911-486 Dead End | 0.28 | \$68,098 | 34 | 27 | 1995 | 0.30 | |
| 223 | | Birchview Drive | Sprucedale Avenue to Lakeview Parkway | 0.20 | \$92,000 | 100 | 1 | 2021 | 0.88 | new in 2021 |
| 224 | LAKEW | Lakewoods Drive | Skead Road to end turnaround | 4.25 | \$1,955,000 | 100 | 1 | 2021 | 0.89 | new in 2021 |
| 225 | SKEAD | Skead Road | HWY60 to Lakewoods Drive | 2.70 | \$1,242,000 | 100 | 1 | 2021 | 0.88 | new in 2021 |
| | | | | | | | | | | |

| _ | | T | | T | 1 | | 30 | \$20,395,977 | 1 | |
|--|--|--|--|--|--|--|---|---|--|--|
| Index | Building | Level 1 - Major Group | Level 2 - Component Group | Level 3 - Component | Asset Name | Year of Construction | Age | 2024 Replacement Cost | 2024 Performance Score | 2024 Performance Score Rationale |
| | CombermereCC CombermereCC | A SUBSTRUCTURE A SUBSTRUCTURE | A10 FOUNDATIONS A10 FOUNDATIONS | A1010 Standard Foundations A1030 Slab on Grade | Concrete Block Foundation Walls Concrete Slab On Grade | 1976 1976 | 48 48 | \$287,500 \$9,200 | 0.859105696 | treatment in long term |
| | CombermereCC | B SHELL | B10 SUPERSTRUCTURE | B1010 Floor and Wall Construction | Concrete Block | 1976 | 48 48 48 | \$34,500 | 0.828571429 0.734615385 | treatment in long term treatment in long term |
| | CombermereCC CombermereCC | B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B1010 Floor and Wall Construction B1010 Floor and Wall Construction | 2nd Floor Steel Columns | 1976 1976 | 48 | \$57,500 \$18,400 | 0.134615385 0.684615385 | treatment required in medium term treatment in long term |
| | CombermereCC | B SHELL | B10 SUPERSTRUCTURE | B1020 Roof Construction | Roof Structure | 1976 | 48 | \$57,500 | 0.634615385 | treatment in long term |
| | CombermereCC CombermereCC | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | Metal Cladding - Newer Metal Cladding - Original | 2016 | 8 23 | \$83,375 \$195,500 | 0.584615385 0.534615385 | treatment in long term |
| 9 | | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | Brick Chimney Aluminum Soffits | 1991 1991 | 23 33 33 | \$8,050 \$8,050 \$14,605 | 0.534615385 0.484615385 0.574289137 | treatment in long term treatment in long term treatment in long term |
| | CombermereCC | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2020 Exterior Windows | Windows - Vinyl | 2014 | 10 | \$14,005 \$56,925 | 0.669656755 | treatment in long term |
| | CombermereCC CombermereCC | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B2030 Exterior Doors B3010 Roof Coverings | Exterior Doors Roofing - Asphalt | 2016 2016 | 8 8 | \$6,900 \$46,000 | 0.676958783 0.621052632 | treatment in long term treatment in long term |
| | CombermereCC | CINTERIORS | C10 INTERIOR CONSTRUCTION | C1010 Partitions | MDF Partitions | 2016 | 8 | \$4,600 | 0.68 | treatment in long term |
| 16 | CombermereCC CombermereCC | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1010 Partitions C1010 Partitions | Interior Rails - Wood Interior Rails - Upper Floor | 1976 1976 | 48 48 | \$3,795 \$2,070 | -0.101056341 0.774732732 | Treatment Required in 2021 or 2022 treatment in long term |
| | CombermereCC | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors | Interior Doors - Steel | 1991 | 33 | \$1,725 \$6,900 | 0.827700188 | treatment in long term treatment in long term |
| | CombermereCC | C INTERIORS | C10 INTERIOR CONSTRUCTION | C1030 Fittings | Lockers | 2016 | 16 | \$4,140 | 0.850273415 | treatment in long term |
| 20 | CombermereCC CombermereCC | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | MDF Countertop MDF Countertop - Upper Floor | 2001 1997 | 23 27 | \$8,625 \$3,450 | 0.120197945 -0.089552619 | treatment required in medium term Treatment Required in 2022, includes new a |
| 22 | CombermereCC | C INTERIORS | C10 INTERIOR CONSTRUCTION | C1030 Fittings | MDF Countertop - Service | 2006 | 18 | \$5,750 | 0.670704004 | treatment in long term |
| | CombermereCC CombermereCC | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | Wood Cabinets Wood Cabinets - Upper Floor | 2001 | 23 23 | \$8,625 \$5,750 | 0.420968469 0.010219027 | treatment required in medium term treatment required in medium term |
| | CombermereCC | C INTERIORS | C10 INTERIOR CONSTRUCTION | C1030 Fittings | Wood Service Counter Doors | 2003 | 21 | \$3,450 | 0.721241523 | treatment in long term |
| | CombermereCC | C INTERIORS C INTERIORS | C20 STAIRS C30 INTERIOR FINISHES | C2010 Stair Construction C3010 Wall Finishes | Structural Wood Stairs Gypsum Board Walls - Older | 1976 | 48 | \$17,250 \$35,650 | -0.088475977 -0.088183042 | Treatment Required in 2021 or 2022 - new s Treatment Required in 2021 or 2022 |
| | CombermereCC | C INTERIORS | C30 INTERIOR FINISHES | C3010 Wall Finishes | Gypsum Board Walls - Older Gypsum Board Walls - Newer | 2016 | 8 | \$5,175 | 0.672121474 | treatment in long term |
| 29 | CombermereCC CombermereCC | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes | Hardie Boards Wood Wall Panels | 1976 1976 | 48 48 | \$29,900 \$10,695 | 0.622438921 0.572770894 | treatment in long term treatment in long term |
| | CombermereCC | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes | Hardwood Flooring | 2011 | 13 | \$10,095 | 0.523119304 | treatment in long term |
| | CombermereCC CombermereCC | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | Vinyl Composite Tile (VCT) Vinyl Composite Tile (VCT) - Washrooms | 2001 2016 | 23 8 | \$23,920 \$2,875 | -0.026513535 0.823875224 | treatment required in medium term treatment in long term |
| 34 | Combermere CC Combermere CC | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | Vinyl Sheet Flooring Epoxy Coating | 2016 2016 | 8 8 | \$575 \$1,104 | 0.8265625 0.71037577 | treatment in long term treatment in long term |
| 36 | CombermereCC CombermereCC | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3030 Ceiling Finishes | Plywood Ceiling Tiles Acoustic Ceiling Tiles | 1994 2016 | 30 | \$18,147 \$2,875 | 0.660532098 0.628575346 | treatment in long term |
| | CombermereCC CombermereCC | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3030 Ceiling Finishes C3030 Ceiling Finishes | Acoustic Ceiling Tiles Gypsum Board Ceilings - Older | 2016 | 23 | \$2,875 \$2,300 | -0.08426545 | treatment in long term Treatment Required in 2021 or 2022 |
| 39 | | C INTERIORS | C30 INTERIOR FINISHES | C3030 Ceiling Finishes | Gypsum Board Ceilings - Newer | 2016 | 8 | \$1,840 | 0.576311587 | treatment in long term |
| 40 | CombermereCC | D SERVICES | D10 CONVEYING | D1010 Elevators and Lifts | Elevator | 2016 | 8 | \$57,500 | 0.525211906 | treatment in long term |
| 41 | CombermereCC | D SERVICES | D20 PLUMBING | D2010 Plumbing Fixtures | Plumbing Fixtures - Toilets | 2016 | 8 | \$4,600 | 0.58339806 | treatment in long term |
| | CombermereCC CombermereCC | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Plumbing Fixtures - Sinks Plumbing Fixtures - Ceramic Sink | 2016 2006 | 8 18 | \$2,300 \$1,150 | 0.67110266 0.08150648 | treatment in long term treatment required in medium term |
| 44 | Combermere CC Combermere CC | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Plumbing Fixtures - Stainless-Steel Sink Plumbing Fixtures - Mop Sink | 2016 2016 | 8 8 | \$2,300 \$1,150 | 0.667035068 0.6172221 | treatment in long term treatment in long term |
| 46 | CombermereCC | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Plumbing Fixtures - Urinals | 2016 2016 2016 | 8 8 | \$2,300 \$2,300 | 0.728571429 0.767411644 | treatment in long term |
| | CombermereCC CombermereCC | D SERVICES | D20 PLUMBING | D2010 Plumbing Fixtures D2050 Domestic Water Distribution | Plumbing Fixtures - Showers Water Filtration System | 2016 | 18 | \$4,025 | 0.067603859 | treatment in long term treatment required in medium term |
| | CombermereCC | D SERVICES | D20 PLUMBING | D2050 Domestic Water Distribution | Hot Water Tank | 1982 | 42 | \$2,300 | -0.092201085 | Treatment Required in 2022 |
| 60 | CombermereCC | D SERVICES | D30 HVAC | D3020 Heat Generating Systems | Gas-Fired Furnaces | 2013 | 11 | \$13.800 | 0.817996995 | treatment in long term |
| | CombermereCC | D SERVICES | | | | 2013 | - " | \$13,000 | 0.817990993 | treatment in long term |
| | | D SERVICES | D30 HVAC | D3030 Cooling Generating Systems | Rooftop Units (RTU) | 1991 | 33 | \$23,000 | -0.091801703 | Treatment Requried in 2023 |
| | CombermereCC | D SERVICES | D30 HVAC | D3030 Cooling Generating Systems D3040 Distribution Systems | Exhaust Fan | 2003 | 21 | \$5,175 | 0.868403037 | treatment in long term |
| 53 54 | CombermereCC CombermereCC CombermereCC | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D40 FIRE PROTECTION | D3040 Distribution Systems D4030 Fire Protection Specialties | Exhaust Fans - Washrooms Exhaust Fans - Washrooms Fire Extinguisher | 2003 2016 2016 | 21 8 8 | \$5,175 \$690 \$1,438 | 0.868403037 0.718611447 0.668823782 | treatment in long term treatment in long term treatment in long term |
| 53 54 55 | CombermereCC CombermereCC CombermereCC | D SERVICES D SERVICES | D30 HVAC D30 HVAC | D3040 Distribution Systems | Exhaust Fan Exhaust Fans - Washrooms | 2003 2016 | 21 8 | \$5,175 \$690 | 0.868403037 0.718611447 | treatment in long term treatment in long term |
| 53 54 55 | CombermereCC CombermereCC CombermereCC CombermereCC | D SERVICES D SERVICES D SERVICES D SERVICES | 030 HVAC 030 HVAC 040 FIRE PROTECTION 040 FIRE PROTECTION | D3040 Distribution Systems D4030 Fire Protection Specialties D4090 Other Fire Protection Systems | Exhaust Fan Exhaust Fans - Washrooms Fire Extinguisher Fire Suppression System - Hood | 2003 2016 2016 2016 | 21 8 8 8 | \$5,175 \$690 \$1,438 \$5,750 | 0.868403037 0.718611447 0.668823782 0.719040321 | treatment in long term treatment in long term treatment in long term treatment in long term |
| 53 54 55 56 | CombermereCC CombermereCC CombermereCC CombermereCC CombermereCC CombermereCC | D SERVICES D SERVICES D SERVICES D SERVICES | 030 HVAC 030 HVAC 040 FIRE PROTECTION 040 FIRE PROTECTION | D3040 Distribution Systems D4030 Fire Protection Specialties D4090 Other Fire Protection Systems | Exhaust Fan Exhaust Fans - Washrooms Fire Extinguisher Fire Suppression System - Hood | 2003 2016 2016 2016 | 21 8 8 8 | \$5,175 \$690 \$1,438 \$5,750 | 0.868403037 0.718611447 0.668823782 0.719040321 | treatment in long term treatment in long term treatment in long term treatment in long term |
| 53 54 55 56 56 | CombermereCC CombermereCC CombermereCC CombermereCC CombermereCC | D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D30 HVAC O40 FIRE PROTECTION D40 FIRE PROTECTION D40 FIRE PROTECTION | 03040 Distribution Systems D4030 Fire Protection Specialties D4090 Other Fire Protection Systems D4090 Other Fire Protection Systems | Exhaust Fan Exhaust Fans - Washrooms Fire Estinguisher Fire Suppression System - Hood Smoke Detector | 2003 2016 2016 2016 2018 | 21 8 8 8 8 | \$5,175 \$890 \$1,438 \$5,750 \$1,725 | 0.868403037 0.718611447 0.668823782 0.719040321 0.669261369 | treatment in long term |
| 53 54 55 56 56 57 58 59 | Combermere CC | D SERVICES | D09 HMC D09 HMC POD HMC POTENTION D09 FME PROTECTION D09 FME PROTECTION D09 FME PROTECTION D09 FME PROTECTION D09 ELECTRICAL D09 ELECTRICAL D09 ELECTRICAL D09 ELECTRICAL D09 ELECTRICAL | D03040 Distribution Systems D0303 Fire Protection Specialities D0300 Other Fire Protection Systems D0300 Distribution Systems D0300 Distribution Systems D0300 Lighting and Branch Wireg D03000 Lighting and Branch Wireg D03000 Lighting and Branch Wireg | Cahaudi Fan Cahaudi Fane, Vasheromes Fen Edingusher Fen Suppression System - Hood Smoke Detector Electrical Panels Eact Lighting Lighting - CEL July Fixtures Lighting - CEL June 178 | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 | \$5,175 \$690 \$1,438 \$5,750 \$1,725 \$25,300 \$1,725 \$1,725 \$1,960 \$1,896 | 0.868403037 0.718611447 0.668823782 0.719040321 0.669261369 0.128571429 0.169487263 0.619718373 | evalence in inrag term scalenced in inga term scalenced in inga term scalenced in inga term scalenced in inga term peatment in inga term readment in inga term beatment required in medium term readment required in medium term beatment required in medium term beatment paguired in medium term beatment in inga |
| 53 54 55 56 56 57 58 59 60 61 | Combermere CC | D SERVICES | DIS HYAC DIS HYAC DIS HYAC DIS FREE PROTECTION DIS FREE PROTECTION DIS FREE PROTECTION DIS FREE PROTECTION DIS ELECTRICAL | 20300 Dehinkolon Systems Di000 Fire Protection Specialises Di000 Chee Fire Protection Systems Di000 Lighting and Branch Wing Di000 Lighting and Branch Wing Di000 Chee Fire Protection Systems Di000 Chee Fi | Cahauf Fan Cahauf Fan Vabrinoms Fer Estingsinher Fer Gupresson System - Hood Snoke Detector Bedrical Pamels Eat Lighting Lighting - LED Light Fintures Lighting - CE/Incan/T8 Society System | 2003 2016 2016 2016 2018 2018 2018 2016 2016 2016 2016 2006 2016 | 21 8 8 8 8 8 8 48 8 8 | \$5.175 \$4000 \$1.48 \$5.750 \$1.28 \$25.300 \$1.25 \$11.500 \$1.960 \$1.860 \$3.450 | 0.868403037 0.718611447 0.668623782 0.719040321 0.669261369 0.128571429 0.169487263 0.619718373 0.200621824 0.550953797 | anahment in long term pautment in long term pautment in long term pautment in long term pautment in long term preadment in long term preadment in long term treatment required in medium term treatment required in medium term pautment in long term |
| 53 54 55 56 56 57 58 59 60 61 62 | Combemmers CC | DEFINICES | D09 PMC D09 PMC PROTECTION D09 ELECTRICAL | D0000 Derivation Systems D0000 Fire Protection Specialises D0000 Center Fire Protection Systems D0000 Center Fire Protection Systems D0000 Center Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Center Systems of Standard Wiring D0000 Center Systems of Systems | Cahaudi Fan Cahaudi Fane, Vaderborons Fane Estinguisher Fane Suppression System - Hood Smoke Detector Sanoke Detector Sectional Panels East Lighting Layding - LED Light Fotunes Lighting - CFL Annual TB Socurily System Fane Alarm Systems Energopero, Lighting Fatunes Employers Employers | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$600 \$1.438 \$5.750 \$1.225 \$25,300 \$1.725 \$11,900 \$1,900 \$1,900 \$3,450 \$1,005 \$3,450 \$1,005 \$800 | 0.868403037 0.718611447 0.688823782 0.719040321 0.669261369 0.128571429 0.169487263 0.619718373 0.200621824 0.550953797 0.501271244 0.851575761 | evalement in long term scalement in long term scalement in long term scalement in long term scalement in long term peatment in long term readment in long term scalement required in medium term readment in long term readment in long term readment in long term |
| 53 54 55 56 56 57 58 59 60 61 62 63 64 65 | Ombemmers CC Combemmers CC | DESPINCES | DOB HANG DOB HANG DOB PRE PROTECTION DOF PRE PROTECTION DOF PRE PROTECTION DOF PRE PROTECTION DOF PRE PROTECTION DOB ELECTRICAL | D0000 Directorion Systems D0000 Fire Protection Specialities D0000 Chee Fire Protection Specialities D0000 Chee Fire Protection Systems D0000 Chee Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Chee Fire Protection Systems | Enhant Fan Chhant Fan Chhant Fan Washnoons Fin E Girgusher Fin Suppression System - Hood Smoke Delector Gedical Panels Est Lighting Lighting - LED Light Fishures Lighting - LED Light Fishures Lighting - CEL Monary Till Fine Alam Systems Fine Alam Systems Fine Alam Systems Energency Lighting Fishures | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$800 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.900 \$1.800 \$3.460 \$3.460 \$3.460 \$1.005 \$600 \$575 \$1.150 | 0.868403037 0.718611447 0.68823782 0.719040321 0.689251369 0.128571429 0.169487263 0.619718373 0.200621624 0.550963797 0.501271244 0.851575761 0.801868695 0.202151196 | realment in long term presented in long term |
| 53 54 55 56 57 58 59 60 61 62 63 64 65 66 | Comberners CC | D SERVICES | 000 FMAC 000 FMAC 000 FMER PROTECTION 040 FME PROTECTION 040 FME PROTECTION 040 FME PROTECTION 040 FME PROTECTION 040 ELECTROAL 050 ELECTROAL | 03036 Dishabation Systems 03030 Fire Protection Specialises 03030 Fire Protection Specialises 03000 Chee Fire Protection Systems 03000 Chee Fire Protection Systems 03000 Lighting and Branch Wiring 03000 Chee Fine Standard Systems | Enhant Fan Chanter Fan Washrooms Fire Entriguisher Fire Suppression System - Hood Smoke Detector Electrical Plants Electrical | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$900 \$1,438 \$1,438 \$5,750 \$1,725 \$1,725 \$1,725 \$1,900 | 0.868403037 0.718611447 0.66823782 0.719040321 0.668261369 0.128571429 0.169487263 0.699718373 0.200621824 0.550653787 0.501271244 0.85157761 0.801688985 0.252151190 0.75242425 | realment in long term presented in long term |
| 53 54 55 56 56 57 58 59 60 61 62 63 64 65 66 | Comberners CC | DESPINCES | DOB INVAC DOB INVAC DOB INVAC DOB FIRE PROTECTION DOB FIRE PROTECTION DOB FIRE PROTECTION DOB FIRE PROTECTION DOB ELECTRICAL ETO EQUIPMENT | D0000 Directorion Systems D0000 Fire Protection Specialities D0000 Chee Fire Protection Specialities D0000 Chee Fire Protection Systems D0000 Chee Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Chee Fire Protection Systems | Enhant Fan Chhant Fan Chhant Fan Washnoons Fin E Girgusher Fin Suppression System - Hood Smoke Delector Gedical Panels Est Lighting Lighting - LED Light Fishures Lighting - LED Light Fishures Lighting - CEL Monary Till Fine Alam Systems Fine Alam Systems Fine Alam Systems Energency Lighting Fishures | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 18 8 8 8 | \$5.175 \$800 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.900 \$1.800 \$3.460 \$3.460 \$3.460 \$1.005 \$600 \$575 \$1.150 | 0.868403037 0.716911447 0.668227362 0.719040321 0.669261369 0.128571429 0.199487263 0.619718373 0.200821824 0.55063397 0.5012712444 0.851575761 0.801886695 0.252151198 0.75242425 | realment in long term presented in long term |
| 53 54 55 56 56 57 58 59 60 61 62 63 64 65 68 | Combemeres CC | DISENVICES DISENVICES DISENVICES DISENVICES DISENVICES OI SERVICES OI SERVICES OI SERVICES DISENVICES DISENVIC | 000 FMAC 000 FMAC 000 FMER PROTECTION 000 FME PROTECTION 000 FME PROTECTION 000 FME PROTECTION 000 ELECTRICAL | 00000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chee Fire Protection Specialises D0000 Chee Fire Protection Specialises D0000 Chee Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Chee Fire Protection Systems D0000 Chee Fire Protection Syste | Enhant Fan Chanter Fan L. Washrooms Fire Entrigasher Fire Suppression System - Hood Smoke Detector Beddical Planels Est Lighting Lighting L. State Lighting Lighting L. State Lighting Lighting L. State Lighting Fire Alam Systems Fire Chanter Lighting Fishers Emergency Lighting and Eathery pack Defertions Scholar Lighting and Lighting Fishers Emergency Lighting and Lighting Planels Emergency Lighting and Lighting Alam State Lighting Employment Scholars Employment Schola | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$000 \$1,438 \$5,750 \$1,725 \$1,725 \$1,725 \$1,726 \$1,900 \$1,900 \$1,900 \$1,900 \$1,900 \$1,900 \$1,900 \$1,000 | 0.88615077 0.078615147 0.068627762 0.778040217 0.068627762 0.778040217 0.068627762 0.10867762 0.10867762 0.10867762 0.50867762 0.50867762 0.50867762 0.50867762 0.508676762 0.508676762 0.508676762 0.508676762 0.508676762 | realment in long term presented in long term |
| 53 54 55 56 56 57 58 59 60 61 62 63 64 65 66 67 70 | Combemers CC | D SERVICES G SERVICES D SERVICES G SERVICES G STEWORK | DOD HANG DOD HANG DOD HANG DOD FREE PROTECTION DAD FREE PROTECTION DAD FREE PROTECTION DAD FREE PROTECTION DAD ELECTRICAL DOD ELECTRICAL | D0000 Dre Protection Specialise D0000 Fire Protection Specialise D0000 Cher Fire Protection Specialise D0000 Cher Fire Protection Specialise D0000 Cher Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Cher Branch Specialise E1000 Cher Experiment | Chaud Fan Chaud Fan Chaud | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$900 \$1.438 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.160 \$1.986 \$3.450 \$1.055 \$600 \$1.055 \$600 \$1.505 \$2.775 \$2.775 \$2.775 \$2.775 \$2.000 | 0.8981547 | realment in long term presented in long term realment required in medium term realment in long term realment in long term realment required in medium term realment required in medium term realment required in medium term realment in long term Trealment required in medium term realment in long term Trealment in long term Trealment in long term Trealment in long term |
| 53 54 55 56 57 58 60 61 62 63 64 65 68 69 70 | Combemers CC | D SERVICES | DO HAC DO HAC DO HAC DO HAC DO FRER PROTECTION DAD FRE PROTECTION DAD FRER PROTECTION DAD FRER PROTECTION DAD FRER PROTECTION DAD ELECTRICAL DOS ELECTRI | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Cher Fire Protection Specialises D0000 Cher Fire Protection Specialises D0000 Cher Fire Protection Systems D0000 Cher Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Communications and Security D0000 Communications D0000 Communications Explaines D0000 Communications Explaines D0000 Communications Explaines D0000 Communications Explaines D0000 Communications D00000 Communications D00000 Communications D00000 Communications D000000000000000000000000000000000000 | Enhant Fan Echant Fan Echan Fan Echant Fan Echant Fan Echant Fan Echant Fan Echant Fan Echan Fan Echant Fan Echant Fan Echant Fan Echant Fan Echant Fan Echan Fan Echant Fan Echant Fan Echant Fan Echant Fan Echant Fan Ech | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$890 \$1.1438 \$1.476 \$1.726 \$1.726 \$1.726 \$1.726 \$1.726 \$1.986 \$3.460 \$1.005 \$900 \$1.005 \$2.775 \$1.500 \$2.775 \$3.3.925 \$1.720 \$2.775 \$3.3.925 \$1.720 \$1.720 | 0.89641536 0.078611451 0.086621762 0.086621762 0.086621360 0.186627120 0.186627120 0.1866271429 | realment in long term presented in long term realment required in medium term realment required in medium term realment required in medium term realment in long term realment in long term realment required in medium term realment required in realment realment in long term Trealment Required in medium term 2023 realment in long term Trealment Required in medium term 2023 realment in long term |
| 53 54 55 56 57 58 59 60 61 62 63 64 65 68 69 70 71 72 73 | Combemers CC | DEFINICES DEFINI | DOD HANG DOD HANG DOD HANG DOD HANG DOD FREE PROTECTION DOD FREE PROTECTION DOD FREE PROTECTION DOD ELECTRICAL DOD ELECTRI | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Cher Fire Protection Specialises D0000 Cher Fire Protection Specialises D0000 Cher Fire Protection Systems D0000 Cher Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Chermicolises and Security D0000 Chermicolises and Security D0000 Chermicolises and Specialises D0000 Chermicolises and Systems D0000 Chermicolises Systems D00000 Chermicolises Systems D0000 Chermicolises Systems D00000 Chermicolises Systems D000000000000000000000000000000000000 | Enhanter Fanc Enhanter Fanc Varberooms Fire Strignahrer Fire Suppression System - Hood Smoke Detector Electrical Parets Lighting - Cell Lighting Lighting - LED Light Fixtures Lighting - CED Light Fixtures Employee - Lighting and battery pack - New Employee - Lighting - CED Lighting | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$890 \$1.1438 \$1.476 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.160 \$1.986 \$3.460 \$1.055 \$800 \$1.155 \$2.775 \$1.150 \$2.775 \$1.150 \$2.775 \$1.150 \$2.775 \$1.150 \$2.775 \$1.150 \$2.775 \$1.150 \$2.775 \$1.72 | 0.89691347 0.069621762 0.079963217 0.069621309 0.18967429 | realment in long term continued in long term realment in long term realment in long term realment in long term brealment in long term brealment in long term brealment in long term brealment required in medium term realment in long term realment in long term realment required in medium term realment required in indicate term realment required in indicate term realment required in indicate term realment in long term Trealment Required in mendum term zealment in long term Trealment Required in medium term 2023 realment in long term zellowers of decommissioning when new term zellowers of decommissioning when new term zellowers in long term |
| 53 54 55 56 56 57 58 59 60 61 62 63 64 65 68 69 70 71 72 73 74 75 | Ombermers CC | D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES D SERVICES | DOS HANC DOS PHAC DOS PHACE DOS PRESE PROTECTION DOS PRESE PROTECTION DOS PRESE PROTECTION DOS PRESE PROTECTION DOS ELECTRICAL | D0305 Distribution Systems D0305 Fire Protection Specialities D0305 Fire Protection Specialities D0305 Chem Fire Protection Specialities D0305 Chem Fire Protection Systems D0305 Lighting and Branch Wiring D03005 Lighting and Branch Wiring D03005 Lighting and Branch Wiring D03005 Cheminications was Security D03005 Cheminications was Security D03005 Cheminications was Security D03005 Chem Electrical Systems D03005 Chem Electrical Systems D0300 Chem E | Enhant Fan Echant Fan Echan Fan Echa | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$800 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.900 \$1.900 \$1.900 \$1.900 \$1.005 \$000 \$075 \$1.150 \$2.275 \$1.150 \$2.275 \$1.150 \$2.270 \$2.270 \$1.200 \$ | 0.89815427 0.69682762 0.69682762 0.69682762 0.69682762 0.1968623762 0.196862762 0.10867429 0.10867429 0.10867429 0.10867429 0.10867429 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.208685797 0.20868579 | realment in long term presented in long term |
| 53 54 55 56 57 58 59 60 61 62 63 64 65 66 69 70 71 72 73 74 75 76 | Combemens CC Combe | DEFINICES DEFINI | DOD HANG DOD | D0000 Fire Protection Systems D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chee Fire Protection Systems D0000 Chee Fire Protection Systems D0000 Chee Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Chee Branch Systems | Enhanter Fans Chanter Fans (Natherlooms Fire Strignather Fire Suppression System - Hood Smoke Detector Stroke Detector Stroke Lighting L | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$000 \$1.438 \$1.725 \$1.725 \$25.300 \$1.725 \$1.725 \$1.725 \$1.100 \$1.800 \$3.450 \$1.000 \$3.450 \$1.000 \$1. | O.866413027 O.878611447 O.86623782 O.866021309 O.186571429 O.1865 | realment in long term presented in long term realment in long term realment in long term realment in long term brealment in long term brealment in long term brealment in long term brealment required in medium term realment required in medium term realment required in medium term realment required in medium term brealment in long term brealment in long term realment required in medium term prealment in long term Trealment Required in medium term 2023 realment in long term allowance for decommissioning when new ut Trealment Required in medium term realment in long term allowance in long term realment required in medium term realment in long term realment required in medium term realment required in medium term realment required in medium term realment in long term |
| 53 54 55 56 56 57 58 59 60 61 62 63 64 65 66 67 77 71 72 73 74 75 76 77 77 78 | Combemeres C C C Combemeres C C C Combemeres C C C C C C C C C C C C C C C C C C C | DEFENCES DEFENCES DEFENCES DEFENCES DEFENCES O SERVICES O SERVICES O SERVICES D SERVICES | 000 FINAC 000 FIRE PROTECTION 000 ELECTRICAL | 00000 Fire Protection Specialises 00000 Fire Protection Specialises 00000 Fire Protection Specialises 00000 Cheller Fire Protection Specialises 00000 Cheller Fire Protection Systems 00000 Lighting and Branch Wiring 00000 Cheller Specialises 000000 Cheller Specialises 000000 Cheller Specialises 00000000000000000000000000000000000 | Enhant Fan Chanter | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$000 \$1,438 \$5,750 \$1,725 \$1,725 \$1,725 \$1,726 \$1,900 \$1,900 \$1,900 \$1,900 \$3,450 \$1,900 \$2,875 \$1,900 \$2,875 \$1,900 \$2,875 \$1,150 \$2,875 \$1,150 \$2,875 \$1,150 \$2,875 \$1,800 \$1,8 | 0.89615429 0.89681540 0.89682782 0.09682782 0.09682782 0.09682782 0.1968427283 0.1968427283 0.1968427283 0.096878323 0.0068787832 0.006878782 0.00687878 | readment in long term readment required in medium term readment required in medium term readment required in medium term readment in long term |
| 53 54 55 56 56 57 58 59 60 61 62 63 64 65 66 67 77 71 72 73 74 75 76 77 77 78 | Combemeres CD Co | DEFINICES DEFINI | DOD HANG DOD | D0000 Pre-Protection Specialises D0000 Fire Protection Specialises D0000 The Protection Specialises D0000 Other Fire Protection Specialises D0000 Cheer Fire Protection Specialises D0000 Cheer Fire Protection Specialises D0000 Cheer Fire Protection Specialises D0000 Lighting and Branch Wireig D0000 Cheer Branch Wireig D0000 One Blackward Systems D0000 One Blackward Systems D0000 One Blackward Systems E1000 Cheer Equipment G0000 One Equipment G0000 Poeting Liefs G0000 Pretion Liefs G0000 Sin Lighting G0000 Sin Lighting G0000 Sin Lighting G0000 Sin Lighting | Enhanter Fans Chanter Fans (Natherlooms Fire Strignahre Fire Strignahre Fire Strignahre Fire Strignahre Strick (Springer) Strick (Springer | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$000 \$1.438 \$2.750 \$1.725 \$25.300 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.726 \$1.726 \$1.726 \$1.100 \$1.800 \$1.800 \$1.800 \$1.900 \$1.900 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 | 0.89601427 0.89601427 0.89602762 0.89602762 0.89602762 0.89602772 0.89602762 0.186647293 0.186647293 0.296021624 0.2960267294 | realment in long term variation in long term |
| 53 54 55 55 56 60 61 62 63 64 66 66 67 70 71 72 73 74 75 76 77 78 | Combemeres CD Co | DESPINCES DESPINCES DESPINCES DESPINCES DESPINCES O SERVICES O SERVICES O SERVICES DESPINCES DES | DOS HANG DOS PRACE DOS PRES PROTECTION DOS ELECTRICAL DOS DOS ELECTRICAL | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chem Fire Protection Systems D0000 Lighting and Branch Wiring D0000 Chem Fire Protection Systems D0000 Chem Fire Fire Systems D0000 Chem Fire Fire Systems D0000 Chem Fire Fire Systems E1000 Chem Fire Fire Systems D0000 Chem Fire Systems D0000 Chem Fire Systems D0000 Chem Fire Systems D0000 Chem Fire Systems D00000 Chem Fire Systems D00000 Chem Fire Systems D000000000000000000000000000000000000 | Enhant Fan Chanter Fan Washeroms Fire Entrigaiher Fire Suppression System - Hood Smoke Detector Electrical Plants Est Lighting Light Fishers Lighting - CE/Incom/TB Secondly System Fire Allow System - Hood Ennemen Light Fishers Ennemen Lighting Fishers Concept Lighting and Estery pack Nother Enginement Skinder Enginement Nother Enginem | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$000 \$1,438 \$5,750 \$1,725 \$1,725 \$1,725 \$1,726 \$1,200 \$1,200 \$1,200 \$1,200 \$1,200 \$1,000 \$1,000 \$2,000 \$2,000 \$1,000 \$2,000 \$1,000 \$2,000 \$1,000 \$2,000 \$1,000 \$2,000 \$1,0 | 0.89601427 0.89601427 0.89602762 0.89602762 0.89602762 0.89602772 0.89602762 0.186647293 0.186647293 0.296021624 0.2960267294 | readment in long term readment required in medium term readment required in medium term readment in long term |
| 53 54 55 55 56 60 61 62 63 64 65 66 68 69 70 71 72 73 74 75 76 77 78 | Combemens CC | DEFINICES DEFINI | DOD HANG DOD | D0000 Pre-Protection Specialises D0000 Fire Protection Specialises D0000 The Protection Specialises D0000 Other Fire Protection Specialises D0000 Cheer Fire Protection Specialises D0000 Cheer Fire Protection Specialises D0000 Cheer Fire Protection Specialises D0000 Lighting and Branch Wireig D0000 Cheer Branch Wireig D0000 One Blackward Systems D0000 One Blackward Systems D0000 One Blackward Systems E1000 Cheer Equipment G0000 One Equipment G0000 Poeting Liefs G0000 Pretion Liefs G0000 Sin Lighting G0000 Sin Lighting G0000 Sin Lighting G0000 Sin Lighting | Enhanter Fans Chanter Fans (Natherlooms Fire Strignahre Fire Strignahre Fire Strignahre Fire Strignahre Strick (Springer) Strick (Springer | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$000 \$1.438 \$2.750 \$1.725 \$25.300 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.726 \$1.726 \$1.726 \$1.100 \$1.800 \$1.800 \$1.800 \$1.900 \$1.900 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 \$1.100 | 0.8645137 0.06061302 0.078611421 0.060621302 0.19064231 0.06061309 0.180571429 0.180571429 0.180571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.50571429 0.70571 | realment in long term variation in long term |
| 53 54 55 55 56 57 58 59 60 61 62 63 64 65 66 67 70 71 72 73 74 75 76 77 78 79 | Combenemes CC Combened CC CC Combened CC | DEFINICES DEFINI | 000 HAVE 000 HAVE 000 HAVE 000 FREE PROTECTION 000 FREE FREE PROTECTION 000 FREE PROTECTION 000 FREE FREE PROTECTION 000 FREE FREE PROTECTION 000 FREE FREE PROTECTION 000 FREE FREE FREE PROTECTION 000 FREE FREE FREE PROTECTION 000 FREE FREE FREE FREE PROTECTION 000 FREE FREE FREE FREE FREE FREE FREE F | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Cher Fire Protection Specialises D0000 Cher Fire Protection Specialises D0000 Cher Fire Protection Systems D0000 Cher Fire Protection Systems D0000 Lighting and Borneth Wiring D0000 Lighting and Borneth Wiring D0000 Lighting and Borneth Wiring D0000 Cher Borneth Systems D00000 Cher Borneth Systems D00000 Cher Borneth Systems D000000 Cher Borneth Systems D000000000000000000000000000000000000 | Enhanter Fans Enhanter Fans (Washenoms Fire Strignahme Fire Strignahme Fire Suppression System - Hood Smoke Detector Electrical Pariets Lighting - Let Lighting Lighting - Let Lighting Lighting - Let Light Fishures Lighting - CF-Amount Till Social Systems Fire Alaim Systems Fire Pariety Lighting Fishures Emergency Lighting and Intelligency Chromotopy Lighting Fishures Emergency Lighting and Intelligency Chromotopy Lighting and Intelligency Chromotopy Lighting and Intelligency Chromotopy Lighting and Intelligency Chromotopy Chromotopy Chromotopy Chromotopy Wood Stains W | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$899 \$1.1438 \$1.1438 \$1.1438 \$1.1725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.160 \$1.986 \$3.450 \$1.005 \$1.005 \$3.450 \$1.005 \$3.450 \$1.005 \$3.450 \$1.150 \$5.175 \$3.925 \$1.150 \$3.3,925 \$1.150 \$3.3,925 \$1.150 \$3.3,925 \$ | 0.89641526 0.696912762 0.69692762 0.69692762 0.186971429 0.186971429 0.186971429 0.186971429 0.186971627 0.501271244 0.851376763 0.501271244 0.851376763 0.251376763 0.251376763 0.252137676763 0.252137676763 0.252137676763 0.252137676763 0.25213767676763 0.2521376767676767676767676767676767676767676 | realment in long term continued in long term realment required in medium term realment in long term realment in long term realment in long term realment in long term realment required in medium term realment in long term realment in long term Trealment Required in medium term allowance for decommissioning when new or Trealment Required in medium term realment in long term allowance for decommissioning when new or Trealment Required in long term realment required in medium term realment in long term realment required in medium term realment in long term Trealment Required in 2022 realment in long term Trealment Required in 2022 |
| 53 54 55 55 56 56 59 60 61 62 63 64 65 66 67 77 71 72 73 74 75 76 77 80 80 80 80 80 80 80 80 80 80 80 80 80 | Combenemes CC Combened CC | DEFINICES DEFINI | DOD HANG DOD | D0300 Directorion Systems D0300 Fire Protection Specialises D0300 Fire Protection Specialises D0300 Other Fire Protection Specialises D0300 Chee Fire Protection Systems D0300 Lighting and Branch Wiring D0300 D0300 Lighting and Branch Wiring D0300 D030 | Enhant Fan Echant Fan Echan Fa | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 | \$5.175 \$800 \$1.128 \$5.750 \$1.725 \$1.725 \$1.725 \$1.900 \$1.900 \$1.900 \$1.900 \$1.005 \$1.005 \$2.075 \$2.075 \$2.075 \$1.150 \$2.075 \$1.150 \$2.075 \$2.075 \$1.150 \$2.075 \$2.075 \$2.075 \$2.000 \$1.000 \$1.000 \$1.000 \$2.000 \$1.000 \$2.000 \$1.000 \$2.000 \$1.000 \$2.000 \$1.000 \$2.000 \$1.000 \$2.0000 \$2.0 | 0.89691547 0.69692762 0.69692762 0.69692762 0.69692762 0.69692762 0.18857429 | restrient in long term prostment required in medium term prostment in long term prostment i |
| 53 54 56 56 56 60 61 62 63 64 65 66 67 70 71 72 73 74 75 76 77 78 79 | Combenemes CC Combened CC CC Combened CC | DEFINICES DEFINI | 000 HAVE 000 HAVE 000 HAVE 000 HAVE 000 FREE PROTECTION 000 FREE FREE PROTECTION 000 FREE FREE PROTECTION 000 FREE FREE FREE FREE FREE FREE FREE F | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chee Fire Protection Specialises D0000 Lightings and Branch Wireig D0000 Chee Branch Wireig D0000 Chee Branch Wireig D0000 Chee Branch Wireig D0000 Chee Branch Systems D00000 Chee Branch Systems D000000000000000000000000000000000000 | Enhanter Fans Chanter Fan Chanter Fans Chant | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$890 \$1.438 \$1.438 \$1.435 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.100 \$1.986 \$3.450 \$1.005 \$600 \$1.005 \$600 \$1.105 \$600 \$1.105 \$2.000 \$1.150 \$2.000 \$1.000 \$2.000 \$1.000 \$2. | 0.89491347 0.0696432782 0.0696432782 0.069643289 0.186974293 0.186 | realment in long term variations of decommissioning when new un Treatment Required in medium term variations in long term vari |
| 53 54 55 56 56 57 58 60 61 62 63 64 66 66 67 70 71 72 73 74 75 75 77 77 77 78 79 80 80 81 81 82 83 84 84 85 86 86 86 86 86 86 86 86 86 86 86 86 86 | Combemens CC Combe | DEFENCES DEF | DOD HANG DOD HANG DOD HANG DOD HANG DOD HANG DOD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DOD ELECTRODAL DOD ELEC | 03030 Fire Protection Specialises 04030 Fire Protection Specialises 04030 Fire Protection Specialises 04030 Chee Fire Protection Systems 04030 Lighting and Branch Wiring 04030 Lighting and Branch Wiring 04030 Lighting and Branch Wiring 04030 Chee Fire Protection Systems 04030 Chee Fire Protection Protection 04030 Chee Fire Protection Protection 04030 Sinc Development 04030 Sinc Development 04030 Sinc Lighting | Enhant Fan Chanter Fane Chanter Fane Chanter Fane Fire Singression System - Hood Smoke Delector Electrical Pamels Electrical Light Fatures Lighting - CE. Fincent TB Security System Fire Alam Systems Energency Lighting and Saltery pack - New Greengers Energency Lighting Fature Light Salterd - Light Fature Light Salterd - Light Fature Light Salterd - Light Fature Addish Maseum - Wood Base Addish Maseum - Floor Decks & Salte - Wood Breen Addish Maseum - Floor Decks & Salte - Wood Deck Addish Maseum - Wood Decks Addish Maseum - Wood Salter | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$900 \$1.438 \$5.750 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.7 | 0.89691542 0.09692772 0.09692772 0.0969272 | readment in long term readment required in medium term readment required in medium term readment required in medium term readment in long term readment in |
| 53 54 55 56 56 56 56 56 56 56 56 56 56 56 56 | Combemeres CC Co | DEFINICES DEFINI | DOD HANG DOD HANG DOD HANG DOD HANG DOD HANG DOD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DOD ELECTRICAL DOD SELECTRICAL DOD SELECTRICAL UTILITIES DAD SELECTRICAL UTILITIES | 0.0000 Fire Protection Specialises 0.0000 Fire Protection Specialises 0.0000 Fire Protection Specialises 0.0000 Chee Fire Protection Specialises 0.0000 Chee Fire Protection Specialises 0.0000 Chee Fire Protection Specialises 0.0000 Lighting and Branch Wiring 0.0000 Chee Fire Protection Specialises 0.00000 Chee Fire Protection Specialises 0.00000 Chee Fire Protection Specialises 0.00000 Chee Fire Protection Protection 0.00000 Chee Fire Protection Protection 0.00000000000000000000000000000000000 | Enhanter Fans Fens Entrygasher Fins Entrygasher Fins Entrygasher Fins Entrygasher Fins Entrygasher Fins Entrygasher Fins Entrygasher Entrygasher Entrygasher Entrygasher Entrygasher Entrygasher Entrygasher Fins Entrygasher Fins Allem Systems Entrygasher Lighting - Lighting Fintures Entrygasher Lighting and Maltiny pack. New Entrygasher Lighting and Maltiny pack. New Entrygasher Lighting and Maltiny pack. New Entrygasher Ent | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.176 \$900 \$1.438 \$000 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.726 \$1.900 \$1.900 \$1.900 \$1.000 \$1.000 \$1.000 \$1.000 \$1.150 \$2.000 \$1.150 \$2.000 \$1.150 \$2.000 \$1.150 \$2.000 \$1.150 \$2.000 \$1.150 \$2.000 \$1.150 \$2.000 \$1.150 \$2.000 \$3.150 \$3.461 \$3.450 | 0.89691340 0.089691370 0.089692130 0.089692130 0.089692130 0.089692130 0.18967429 0.189692130 0.089692 | realment in long term realment required in medium term realment required in medium term realment in long term |
| 53 54 55 56 56 66 67 70 80 81 82 83 83 84 85 56 66 87 | Combemens CC Combe | DEFENCES DEF | DOD HANG DOD HANG DOD HANG DOD HANG DOD HANG DOD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DOD ELECTRODAL DOD ELEC | 03030 Fire Protection Specialises 04030 Fire Protection Specialises 04030 Fire Protection Specialises 04030 Chee Fire Protection Systems 04030 Lighting and Branch Wiring 04030 Lighting and Branch Wiring 04030 Lighting and Branch Wiring 04030 Chee Fire Protection Systems 04030 Chee Fire Protection Protection 04030 Chee Fire Protection Protection 04030 Sinc Development 04030 Sinc Development 04030 Sinc Lighting | Enhant Fan Echant Fan Echan Fan Echant Fan Echant Fan Echant Fan Echant Fan Echant Fan Echan Fan Echant Fan Echant Fan Echan Fan E | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$900 \$1.438 \$5.750 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.7 | 0.89691542 0.09692772 0.09692772 0.0969272 | readment in long term prostment required in medium term prostment required in medium term prostment in long term p |
| 633 644 855 666 677 688 699 700 711 722 733 744 777 788 799 80 81 82 83 84 85 86 88 | Combenemes CC Co | D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES | DOS HANC DAS PRICE PROTECTION DAS ELECTRICAL DOS STE MAPROVEMENTS COS STE MAPROVEMENTS DOS STE ELECTRICAL UTILITIES DAS DETERMONE UTILITIES DAS DETERMONE UTILITIES DAS DETERMONE VERTICAL ENCLOSURES | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chee Fire Protection Specialises D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Chee Fire Protection Specialises D0000 Chee Fire Protection Priving D0000 Chee Fire Priving D0000 Site Lighting D00000 Site Lighting D00000 Site Lighting D000000000000000000000000000000000000 | Enhant Fan Echant Fan | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$500 \$1.125 \$500 \$1.125 \$500 \$1.125 \$5.175 \$1.175 | 0.89591547 0.69692762 0.69592762 0.69592762 0.69592762 0.69592762 0.195927627 0.595927764 0.595927764 0.595927764 0.595927764 0.69592766 | restrient in long term prostered in long term |
| 53 56 56 56 56 56 56 56 56 56 56 56 56 56 | Combenemes CC Co | DEFENCES DEF | DOS HANG DOS PREE PROTECTION DOS ELECTRICAL DOS SITE IMPROVEMENTS COD SITE IMPROVEMENTS SOB SITE ELECTRICAL UTILITIES DOS SITE ELECTRICAL UTILITIE | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chem Fire Protection Protection D0000 Chem Fire Protection Specialises D0000 Chem Fire Protection Special | Enhanter Fans Chanter Fans I waterbornes Fire Edingsahrer Fire Suppression System - Hood Smoble Defector Electrical Fanse - Hood Smoble Defector Electrical Fanse Est Lighting Lighting - LEPL Light Fixtures Lighting - CEPL Incom*TB Security System Fire Alam Systems Company Lighting reliables Energiency Lighting | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$000 \$1.438 \$5.750 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.726 \$1.726 \$1.800 | 0.804901302 0.80501302 0.80501303 | readment in long term readment required in medium term readment required in medium term readment in long term readment Required in 2022 readment in long term |
| 53 56 56 56 56 56 56 56 56 56 56 56 56 56 | Combemens CC Combe | D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES | DOS HANC DAS PRES PROTECTION DAS ELECTRICAL DOS SETE MARROVEMENTS DOS | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chee Fire Protection Specialises D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Chee Fire Protection Specialises D0000 Chee Fire Protection Priving D0000 Chee Fire Priving D0000 Site Lighting D00000 Site Lighting D00000 Site Lighting D000000000000000000000000000000000000 | Entered Fan Chanter Fann Verbinderens Finn Edingsahrer Finn Suppression System - Hood Smoke Defector Gleichkard Parenis Est Lighting Lighting - LED Light Fishures Lighting - LED Lighting Fishures Emergency Lighting roll bases Emergency Lighting Fishures Emergency Lighting Fishures Emergency Lighting Fishures Emergency Lighting Fishures Lighting - Lighting | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$500 \$1.438 \$500 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.726 \$1.726 \$1.900 \$1.800 \$1.800 \$1.900 | 0.89591547 0.69692762 0.69592762 0.69592762 0.69592762 0.69592762 0.195927627 0.595927764 0.595927764 0.595927764 0.595927764 0.69592766 | evaluation in long term produced in long term produced in long term produced in long term positioned in long term |
| 53 56 56 56 56 56 56 56 56 56 56 56 56 56 | Combemens CC Combe | DEFENCES D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES D | DOS HANC DAS PRES PROTECTION DAS ELECTRICAL DOS SETE MERCHENTS GOS S | D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Fire Protection Specialises D0000 Chem Fire Protection Specialises D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Chem Fire Protection Specialises D0000 Chem Fire Protection D0000 Chem Fire Protection Specialises D0000 State Lighting D00000 State Lighting D00000 State Lighting D000000000000000000000000000000000000 | Echael Fan Charles | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$500 \$1.438 \$600 \$1.438 \$5.750 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.900 | 0.89491347 0.89692762 0.89692762 0.69692762 0.69692762 0.1069672763 0.1069672763 0.2069672763 | readment in long term versioners in long term |
| 53 56 56 56 56 56 56 56 56 56 56 56 56 56 | Combenemes CC Co | D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES O SERVICES | DOS HANC DAS PRICE PROTECTION DAS ELECTRICAL DOS STE MAPROVEMENTS COS STE MAPROVEMENTS DOS STE MAPROVEMENTS | D0000 Fire Princetion Specialises D0000 Fire Princetion Specialises D0000 Fire Princetion Specialises D0000 Chee Fire Protection Specialises D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Lighting and Branch Wiring D0000 Chee Fire Protection Specialises D0000 Chee Fire Protection D0000 Chee Fire Protection D0000 Chee Fire Protection D0000 Sile Lighting D00000 Sile Lighting D00000 Sile Lighting D00000 Sile Lighting D000000 Sile Lighting D000000000000000000000000000000000000 | Entered Fan Chanter Fann Verbinderens Finn Edingsahrer Finn Suppression System - Hood Smoke Defector Gleichkard Parenis Est Lighting Lighting - LED Light Fishures Lighting - LED Lighting Fishures Emergency Lighting roll bases Emergency Lighting Fishures Emergency Lighting Fishures Emergency Lighting Fishures Emergency Lighting Fishures Lighting - Lighting | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 211 | \$5.175 \$500 \$1.125 \$500 \$1.125 \$500 \$1.125 \$53.00 \$1.125 \$ | 0.895915429 0.895915429 0.69592762 0.69592762 0.69592762 0.69592762 0.100592762 0.100592762 0.20059262 | restrient in long term prosterient in long ter |
| 53 56 56 56 56 56 56 56 56 56 56 56 56 56 | Combemers CC Combe | DEFINICES DEFINI | DOD HANG DOD HANG DOD HANG DOD HANG DOD HANG DOD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DAD FIRE PROTECTION DOD ELECTRICAL DOD ELEC | 0.0000 Fire Protection Specialises 0.0000 Fire Protection Specialises 0.0000 Fire Protection Specialises 0.0000 Chee Fire Protection Specialises 0.0000 Lighting and Branch Wiring 0.0000 Lighting and Branch Wiring 0.0000 Lighting and Branch Wiring 0.0000 Chee Fire Protection Specialises 0.0000 Chee Fire Lighting 0.0000 Specialises 0.00000 Specialises 0.0000 Specialises 0.00000 Specialises 0.00000 Specialises 0.00000 Specialises 0.00000 Specialises 0.00000 | Enhant Fan Echanter Fan Echanter Fan Fan Expression System - Hood Smoke Delector Ecit Lighting Ecit Lighting Light Fathers Lighting - Light Fathers Lighting - Lighting Fathers Energency Lighting Fathers Echanter - Lighting and Eathery pack Order-Bate Whither Equipment Solithers Equipment Solithers Equipment Solithers Equipment Solithers Equipment Whither Equipment Solithers Equipment Wood State Wood State Wood State Wood State Wood State Light Solithers - Lighting Echanter - Lighting Expression - Lighting Addish Masseam - Wood Solith Addish Masseam - Wood Doon Addish Masseam - Wood Doon Addish Masseam - Wood Doon Addish Masseam - Coulers and Downspouls | 2003 2016 2016 2016 2016 2016 2016 2016 2016 | 21 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 | \$5.175 \$900 \$1.438 \$1.438 \$1.438 \$1.438 \$1.438 \$1.438 \$1.438 \$1.438 \$1.725 \$1.725 \$1.725 \$1.725 \$1.726 \$1.726 \$1.726 \$1.726 \$1.800 | 0.89641549 0.08662782 0.089631549 0.18967429 | evaluent in long term readment required in medium term readment required in medium term readment required in medium term readment in long term readment lo |

| | Adrian Museum | | | | | | | | | |
|------------|---|--|--|---|--|----------------------|----------------|----------------------------------|--|---|
| 97 | Adrian Museum | D SERVICES D SERVICES | D40 FIRE PROTECTION D50 ELECTRICAL | D4030 Fire Protection Specialties D5010 Electrical Service and Distribution | Adrian Museum - Fire Extinguishing Devices Adrian Museum - Electrical Distribution - Panels and S | 2004 | 20 | \$575 \$4.600 | -0.086880696 0.623486465 | Treatment Required in 2022 treatment in long term |
| 99 | | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | Adrian Museum - Electrical Distribution - Branch Wiring Adrian Museum - Lighting - Fluorescent | 1966 | 58 | \$2,300 \$2,013 | 0.173875224 | treatment required in medium term Treatment Required in 2022 |
| 101 | | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | Adrian Museum - Lighting - LED Adrian Museum - Lighting - Pot lights | 2019 2008 | 5 16 | \$288 \$690 | 0.56037577 0.510532098 | treatment in long term treatment in long term |
| | Adrian Museum | D SERVICES | D50 ELECTRICAL | D5030 Communications and Security | Adrian Museum - CCTV | 2014 | 10 | \$2,300 | 0.828575346 | treatment in long term |
| 104 | Adrian Museum | D SERVICES | D50 ELECTRICAL | D5090 Other Electrical Systems | Adrian Museum - Emergency Lighting and Power - Exi | 2021 | 3 | \$1,150 | -0.27426545 | Treatment Required in 2022, asset in very po |
| | Adrian Museum Adrian Museum | G SITEWORK G SITEWORK | G10 SITE PREPARATION G10 SITE PREPARATION | G1020 Site Demolition and Relocations G1030 Site Earthwork | Adrian Museum - Building Relocation Adrian Museum - Grading | 2021 | 3 | \$230,000 \$8,625 | -0.083688413 -0.274788094 | Treatment Requried in 2022 Treatment Required in 2022, asset in very po |
| 107 | | G SITEWORK | G20 SITE IMPROVEMENT | G2030 Pedestrian Paving | Adrian Museum - Concrete Steps | 1966 | 58 | \$7,475 | -0.07660194 | Treatment Required in 2022 |
| | Adrian Museum | G SITEWORK | G20 SITE IMPROVEMENT | G2030 Pedestrian Paving | Adrian Museum - Guardraits - Wood | 1992 | 32 | \$2,875 | -0.26889734 | Treatment Required in 2022, asset in very po |
| | Adrian Museum Adrian Museum | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Pedestrian Paving G2030 Pedestrian Paving | Adrian Museum - Wood Steps Adrian Museum - Wood Deck and Steps | 1966 1998 | 58 26 | \$4,600 \$8,625 | -0.21849352 0.767035068 | Treatment Required in 2022, asset in very potential treatment in long term |
| | Adrian Museum | G SITEWORK | G20 SITE IMPROVEMENT | G2040 Site Development | Adrian Museum - Exterior Furnishings - Wood Sign | 2008 | 16 | \$4,140 | 0.7172221 | treatment in long term |
| 113 | Adrian Museum Combermere GoldenYears | | G20 SITE IMPROVEMENT A10 FOUNDATIONS | G2040 Site Development A1010 Standard Foundations | Adrian Museum - Exterior Furnishings Concrete Block Foundation Walls | 2008 1960 | 16 64 | \$2,300 \$115,000 | 0.678571429 -0.092588356 | treatment in long term Treatment Requried in 2022 |
| | Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | B SHELL | A10 FOUNDATIONS B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | A1010 Standard Foundations B1010 Floor Construction B1020 Roof Construction | Wood Foundation Walls Wood Structure Framing - Ground Floor Wood Structural Frame - Roof | 1988 1960 1960 | 36 64 64 | \$78,200 \$51,750 \$51,750 | -0.092396141 -0.092201085 | Treatment Requried in 2022 Treatment Requried in 2022 treatment in long term |
| 117 | Combermere GoldenYears Combermere GoldenYears | B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B1020 Roof Construction B1020 Roof Construction | Roof Deck Column | 1960 1960 | 64 64 | \$69,000 \$1,725 | 0.568198297 0.518403037 | treatment in long term treatment in long term |
| 120 | Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls B2020 Windows | Metal Cladding Aluminum Soffit Panel Windows - Vinyl | 1998 1988 1988 | 26 36 36 | \$109,250 \$6,210 \$4,025 | 0.568611447 0.658823782 0.669040321 | treatment in long term treatment in long term treatment in long term |
| | Combermere GoldenYears | | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2020 Windows B2030 Exterior Doors | Windows - Vinyi Windows - Wood Exterior Doors and Frames - Steel | 1988 1988 1988 | 36 36 | \$4,025 \$28,750 \$1,725 | 0.619261369 0.728571429 | treatment in long term treatment in long term treatment in long term |
| 124 | Combermere GoldenYears Combermere GoldenYears | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B2030 Exterior Doors B3010 Roof Coverings | Exterior Doors and Frames - Wood Roofing - Metal Sloped | 1988 1988 | 36 36 | \$3,450 \$82,800 | 0.769487263 0.819718373 | treatment in long term treatment in long term |
| 126 | Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | C INTERIORS | B30 EXTERIOR HORIZONTAL ENCLOSURES C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | B3010 Roof Coverings C1010 Partitions C1020 Interior Doors | Gutters and Downspouts Interior Guardrails & Screens Interior Doors | 1988 2011 1988 | 36 13 36 | \$3,623 \$1,242 \$6,900 | 0.850621824 0.700953797 0.651271244 | treatment in long term treatment in long term treatment in long term |
| 129 | Combermere GoldenYears Combermere GoldenYears | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | Wood Countertop Wood Cabinets | 1999 1999 | 25 25 | \$4,313 \$8,050 | 0.101575761 0.051868695 | treatment required in medium term treatment required in medium term |
| 131 | Combermere GoldenYears Combermere GoldenYears | C INTERIORS C INTERIORS | C20 STAIRS C20 STAIRS C30 INTERIOR FINISHES | C2010 Stair Construction C2020 Stair Finishes C3010 Wall Finishes | Interior Stairs - Wood Interior Stairs - Carpet Wood Panel | 1988 2006 1988 | 36 18 36 | \$5,750 \$1,725 \$25,875 | -0.107848804 0.009105696 0.728571429 | Treatment Required in 2022 treatment required in medium term treatment in long term |
| 134 | Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | Wood Panel Carpet - Main Floor Carpet - Basement | 1988 2006 2006 | 36 18 18 | \$25,875 \$9,936 \$8,280 | -0.125384615 -0.065384615 | Treatment Required in 2022 treatment required in medium term |
| 137 | | C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | Laminate Vinyl Flooring | 2016 2004 | 8 20 | \$10,781 \$863 | 0.634615385 -0.015384615 | treatment in long term treatment required in medium term |
| | Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES D20 PLUMBING | C3030 Ceiling Finishes C3030 Ceiling Finishes D2010 Plumbing Fixtures | Gypsum Board Ceilings Acoustic Ceiling Tiles Toilet | 2021 1988 2006 | 3 36 18 | \$1,150 \$9,315 \$1,150 | -0.125384615 -0.125384615 -0.125384615 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 |
| 141 | Combermere GoldenYears Combermere GoldenYears | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Sink Stainless Steel Sink | 1999 1999 | 25 25 | \$1,150 \$2,300 | 0.074289137 0.129656755 | treatment required in medium term treatment required in medium term |
| | Combermere GoldenYears | D SERVICES | D20 PLUMBING D20 PLUMBING D30 HVAC | D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Well Water Sump Pump | 2001 2006 | 23 18 16 | \$3,450 \$1,725 \$3,450 | -0.083041217 0.171052632 0.58 | Treatment Required in 2021 or 2022 treatment required in medium term |
| 146 | Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | D SERVICES | D30 HVAC D30 HVAC | D3020 Heat Generating Systems D3020 Heat Generating Systems D3030 Cooling Generating Systems | Hot Water Tank Baseboard Unit Heaters A/C Unit | 2008 1998 1994 | 16 26 30 | \$3,450 \$9,488 \$1,150 | 0.58 0.558943659 -0.085267268 | treatment in long term treatment in long term Treatment Required in 2021 or 2022 |
| 148 | Combermere GoldenYears Combermere GoldenYears | D SERVICES D SERVICES | D30 HVAC D30 HVAC | D3040 Exhaust Systems D3040 Exhaust Systems | Exhaust Fans - Exterior Exhaust Fan - Washroom | 1993 1994 | 31 30 | \$3,450 \$345 | 0.227700188 0.250273415 | treatment required in medium term treatment required in medium term |
| | Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | D SERVICES | D30 HVAC D40 FIRE PROTECTION D50 ELECTRICAL | D3080 Other Special Mechanical Systems D4030 Fire Extinguishing Devices D4090 Other Fire Protection Systems | Central Vacuum Fire Extinguisher Smoke and CO Detectors | 1999 2020 2014 | 25 4 10 | \$3,450 \$863 \$863 | 0.319955114 0.520197945 0.370447381 | treatment required in medium term treatment in long term treatment required in medium term |
| 153 154 | Combermere GoldenYears Combermere GoldenYears | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5010 Electrical Service and Distribution D5020 Lighting and Branch Wiring | Electrical Panel Lighting - T12 and Incandescent | 1988 2002 | 36 22 | \$12,075 \$4,830 | 0.870704004 -0.089031531 | treatment in long term Treatment Requried in 2022 |
| | Combermere GoldenYears | | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5090 Other Electrical Systems E1090 Other Equipment | Exit Lighting Emergency Lighting Kitchen Equipment | 2001 2001 2008 | 23 23 16 | \$460 \$345 \$3,450 | -0.099780973 -0.088758477 0.171524023 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 treatment required in medium term |
| 158 | | G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Pedestrian Paving G2040 Site Development | Concrete Pad Ramp | 1991 1988 | 33 36 | \$920 \$69,000 | 0.821816958 -0.087878526 | treatment in long term Treatment Required in 2022 |
| 161 | | G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2040 Site Development G2040 Site Development | Exterior Stairs - Wood Exterior Stairs - Concrete | 1994 2008 | 30 16 | \$1,150 \$5,750 | -0.087561079 -0.087229106 | Treatment Requried in 2022 Treatment Requried in 2021 or 2022 |
| | Combermere GoldenYears Combermere Outdoor Rink Combermere Outdoor Rink | A SUBSTRUCTURE | G40 SITE ELECTRICAL UTILITIES A10 FOUNDATIONS B10 SUPERSTRUCTURE | G4020 Site Lighting A1030 Slab on Grade B1010 Floor and Wall Construction | Exterior Light Fixtures Standard Slab on Grade Concrete Block Walls | 2002 2011 2001 | 22 13 23 | \$863 \$18,975 \$43,125 | -0.086880696 0.773486465 0.723875224 | Treatment Required in 2022 treatment in long term treatment in long term |
| 166 | Combermere Outdoor Rink Combermere Outdoor Rink | B SHELL B SHELL | B10 SUPERSTRUCTURE B20 EXTERIOR VERTICAL ENCLOSURES | B1020 Roof Construction B2010 Exterior Walls | Roof Structure Metal Cladding | 2001 2001 | 23 23 | \$126,500 \$96,600 | 0.7265625 0.61037577 | treatment in long term treatment in long term |
| | Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2020 Exterior Windows B2030 Exterior Doors | Aluminum Soffit Windows - Aluminum Exterior Doors - Metal Clad | 2011 2001 2011 | 13 23 13 | \$10,350 \$5,175 \$5,175 | 0.560532098 0.128575346 0.52573455 | treatment in long term treatment required in medium term treatment in long term |
| 170 | Combermere Outdoor Rink Combermere Outdoor Rink | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2030 Exterior Doors B2030 Exterior Doors | Overhead Doors - Zamboni Room Overhead Doors - Utility Room | 2011 2011 | 13 | \$4,025 \$2,875 | 0.576311587 0.665211906 | treatment in long term treatment in long term |
| 172 | Combermere Outdoor Rink Combermere Outdoor Rink | B SHELL B SHELL | B30 EXTERIOR HORIZONTAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B3010 Roof Coverings B3010 Roof Coverings | Metal Roof - Older Metal Roof - Newer | 2001 2011 | 23 13 | \$37,375 \$25,875 | 0.68339806 0.63110266 | treatment in long term treatment in long term |
| | Combermere Outdoor Rink | C INTERIORS | B30 EXTERIOR HORIZONTAL ENCLOSURES C10 INTERIOR CONSTRUCTION | B3010 Roof Coverings C1020 Interior Doors | Gutters and Downspouts Interior Wood Doors | 2021 2011 | 3 13 | \$3,450 \$6,900 | -0.02849352 0.717035068 | Treatment Required in 2021 or 2022 treatment in long term |
| 176 | | | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors C1020 Interior Doors | Interior Steel Door Interior Metal Clad Door Interior Roll-Up Door | 2011 2001 2001 | 13 23 23 | \$3,450 \$1,725 \$1,725 | 0.7672221 0.828571429 0.867411644 | treatment in long term treatment in long term treatment in long term |
| | Combermere Outdoor Rink | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | Countertops Wood Cabinets | 1999 1999 | 25 25 | \$3,910 \$2,415 | 0.067603859 0.017798915 | treatment required in medium term treatment required in medium term |
| 182 | Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C30 INTERIOR FINISHES | C1030 Fittings C1030 Fittings C3010 Wall Finishes | Wood Benches Wood Benches Plywood Walls | 2011 2011 2001 | 13 13 23 | \$5,175 \$2,415 \$12,075 | 0.717996995 0.668198297 0.718403037 | treatment in long term treatment in long term |
| 184 185 | Combermere Outdoor Rink Combermere Outdoor Rink | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3020 Floor Finishes | Gypsum Board Walls Rubber Floor | 2001 2016 | 23 8 | \$23,115 \$2,875 | 0.668611447 0.618823782 | treatment in long term treatment in long term treatment in long term |
| 187 | Combermere Outdoor Rink Combermere Outdoor Rink | C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3030 Ceiling Finishes | Laminate Flooring Plywood Ceilings | 2016 2001 | 8 23 | \$1,553 \$6,728 | 0.569040321 0.519261369 | treatment in long term treatment in long term treatment in long term |
| 189 | Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | D SERVICES | C30 INTERIOR FINISHES D20 PLUMBING D20 PLUMBING | C3030 Ceiling Finishes D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Gypsum Board Ceilings Toilets Sinks | 2001 2011 2004 | 23 13 20 | \$4,830 \$2,300 \$2,300 | 0.828571429 0.769487263 -0.030281627 | treatment in long term treatment in long term treatment required in medium term |
| 191 | Combermere Outdoor Rink Combermere Outdoor Rink | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2050 Other Plumbing Systems | Stainless-Steel Sink Water Filtration System | 2004 2006 | 20 18 | \$3,450 \$3,450 | 0.000621824 0.050953797 | treatment required in medium term treatment required in medium term |
| 193 | Combermere Outdoor Rink | D SERVICES | D20 PLUMBING D20 PLUMBING | D2050 Other Plumbing Systems D2050 Other Plumbing Systems | Electric Hot Water Tank Electric Hot Water Tanks | 2011 2011 | 13 | \$2,300 \$4,600 | 0.701271244 0.651575761 | treatment in long term treatment in long term |
| 196 | Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | D SERVICES | D30 HVAC D30 HVAC D30 HVAC | D3020 Heat Generating Systems D3020 Heat Generating Systems | Unit Heaters Baseboard Electric Heater Propage Fired Furnage | 2011 2001 2015 | 13 23 | \$1,725 \$1,150 \$5,750 | -0.108131305 0.602151196 0.559105696 | Treatment Required in 2021 or 2022 treatment in long term treatment in long term |
| | Combermere Outdoor Rink | D SERVICES | D30 HVAC D30 HVAC D30 HVAC | D3020 Heat Generating Systems D3040 Exhaust Ventilation Systems D3040 Exhaust Ventilation Systems | Propane Fired Furnace Exhaust Fans - Washroom Exhaust Fan - Zamboni Room | 2015 1992 2021 | 9 32 3 | \$5,750 \$690 \$3,450 | 0.559105696 -0.081428571 -0.125384615 | treatment in long term Treatment Requried in 2022 Treatment Requried in 2021 or 2022 |
| 201 | Combermere Outdoor Rink Combermere Outdoor Rink | D SERVICES D SERVICES | D40 FIRE PROTECTION D50 ELECTRICAL | D4030 Fire Protection Specialties D4090 Other Fire Protection Systems | Fire Extinguishers Smoke/Carbon Monoxide Detector | 2004 2006 | 20 18 | \$575 \$1,035 | 0.084615385 0.134615385 | treatment required in medium term treatment required in medium term |
| | Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | D SERVICES | D50 ELECTRICAL D50 ELECTRICAL D50 ELECTRICAL | D5010 Electrical Service and Distribution D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | Main Switch and Electrical Equipment Lighting - T8/T12 Fluorescent Exit Sign | 2011 2006 2011 | 13 18 13 | \$6,325 \$5,060 \$575 | 0.484615385 0.184615385 0.234615385 | treatment in long term treatment required in medium term treatment required in medium term |
| 205 206 | Combermere Outdoor Rink Combermere Outdoor Rink | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5090 Other Electrical Systems D5090 Other Electrical Systems | Emergency Lighting with Exit Emergency Lighting | 2011 2011 | 13 13 | \$863 \$1,150 | 0.284615385 0.574289137 | treatment required in medium term treatment in long term |
| 208 | | D SERVICES E Equipment and Furnishings E Equipment and Furnishings | D50 ELECTRICAL E10 EQUIPMENT E10 EQUIPMENT | D5090 Other Electrical Systems E1090 Other Equipment E1090 Other Equipment | Defibrillator Kitchen Equipment Zamboni | 2018 2009 2011 | 6 15 13 | \$2,875 \$3,450 \$69,000 | 0.669656755 0.376958783 0.671052632 | treatment in long term treatment required in medium term treatment in long term |
| | Combermere Outdoor Rink Combermere Outdoor Rink | G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2020 Asphalt Paving and Surfacing G2030 Pedestrian Paving | Asphalt Pavement Concrete Pad | 2006 2021 | 18 | \$2,300 \$2,300 | 0.13 -0.101056341 | treatment required in medium term Treatment Required in 2021 or 2022 |
| | Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2040 Site Development G2040 Site Development G2040 Site Development | Plywood Dasherboard Chain Link Fence Ice Rink - Asphalt | 2001 2001 2001 | 23 23 23 | \$47,150 \$23,575 \$32,430 | 0.124732732 0.627700188 0.050273415 | treatment required in medium term treatment in long term |
| 215 216 | Combermere Outdoor Rink Combermere Outdoor Rink | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G40 SITE ELECTRICAL UTILITIES G40 SITE ELECTRICAL UTILITIES | G2040 Site Development G4020 Site Lighting G4020 Site Lighting | lce Rink - Asphalt Exterior Light - LED Exterior Lights - Projects | 2019 2006 | 5 18 | \$32,430 \$1,150 \$1,610 | 0.050273415 0.719955114 0.020197945 | treatment required in medium term treatment in long term treatment required in medium term |
| 218 | Combermere Outdoor Rink Combermere Outdoor Rink | G SITEWORK | G40 SITE ELECTRICAL UTILITIES G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting G4020 Site Lighting | Exterior Lights - HID Exterior Light Standard - Wood | 2006 2001 | 18 23 | \$13,800 \$36,800 | -0.029552619 0.770704004 | treatment required in medium term treatment in long term |
| 219 | Library Library | A SUBSTRUCTURE A SUBSTRUCTURE | A10 FOUNDATIONS A10 FOUNDATIONS | A1010 Standard Foundations A1010 Column Foundations & Pile Caps | Library - Block Wall Library - Column Foundations | 1985 1989 | 39 35 | \$5,750 \$32,200 | 0.020968469 0.810219027 | treatment required in medium term treatment in long term |

| and the second | La cuporrouer une | Les comperious | A1030 Slab on Grade | | 0044 | 40 | 451.005 | 0.074044500 | |
|--|--|--|--|--|--|---|---|--|--|
| 222 Library | A SUBSTRUCTURE B SHELL | A10 FOUNDATIONS B10 SUPERSTRUCTURE | B1020 Roof Construction | Library - Standard Slab on Grade Library - Metal Sloped Roof | 2011 1989 | 13 35 | \$54,625 \$108,675 | 0.871241523 0.721524023 | treatment in long term treatment in long term |
| 223 Library 224 Library | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | Library - Brick Veneer Wall Library - Vinyl Cladding | 1989 1989 | 35 35 | \$150,593 \$11,178 | 0.671816958 0.722121474 | treatment in long term treatment in long term |
| 226 Library 226 Library | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | Library - Aluminum Soffit Panel Library - Windows - Vinyl | 1989 1985 | 35 39 | \$7,705 \$6.417 | 0.672438921 | treatment in long term treatment required in medium term |
| 227 Library | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls | Library - Windows - Vinyl - West | 2018 | 6 | \$4,347 | 0.623119304 | treatment in long term |
| 228 Library 229 Library | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2030 Exterior Doors and Frames | Library - Windows - Wood Library - Exterior Doors and Frames - Steel | 1989 1999 | 35 25 | \$3,519 \$12,075 | 0.573486465 0.123875224 | treatment in long term treatment required in medium term |
| 230 Library | B SHELL | B30 EXTERIOR HORIZONTAL ENCLOSURES | B3018 Gutters and Downspouts | Library - Gutters and Downspouts - Metal | 1989 | 35 | \$2,875 | 0.5765625 | treatment in long term |
| 231 Library 232 Library | B SHELL C INTERIORS | B30 EXTERIOR HORIZONTAL ENCLOSURES C10 INTERIOR CONSTRUCTION | B3018 Gutters and Downspouts C1010 Partitions | Library - Gutters and Downspouts - PVC Library - Concrete Block Wall | 1989 1989 | 35 35 | \$2,013 \$103,500 | -0.09962423 0.860532098 | Treatment Required in 2021 or 2022 treatment in long term |
| 233 Library | C INTERIORS | C10 INTERIOR CONSTRUCTION | C1020 Interior Doors | Library - Interior Doors - Fire rated Steel | 2013 | 11 | \$2,875 | -0.081424654 | Treatment Required in 2022 |
| 234 Library 236 Library | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1030 Fittings | Library - Interior Doors - Wood Library - Lockers - Wood | 1999 2018 | 25 6 | \$6,038 \$1,725 | 0.82573455 0.776311587 | treatment in long term treatment in long term |
| 236 Library | C INTERIORS | C10 INTERIOR CONSTRUCTION | C1030 Fittings | Library - Lockers - Metal | 2011 | 13 | \$4,140 | 0.725211906 | treatment in long term |
| 237 Library | C INTERIORS | C10 INTERIOR CONSTRUCTION | C1030 Fittings | Library - Raised Access Flooring | 1989 | 35 | \$1,150 | 0.68339806 | treatment in long term |
| 238 Library | C INTERIORS | C20 STAIRS | C2020 Stair construction | Library - Wood Stairs | 1967 | 57 | \$2,300 | -0.07889734 | Treatment Required in 2021 or 2022 |
| 239 Library | C INTERIORS | C20 STAIRS | C2030 Stair Finishes | Library - Carpet Tread | 2006 | 18 | \$4,600 | 0.23150648 | treatment required in medium term |
| 240 Library | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes | Library - Gypsum Board Walls | 1989 | 35 | \$11,500 | -0.092964932 | Treatment Required in 2021 or 2022 |
| 241 Library 242 Library | C INTERIORS | C30 INTERIOR FINISHES | C3020 Floor Finishes | Library - Vinyl Panel Walls Library - Carpet Flooring | 2011 2011 | 13 13 | \$1,380 \$5,865 | 0.6172221 -0.081428571 | treatment in long term Treatment Requried in 2022 |
| 243 Library 244 Library | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | Library - Carpet Flooring Library - Vinyl Sheet Flooring | 2011 | 13 21 | \$38,640 \$2,070 | 0.217411644 0.567603859 | treatment required in medium term treatment in long term |
| 245 Library 246 Library | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3030 Ceiling Finishes | Library - Vinyl Composite Tile Library - Gypsum Plaster Ceiling Finish | 1997 2011 | 27 13 | \$483 \$21,850 | -0.092201085 0.517996995 | Treatment Required in 2022, asset in very poot treatment in long term |
| 247 Library | C INTERIORS | C30 INTERIOR FINISHES | C3030 Ceiling Finishes | Library - Fiberboard + gypsum | 1967 | 57 | \$46,920 | -0.091801703 | Treatment Required in 2021 or 2022 |
| | D SERVICES D SERVICES | D10 CONVEYING D20 PLUMBING | D1010 Elevators and Lifts D2010 Plumbing Fixtures | Library - Lift Library - Plumbing Fixtures | 2011 2006 | 13 18 | \$51,750 \$5,750 | 0.568403037 -0.091388553 | treatment in long term Treatment Required in 2022 |
| 250 Library 251 Library | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2020 Domestic Water Distribution D2020 Domestic Water Distribution | Library - Domestic Water Distribution Library - Hot Water Tank | 2020 2015 | 4 9 | \$1,150 \$2,300 | 0.658823782 0.669040321 | treatment in long term treatment in long term |
| 252 Library | D SERVICES D SERVICES | D30 HVAC | D3020 Heat Generating Systems D3020 Heat Generating Systems | Propane Furnace | 2016 2006 | 8 18 | \$6,900 \$4.025 | 0.619261369 -0.081428571 | treatment in long term Treatment Required in 2021 or 2022 |
| 254 Library | D SERVICES | D30 HVAC | D3040 Distribution Systems | Library - Air Conditioning | 1991 | 33 | \$1,725 | -0.090512737 | Treatment Required in 2021 or 2022 |
| 258 Library | D SERVICES D SERVICES | D30 HVAC | D3040 Distribution Systems D3040 Distribution Systems | Library - Exhaust Fan - Barrier Free Washroom Library - Exhaust Fan - Older washroom | 1991 1991 | 33 33 | \$345 \$345 | 0.719718373 -0.109378176 | treatment in long term Treatment Requried in 2022, asset in very poor |
| 257 Library 258 Library | D SERVICES D SERVICES | D30 HVAC | D3050 Terminal and Package Units D3050 Terminal and Package Units | Library - Baseboard heater Library - Baseboard heater | 1994 2011 | 30 13 | \$4,313 \$863 | 0.250953797 0.751271244 | treatment required in medium term treatment in long term |
| 259 Library | D SERVICES | D30 HVAC | D3050 Terminal and Package Units | Library - Baseboard heater | 2016 | 8 | \$863 | 0.801575761 | treatment in long term |
| 260 Library 261 Library | D SERVICES D SERVICES | D30 HVAC | D3050 Terminal and Package Units D3050 Terminal and Package Units | Library - Baseboard heater Library - Forced Air Heater | 1991 1967 | 33 57 | \$2,588 \$575 | -0.108131305 -0.107848804 | Treatment Required in 2021 or 2022 Treatment Required in 2022, asset in very poo |
| | D SERVICES D SERVICES | D40 FIRE PROTECTION D40 FIRE PROTECTION | D4030 FIRE PROTECTION SPECIALTIES D4030 FIRE PROTECTION SPECIALTIES | Library - Fire Protection Fire Extinguisher | 1989 2016 | 35 8 | \$4,600 \$863 | -0.100894304 0.328571429 | Treatment Required in 2022 (does it need a fir treatment required in medium term |
| | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5010 Electrical Service and Distribution | Library - Electrical Distribution - Panels and Switches Library - Lighting - T8 Fluorescent | 1989 2016 | 35 | \$863 \$5,606 | -0.125384615 0.334615385 | Treatment Required in 2021 or 2022 |
| 266 Library | D SERVICES | D50 ELECTRICAL | D5020 Interior Luminaries D5020 Interior Luminaries | Library - Lighting - T12 | 2011 | 8 13 | \$10,839 | -0.125384615 | treatment required in medium term Treatment Required in 2022 |
| 267 Library 268 Library | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Interior Luminaries D5020 Interior Luminaries | Library - Lighting - Compact Fluorescent Lamp requirir Library - Lighting - Incandescent | 2016 2001 | 8 23 | \$10,350 \$2,760 | 0.134615385 -0.125384615 | treatment required in medium term Treatment Required in 2021 or 2022 |
| 269 Library 270 Library | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5030 Communications and Security D5030 Communications and Security | Library - CCTV Library - Heat Detector | 2018 2013 | 6 11 | \$5,750 \$3,450 | -0.125384615 -0.125384615 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 271 Library | D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5030 Communications and Security | Library - Security System | 2016 | 8 | \$4,025 | 0.124289137 | treatment required in medium term |
| 272 Library 273 Library | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5090 Other Electrical Systems D5090 Other Electrical Systems | Library - Exit/Emergency Combo Lighting Library - Exit Lighting - Basement | 2011 | 13 13 | \$1,725 \$2,588 | 0.079656755 -0.083041217 | treatment required in medium term Treatment Required in 2021 or 2022 |
| 274 Library 275 Library | D SERVICES E EQUIPMENT AND FURNISHINGS | D50 ELECTRICAL E10 EQUIPMENT | D5090 Other Electrical Systems E1010 Commercial Equipment | Library - Standalone Emergency Lighting Library - Vacuum Cleaner | 2011 | 13 13 | \$1,150 \$1,725 | 0.021052632 | treatment required in medium term treatment required in medium term |
| 276 Library | E EQUIPMENT AND FURNISHINGS | E10 EQUIPMENT | E1010 Commercial Equipment | Library- Kitchen Appliances | 2011 | 13 | \$1,150 | 0.858943659 | treatment in long term |
| | E EQUIPMENT AND FURNISHINGS E EQUIPMENT AND FURNISHINGS | E20 FURNISHINGS E20 FURNISHINGS | E2010 Fixed Furnishings E2010 Fixed Furnishings | Library - Cabinetry and Countertops Library - Countertop | 2003 2014 | 21 10 | \$41,055 \$17,250 | 0.024732732 0.727700188 | treatment required in medium term treatment in long term |
| 279 Library 280 Library | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2010 Roadways G2020 Parking Lots | Library - Signage Library - Concrete Curbs | 2019 1989 | 5 35 | \$1,725 \$2,300 | 0.650273415 -0.090044886 | treatment in long term Treatment Required in 2021 or 2022 |
| | G SITEWORK | G20 SITE IMPROVEMENT | G2030 Pedestrian Paving | Library - Concrete Ramp | 1989 | 35 | \$6,900 | -0.089802055 | Treatment Requried in 2021 or 2022 |
| | CEITEMORY | | | Library accordants | | | | | |
| 282 Library 283 Library | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Pedestrian Paving G2030 Asphalt Paving and Surfacing | Library - guardralis Library - Asphalt Paving and Surfacing | 1989 2008 | 35 16 | \$3,703 \$35,420 | -0.089552619 -0.089295996 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 282 Library 283 Library 284 Library | | | G2030 Asphalt Paving and Surfacing G2030 Pedestrian Paving | Library - Asphalt Paving and Surfacing Library - Concrete Walkway | | | | | Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 282 Library 283 Library 284 Library 285 Library 286 Library | G SITEWORK G SITEWORK G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Asphalt Paving and Surfacing G2030 Pedestrian Paving G2030 Pedestrian Paving G2030 Pedestrian Paving G2040 Site Development | Library - Asphalt Paving and Surfacing Library - Concrete Walkway Library - Front steps Bike Rack | 2008 1982 1988 1981 | 16 42 36 43 | \$35,420 \$9,821 \$8,050 \$2,070 | -0.089295996 -0.089031531 -0.099780973 -0.088758477 | Treatment Requried in 2021 or 2022 Treatment Requried in 2022 Treatment Requried in 2021 or 2022 Treatment Requried in 2021 or 2022 Treatment Requried in 2021 or 2022 |
| 282 Library 283 Library 284 Library 285 Library | G SITEWORK G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Asphalt Paving and Surfacing G2030 Pedestrian Paving G2030 Pedestrian Paving | Library - Asphalt Paving and Surfacing Library - Concrete Walkway Library - Front steps | 2008 1982 1988 | 16 42 36 | \$35,420 \$9,821 \$8,050 | -0.089295996 -0.089031531 -0.099780973 | Treatment Requried in 2021 or 2022 Treatment Requried in 2022 Treatment Requried in 2021 or 2022 |
| 282 Library 283 Library 284 Library 285 Library 285 Library | G SITEWORK G SITEWORK G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Asphalt Paving and Surfacing G2030 Pedestrian Paving G2030 Pedestrian Paving G2030 Pedestrian Paving G2040 Site Development | Library - Asphalt Paving and Surfacing Library - Concrete Walkway Library - Front steps Bike Rack | 2008 1982 1988 1981 | 16 42 36 43 | \$35,420 \$9,821 \$8,050 \$2,070 | -0.089295996 -0.089031531 -0.099780973 -0.088758477 -0.088475977 | Treatment Requried in 2021 or 2022 Treatment Requried in 2022 Treatment Requried in 2021 or 2022 Treatment Requried in 2021 or 2022 Treatment Requried in 2021 or 2022 |
| 282 Library 283 Library 284 Library 285 Library 286 Library 287 Library 288 MissionHouse | G SITEWORK G SITEWORK G SITEWORK G SITEWORK G SITEWORK G SITEWORK A SUBSTRUCTURE | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G40 SITE GENERAL UTILITIES A10 FOUNDATIONS | Ca030 Asphalt Paving and Surfacing Ca030 Pedestrian Paving Ca030 Pedestrian Paving Ca030 Pedestrian Paving Ca040 Site Development G4020 Site Lighting A1010 Standard Foundations | Ubrary - Asphalt Paving and Surfacing Ubrary - Concrete Wallaway Ubrary - Front steps 9like Rack Ubrary - Projector Lights Mission House Museum - Wall Foundation - Stone | 2008 1982 1988 1981 2004 | 16 42 36 43 20 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$63,825 | -0.089295996 -0.089031531 -0.099780973 -0.088758477 -0.088475977 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 |
| 282 Library 283 Library 284 Library 285 Library 286 Library 287 Library 287 Library 289 MissionHouse 290 MissionHouse | G SITEWORK G SITEWORK G SITEWORK G SITEWORK G SITEWORK G SITEWORK A SUBSTRUCTURE | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G40 SITE GENERAL UTILITIES A10 FOUNDATIONS | Ca030 Asphalt Paving and Surfacing Ca030 Pedestrian Paving Ca030 Pedestrian Paving Ca030 Pedestrian Paving Ca040 Site Development G4020 Site Lighting A1010 Standard Foundations | Jaman - Anghatif Pewing and Surfacing Jaman - Concrete Walkary Jaman - Concrete Walkary Jaman - Front steps Silve Floot Jaman - Silve Floot Massion House Museum - Wall Foundation - Store Nassion House Museum - Wall Foundation - Powed O Massion House Museum - Column Foundation - Silve | 2008 1982 1988 1981 2004 | 16 42 36 43 20 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$63,825 | -0.089295996 -0.089031531 -0.099780973 -0.088758477 -0.088475977 | Treatment Required in 2021 2 Treatment Required in 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 200 Library 250 MassionHouse 250 | G STEWORK G STEWORK G STEWORK G STEWORK G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE | GOS SITE MENDOMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS | G0000 Apphall Paving and Startering G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Site Development G4000 Site Lighting A1010 Standard Foundations | Library - Apphalit Pewing and Surfacing Library - Controlled Walkawy Library - Front sleps Library - Front sleps Bake Bake Library - Projector Lights Massion House Museum - Wall Foundation - Store Massion House Museum - Wall Foundation - Store Massion House Museum - Wall Foundation - Power O Massion House Museum - Column Foundation - Steri | 2008 1982 1988 1981 2004 1885 1953 | 16 42 36 43 20 139 71 20 71 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$63,825 \$30,225 \$20,700 \$8,625 | -0.085295996 -0.089031531 -0.089780973 -0.088758477 -0.088175977 -0.088183042 -0.722121474 -0.087561079 -0.672770894 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 treatment in long larm Treatment Required in 2022 Treatment Required in 2022 Treatment Required in 2022 Treatment Required in 2022 |
| 200 Lizeray 200 Massicrétouse 200 Massicrétouse 200 Massicrétouse 200 Massicrétouse 200 Massicrétouse | G SITEWORK G SITEWORK G SITEWORK G SITEWORK G SITEWORK G SITEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE | GOS SITE MAPROVEMENT GOS SITE MAPROVEMENT GOS SITE MAPROVEMENT GOS SITE MAPROVEMENT GOS SITE GOS SITE MAPROVEMENT GOS SITE GOS SITE MAPROVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS | G0000 Aprilatel Paving and Starfaring G0000 Pedestrian Paving G0000 Site Lighting A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations | Jaman - Anghatif Pewing and Surfacing Jaman - Concrete Walkary Jaman - Concrete Walkary Jaman - Front steps Silve Floot Jaman - Silve Floot Massion House Museum - Wall Foundation - Store Nassion House Museum - Wall Foundation - Powed O Massion House Museum - Column Foundation - Silve | 2008 1982 1988 1988 1981 2004 1885 1953 | 16 42 36 43 20 139 71 20 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$63,825 \$36,225 | -0.089295996 -0.089031531 -0.099780973 -0.088758477 -0.088475977 -0.088183042 0.722121474 | Treatment Required in 2021 2 Treatment Required in 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 200 Library 200 Mascine House | G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE SHELL SHELL SHELL SHELL SHELL SHELL | GGS STEE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS | G0000 Apphalet Paving and Startering G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Sile Lighting A1010 Standards Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1000 Stab Order Foundations A1000 Stab Order Foundations A1000 Stab Order Foundations | Listury - Appatial Fewing and Surfacing Listury - Concrede Walkeay Listury - Force steps Blace Flack Listury - Projector Lights Listury - Projector Lights Massion House Massoum - Wall Foundation - Stone Massion House Massoum - Column Foundations - Wall Massion House Massoum - Column Foundations - Wall Massion House Massoum - Column Foundations - Wall Massion House Massoum - Standard Salb on Grade Massion House Massoum - Rico Dack & Salbat - Wood Massion House Massoum - Rico Dack & Salbat - Wood | 2008 1982 1988 1981 2004 1885 1983 2004 1953 1953 1953 1953 | 16 42 36 43 20 139 71 20 71 71 71 71 139 139 | \$39,420 \$8,821 \$8,050 \$2,070 \$1,206 \$63,825 \$30,225 \$20,700 \$8,625 \$27,600 \$29,038 \$17,250 | -0.083295996 -0.08931831 -0.099780973 -0.088788477 -0.088183042 -0.722121474 -0.087561079 -0.672770894 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 Treatment Required |
| 200 Learny 201 Learny 202 Learny 203 Learny 203 Learny 203 Learny 204 Learny 205 Learny 206 MassicreHouse 207 MassicreHouse 207 MassicreHouse 208 MassicreHouse 209 MassicreHouse 200 MassicreHouse 200 MassicreHouse 200 MassicreHouse 200 MassicreHouse 200 MassicreHouse 200 MassicreHouse | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE SSESSESSESSESSESSESSESSESSESSESSESSESS | GGS STE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STO SUPPERSTRUCTURE STO SUPPERSTRUCTURE | G0000 Apphalet Paving and Startering G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Sile Lighting A1010 Sile Lighting A1010 Standard Foundations A1000 Sile Dec | Library - Apphalit Pewing and Surfacings Library - Concreded Walkeay Library - Front ships Library - Front ships Library - Front ships Library - Projector Lights Massion House Museum - Wall Foundation - Stone Massion House Museum - Wall Foundation - Poured C Massion House Museum - Wall Foundation - Poured Library - College - College - College - College Massion House Museum - Collumn Foundations - Sheel Massion House Museum - Face - Standard Sale on Grade Massion House Museum - Face Decks & Salbar - Wood | 2008 1982 1988 1981 2004 1885 1953 2004 1953 1953 1953 | 16 42 36 43 20 139 71 20 71 71 | \$35,40 \$9,821 \$8,050 \$2,070 \$1,208 \$63,825 \$36,225 \$20,700 \$8,625 \$20,700 \$20,008 | -0.089295996 -0.089031531 -0.089730973 -0.088758477 -0.088475977 -0.088475977 -0.088183042 -0.722121474 -0.087561079 -0.672770894 -0.08880696 -0.623466465 -0.573875224 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 2022 |
| 200 Listrary | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B S | GOS SITE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS SITE SUPPRISTRUCTURE BITS SUP | G0000 Apphalet Paving and Startering G0000 Pedestraine Paving G0000 Pedestraine Paving G0000 Pedestraine Paving G0000 Pedestraine Paving G0000 Site Lighting A1010 Standard Foundations B1010 Favor Construction B1010 Favor Construction B1010 Favor Construction B1010 Roof Construction B1010 Roof Construction | Januy - Apphalit Pewing and Surfacing Januy - Concrede Walksory Januy - Concrede Walksory Januy - Front sleps Massion House Massour - Wall Foundation - Store Massion House Massour - Wall Foundation - Power Of Massion House Massour - Column Foundation - Silve Massion House Massour - Column Foundation - Silve Massion House Massour - Column Foundation - Will Massion House Massour - Column Foundation - Will Massion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood Assion House Massour - Filor Dicks & Stitler - Wood | 2008 1982 1988 1981 2004 1885 1953 2004 1953 1953 1983 1885 1885 1983 | 16 42 36 43 20 1139 71 20 71 71 71 139 71 139 71 | \$35,420 \$9,821 \$6,050 \$2,070 \$1,208 \$1,208 \$60,825 \$30,225 \$20,700 \$8,025 \$27,600 \$17,200 \$17,200 \$17,705 | -0.085295096 -0.086031531 -0.096931531 -0.096930873 -0.088758477 -0.088183042 -0.722121474 -0.087581079 -0.672770894 -0.086880696 -0.623488465 -0.573875224 -0.5768625 -0.81037577 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 200 Listery 200 Massion House | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B SUBSTRUCTURE B SHELL B SHELL B SHELL B SHELL B SHELL | GOS SITE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS GOS SUPERSTRUCTURE GIOS SU | G0000 Apphalet Paving and Startering G0000 Pedestraine Paving G0000 Site Lighting A1010 Standard Foundations B1010 Floor Constitution B1010 Floor Constitution B1010 Floor Constitution B1020 Rod Constitution B1020 Rod Constitution B1020 Rod Constitution B1020 Rod Constitution | Janus - Apphall Fewing and Surfacing Janus - Concrete Walkery Janus - Concrete Walkery Janus - Front steps Mascon House Maseum - Wall Foundation - Store Mascon House Maseum - Wall Foundation - Power C Mascon House Maseum - Column Foundation - Store Mascon House Maseum - Column Foundation - Store Mascon House Maseum - Column Foundation - Wood Mascon House Maseum - Flora Decks & State - Wood Mascon House Maseum - Flora Decks & State - Wood Asson House Maseum - Flora Decks & State - Wood Asson House Maseum - Flora Decks & State - Wood Asson House Maseum - Flora Decks & State - Wood Asson House Maseum - Flora Decks & State - Wood Asson House Maseum - Flora Decks & State - Wood Mascon House Maseum - Flora Wall Mascon House Maseum - Plack Wall Mascon House Maseum - Wyll Stating Mascon House Maseum - Wyll Stating | 2008 1982 1982 1988 1981 2004 1885 1963 2004 1983 1983 1985 1885 1885 1885 1885 | 16 42 36 43 20 139 71 20 71 20 71 139 71 139 139 139 139 19 | \$35,420 \$9,821 \$6,050 \$2,070 \$1,208 \$1,208 \$1,208 \$30,275 \$20,700 \$8,025 \$27,600 \$17,260 \$17,250 \$47,765 \$40,275 | -0.08925996 -0.08925996 -0.089311 -0.089780973 -0.08878477 -0.088183042 -0.722121474 -0.087561079 -0.672770894 -0.08680899 -0.023480465 -0.573875224 -0.5769225 -0.099467902 -0.778575346 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 200 Listery 200 Massion House | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B S | GOS SITE MAPPOVEMENT GOS SITE | G0000 Apphalet Paving and Starkering G0000 Pedestraine Paving G0000 Site Lighting A1010 Standard Foundations B1000 Foundations A1010 Standard Foundations B1000 Foun | Janus - Apphalit Fewing and Surfacing Janus - Concrete Walksory Janus - Concrete Walksory Janus - Front steps Massion House Massoum - Wall Foundation - Stone Massion House Massoum - Wall Foundation - Power G Massion House Massoum - Column Foundation - Steel Massion House Massoum - Front Decks & States - Wood Assion House Massoum - Front Decks & States - Wood Assion House Massoum - Front Decks & States - Wood Assion House Massoum - Front Decks & States - Wood Assion House Massoum - Front Decks & States - Wood Assion House Massoum - Front Decks & States - Wood Assion House Massoum - Port Decks & States - Wood Massion House Massoum - Port Walks Massion House Massoum - Well Stelling Massion House Massoum - Wood Stelling Massion House Massoum - Wood Stelling | 2008 1982 1982 1988 1981 2004 1885 1963 2004 2004 1885 1963 1963 1963 1963 1963 1965 1965 1965 1965 1965 1965 1965 1965 | 16 42 36 43 20 139 71 20 71 71 139 139 139 139 139 139 139 139 139 13 | \$35,420 \$9,821 \$6,050 \$2,070 \$1,208 \$60,825 \$30,225 \$20,700 \$20,025 \$20,025 \$27,600 \$20,036 \$17,280 \$40,250 | -0.095205996 -0.09578077 -0.09578077 -0.09578077 -0.09578077 -0.09578077 -0.095780707 -0.0957807 -0. | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 |
| 200 Lorary 201 Lorary 202 Lorary 203 Lorary 205 Lorary 205 Lorary 206 Lorary 207 Lorary 207 Lorary 208 MissionHouse 209 MissionHouse | G STEWORK A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE G SIELL G SIELL G SIELL G SIELL G SIELL G SIELL | GOS SITE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS SITE SUPPRISTRUCTURE SITE SUP | G0000 Apphalet Paving and Starkering G0000 Pedestration Paving G0000 Pedestration Paving G0000 Pedestration Paving G0000 Site Development G0000 Site Lighting A1010 Standard Foundations B1010 Foundations | Listury - Angel Markey and Surfacing Library - Concrede Walkeys Listury - Force Reps Bine Flack Listury - Projector Lights Massion House Maneum - Wall Foundation - Store Massion House Maneum - Wall Foundation - Power Co Massion House Maneum - Column Foundation - Power Co Massion House Maneum - Column Foundation - Wall Fo | 2008 1982 1982 1981 2004 1885 1953 2004 1953 1953 1953 1953 1885 1885 1885 1885 1885 1885 | 16 42 36 43 20 139 71 20 71 139 71 139 139 139 139 139 139 139 139 139 171 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$40,825 \$30,225 \$30,225 \$20,700 \$20,700 \$20,000 \$21,200 \$37,25 \$37,25 \$40,25 \$40,25 \$40,25 \$40,400 | -0.089259069 -0.08925907 -0.08978073 -0.08978073 -0.08878047977 -0.0884780479 -0.0884780479 -0.0884780479 -0.0884780479 -0.08848048 -0.082480486 -0.082480486 -0.082480486 -0.082480486 -0.08780524 -0.0888057877 -0.099467902 -0.78875346 -0.08248048 -0.08780524 -0.08248048 -0.08780524 -0.08248048 -0.0824804 -0.08248048 -0.08248048 -0.08248048 -0.08248048 -0.08248048 -0.08248048 -0.08248048 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 |
| 200 Listery 200 Massion House | G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE G SHELL S SHELL | GGS STEE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STEE STEEP STRUCTURE STORY STEEP STRUCTURE STORY S | G0000 Apphalet Paving and Starkering G0000 Pedestration Paving G0000 Pedestration Paving G0000 Pedestration Paving G0000 Site Development G0000 Site Lighting A1010 Standard Foundations B1010 Four Constitution B1010 Four Constitu | Linary - Angel Terwing and Surfacing Linary - Concrete Walkeay Linary - Forcet Seps Basic Riska Linary - Prote Seps Basic Riska Linary - Prote Seps Basic Riska Linary - Projector Lights Massich House Massaum - Wall Foundation - Store Massich House Massaum - Column Foundation - Power Massich House Massaum - Column Foundation - Walkea Massich House Massaum - Column Foundation - Walkea Massich House Massaum - Foundation - Store Massich House Massaum - Foundation - Walkea Massich House Massaum - Foundation - State Massich House Massaum - House - State Massich House Massaum - Word Stating Massich House Massaum - Wed Stating Massich House Massaum - Wed Stating Massich House Massaum - Word Stating Massich House Massaum - Wall Stating Massich House Massau | 2008 1982 1982 1981 2004 1885 1983 2004 1983 1983 1983 1983 1885 1985 1885 1885 1885 1885 1885 1885 | 16 42 36 43 20 139 71 71 71 139 71 139 71 139 71 139 139 139 139 19 19 19 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$1,008 \$1,000 \$20,700 \$40,255 \$27,500 \$20,000 \$21,200 \$21,200 \$3,738 \$41,250 \$41,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,450 \$40,450 \$40,450 \$40,450 \$40,450 | -0.080750976 -0.080750973 -0.080750973 -0.080750973 -0.080750973 -0.080750973 -0.080750977 -0.080750977 -0.080750977 -0.080750977 -0.080750977 -0.080750977 -0.080750977 -0.080750977 -0.080750977 -0.08075097 -0. | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 |
| 200 Livery 200 Mission fouce | G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE S SHELL | GGS STE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STORY STEMPORT TOURE STORY STEMPORT STEMPORT TOUR STEMPORT STEMPORT TOUR STEMPORT TOUR STEMPORT TOUR STEMPORT TOUR STEMPORT STEMPORT TOUR STEMPORT STEMPORT TOUR STEMPORT TOUR STEMPORT TOUR STEMPORT TOUR STEMPORT STEMPORT TOUR STEMPORT TOUR STEMPORT TOUR STEMPORT TOUR STEMPOR | G0000 Apphalet Paving and Starkering G0000 Pedestrian Paving G0000 Starkering A1010 Standard Foundations B1010 Foundations | Linary - Angelet Tevring and Surfacing Linary - Concreted Walkeapy Linary - Front sleps Blane Flack Linary - Projector Lights Massich Floors Manner - Wall Foundation - Store Massich House Manner - Wall Foundation - Store Massich House Manner - Wall Foundation - Promet Massich House Manner - Column Foundation - Wall Massich House Manner - Column Foundation - Wall Massich House Manner - Column Foundation - Wall Massich House Manner - Root Decks & States - Wood Massich House Manner - Root Decks & States - Wood Massich House Manner - Root Decks & States - Wood Massich House Manner - Root Decks & States - Wood Massich House Manner - Root Decks & States - Wood Massich House Manner - Wood String Massich House Manner Wood String Massich House Manner Wood String Massich House Manner | 2006 1982 1982 1981 2004 1985 1985 1985 1985 1983 1885 1983 1885 2005 1983 1885 2005 1983 1983 2005 1983 2005 2005 | 16 42 36 43 20 119 71 71 71 71 139 71 139 71 139 71 139 19 71 139 19 77 11 19 19 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$1,208 \$1,208 \$2,000 \$2,000 \$2,000 \$2,000 \$2,000 \$2,000 \$3,738 \$40,250 \$40,450 | -0.080250986 -0.080315317 -0.080415317 -0.080415317 -0.080415317 -0.0804153012 -0.080516317 -0.080516317 -0.080516317 -0.0805163012 -0.0805163012 -0.0805163012 -0.0805163012 -0.0805163012 -0.0806163012 -0.0806163012 -0.0806163012 -0.080617002 -0.080617002 -0.080617002 -0.080617002 -0.080617002 -0.080617002 -0.080617003 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 |
| 282 Livery 284 Livery 284 Livery 286 Livery 286 Livery 286 Livery 287 Livery 287 Livery 288 Mission House 289 Mission House 280 Mission House | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE SSEELL | GGO SITE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS SITE SUPPRESTRUCTURE SITE SUP | G0000 Apphalet Paving and Starkering G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Starkering G0000 Starkering A1010 Standard Foundations B1010 Four Constitution B1010 Four | Library - Forcet Septs Library - Concrete Walksway Library - Forcet Septs Library - Forcet Septs Bion Flack Library - Projector Lights Massion House Maneum - Wall Foundation - Store Massion House Maneum - Wall Foundation - Store Massion House Maneum - Column Foundation - Store Massion House Maneum - Column Foundation - Wall Massion House Maneum - Column Foundation - Wall Massion House Maneum - Column Foundation - Wall Massion House Maneum - Standard Salt on Grade Massion House Maneum - Fibro Deads & Saltha- Wood Massion House Maneum - Fibro Deads & Saltha- Wood Massion House Maneum - Fibro Deads & Saltha- Wood Massion House Maneum - Fibro Deads & Saltha- Wood Massion House Maneum - House & Saltha- Wood Massion House Maneum - House & Saltha- Wood Massion House Maneum - Wood Soling Massion House Maneum - Wood Soling Massion House Maneum - Wall Massion Ho | 2006 1982 1982 1981 2004 1985 1985 1953 1953 1885 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 20 119 71 71 71 71 139 71 139 71 139 71 139 19 77 11 139 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$50,225 \$30,225 \$27,600 \$20,038 \$17,250 \$3,738 \$17,250 \$3,738 \$40,250 \$44,450 \$44,450 \$44,450 \$44,450 \$49,455 \$1,250 \$ | -0.00020998 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 200 Listery 200 Massicref touse | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B S | GOS SITE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS SUPERSTRUCTURE BIT S | G0000 Apphalet Paving and Starkering G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Site Lighting A1010 Standard Foundations B1000 Founda | Jamay - Appatil Pawing and Surfacing Jamay - Control Walksay Jamay - Forted Reps Bare Flack Jamay - Forted Reps Base Flack Jamay - Forted Reps Base Flack Jamay - Forted Reps Massion House Managem - Wall Foundation - Store Section House Managem - Wall Foundation - Proceed Section House Managem - Column Foundation - Store Massion House Managem - Column Foundation - Wall Massion House Managem - Column Foundation - Wall Massion House Managem - Store Massion House Managem - Report Date & Balter - Woold Massion House Managem - Report Date & Balter - Woold Massion House Managem - Report Date & Balter - Woold Massion House Managem - Report Date & Balter - Woold Massion House Managem - Report Date & Balter - Woold Massion House Managem - Report Date & Balter - Woold Massion House Managem - Wool Stoling Massion House Managem - Wool Storing Massion House Managem - Wool Down Massion House Managem - Wool Down Massion House Managem - Glorge and Downgoulds Massion House Managem - Glorge and Downgoulds Massion House Managem - Gilder and Downgoulds Massion House Managem - Gilder and Downgoulds Massion House Managem - Gilder and Downgoulds Massion House Managem - Gulder and Downgoulds Massion House Managem - Gilder and Downgoulds Massion Hous | 2006 1982 1982 1981 2004 1885 1963 2004 2004 1953 1953 1953 1965 1965 1965 1965 1965 1965 1965 1965 | 16 42 36 43 43 20 139 71 71 71 71 71 159 159 159 171 159 171 159 171 171 19 19 19 | \$35,420 \$9,821 \$6,050 \$1,008 \$1,008 \$1,008 \$1,008 \$1,008 \$1,008 \$20,000 \$20,000 \$20,000 \$20,000 \$1,738 \$1,738 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$40,250 \$41,950 \$41, | -0.08076098 -0.08075871 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.08078073 -0.0808078073 -0.08080734 -0.0808074 -0. | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 |
| 202 Liverary 203 Liverary 204 Liverary 205 Liverary 205 Liverary 205 Liverary 206 Liverary 207 Liverary 207 Liverary 208 Mission Fouse 208 Mission Fouse 209 Mission Fouse 209 Mission Fouse 209 Mission Fouse 200 Mission Fouse | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A BUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B SUBSTRUCTURE SUBSTRUC | GOS STE MAPOCHEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STO SUPPORTFUCTURE STO SUPPORT STO SUPPORTFUCTURE S | G0000 Apphalt Paving and Starkening G0000 Pedestrian Paving G0000 State Lighting A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundations A1010 | Lintery - Appellet Perring and Surfacing Library - Connected Wildsway Library - Front steps Library - Front steps Bine Risch Library - Projector Lights Mission House Masseam - Wall Foundation - Store Mission House Masseam - Wall Foundation - Store Mission House Masseam - Column Foundation - Wood Mission House Masseam - Column Foundation - Wood Mission House Masseam - Column Foundation - Wood Mission House Masseam - Store & Silber - Wood Mission House Masseam - Rich Dack & Silber - Wood Mission House Masseam - Rich Dack & Silber - Wood Mission House Masseam - Wood Dack & Silber - Wood Mission House Masseam - Wood Dack Mission House Masseam - Wood Doors Mission House Masseam - Mission Edition Mission House Masseam - Mission - House Masseam - Mission - Mission House Masseam - Mission House Masseam - Mission House Masseam - Mission House Masseam | 2006 1982 1981 2004 1885 1895 19953 2004 19953 1 | 16 42 36 43 43 20 139 71 71 71 71 159 159 159 171 171 171 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$30,420 \$8,251 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$53,025 \$53,025 \$2,700 \$6,025 \$27,000 \$5,025 \$27,000 \$5,025 \$27,000 \$3,025 \$40,025 | -0.08020998 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 2021 or 2022 Treatment Required in 2021 Treatment Required in 2022 |
| 202 Liverary 203 Liverary 204 Liverary 205 Liverary 205 Liverary 205 Liverary 206 Liverary 207 Liverary 208 Massion Founce 209 Massion Founce 200 Massion Founce 200 Massion Founce 201 Massion Founce 201 Massion Founce 201 Massion Founce 202 Massion Founce 203 Massion Founce 203 Massion Founce 204 Massion Founce 205 Massion Founce 206 Massion Founce 206 Massion Founce 207 Massion Founce 208 Massion Founce 208 Massion Founce 209 Massion Founce 209 Massion Founce 209 Massion Founce 200 | G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B SHELL B SH | GOS STE MAPPOVEMENT GOS STEMPORT GOS S | G0000 Apphalt Paving and Starkening G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Pedestrain Paving G0000 Site Lighting A1010 Standard Foundations A1010 Foundat | Lintary - Anjohal Pawing and Surfacing Lintary - Concrete Walkeay Lintary - Front steps Bine Risch Lintary - Front steps Bine Risch Lintary - Projector Lights Mission House Masseam - Wall Foundation - Store Mission House Masseam - Wall Foundation - Store Mission House Masseam - Column Foundation - Store Mission House Mission - Column Foundations - Store Mission House Mission - Column Foundations - Wool Mission House Mission - Column Foundations - Wool Mission House Mission - Foundations - Wool Mission House Mission - Foundations - Wool Mission House Mission - Foundation - Wool Mission House Mission - Foundation - Wool Mission House Mission - Foundation - Wool Mission House Mission - Foundations - Wool Mission House Mission - Wool Soliday Mission House Mission Wool Soliday Mission House Mission Wool Soliday Mission House Mission | 2006 1982 1981 2004 1885 1895 19953 2004 19953 | 16 42 36 43 43 20 139 771 71 71 139 139 139 139 139 139 139 139 139 13 | \$35,420 \$8,821 \$8,050 \$2,070 \$1,208 \$1,208 \$40,825 \$40,825 \$40,825 \$27,600 \$570,008 \$40,825 \$40,250 \$4 | | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 Treatment Required in 2022 Treatment Required in 2022 Treatment In long term Treatment In long term Treatment In long term Treatment In long term Treatment Required in 2022 Treatment In long term Treatment In long term Treatment Required in 2022 Treatment In long term Treatment In long term Treatment In long term Treatment Required in 2021 or 2022 Treatment In long term Treatment Required in 2021 or 2022 Treatment In long term Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment In long term Treatment Required in 2021 Treatment Required in 2022 to 2022 |
| 202 Larrary | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE SSEELL | GGO STER MEMPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STO SUPERSTRUCTURE SUPERS | G0000 Apphalet Paving and Starkering G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Site Lighting A1010 Standard Foundations B1010 Four Constitution B1010 Four Constit | James - Apphalit Pewing and Surfacing James - Concrete Walkersy James - Concrete Walkersy James - Concrete Walkersy James - Forot sleps Blace Flack James - Forot sleps Blace Flack James - Forot sleps Massich House Masseum - Wall Foundation - Store Massich House Masseum - Wall Foundation - Proceed Massich House Masseum - Column Foundations - Store Massich House Masseum - Column Foundations - Store Massich House Masseum - Column Foundations - Walker Massich House Masseum - Foro Dack & States - Wood Massich House Masseum - Foro Dack & States - Wood Massich House Masseum - Foro Dack & States - Wood Massich House Masseum - Foro Dack & States - Wood Massich House Masseum - Foro Dack & States - Wood Massich House Masseum - Foro Dack & States - Wood Massich House Masseum - Foro Dack & States - Wood Massich House Masseum - Wood Stating Massich House Masseum - | 2006 1982 1982 1982 1982 1983 1983 2005 20 | 16 42 36 43 20 119 71 71 71 71 139 71 139 71 139 71 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$1,208 \$1,208 \$2,700 \$2,000 \$2,000 \$2,000 \$2,000 \$2,000 \$1,200 \$1,200 \$3,738 \$40,250 \$40,250 \$40,450 \$4 | -0.0002000000 -0.00020000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 202 Liverary 203 Liverary 204 Liverary 205 Liverary 206 Liverary 206 Liverary 206 Liverary 206 Liverary 207 Liverary 208 Liverary 208 Liverary 208 Liverary 208 Mission Floure 209 Mission Floure 209 Mission Floure 209 Mission Floure 209 Mission Floure 200 Mission Floure 200 Mission Floure 200 Mission Floure 200 Mission Floure 201 Mission Floure | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE SSEELL | GGO STER MEMPOVEMENT GGO STER GGO STER GGO STER GGO STER GGO STER GENERAL GGO STER GGO STER GGO STER GGO STER GO STER GGO STER GENERAL GGO STER GGO STER GGO STER GO STER GGO STER GO STER GGO STER GO STER GGO STER GO STER GGO STER GGO STER GGO STER GO STER GGO STER GGO STER GO STER GGO STER | G0000 Apphalet Paving and Starkering G0000 Pedestration Paving G0000 Pedestration Paving G0000 Pedestration Paving G0000 Site Legisling A1010 Starkering A1010 | James - Appail Flewing and Surfacing James - Concrete Walkery James - Concrete Walkery James - Concrete Walkery James - Forest lesps Blace Flack James - Forest lesps Blace Flack James - Forest lesps Massich House Masseum - Wall Foundation - Store Massich House Masseum - Wall Foundation - Proceed Massich House Masseum - Column Foundations - Store Massich House Masseum - Column Foundations - Store Massich House Masseum - Column Foundations - Wall Massich House Masseum - Fore Dack & States - Wood Massich House Masseum - Fore Dack & States - Wood Massich House Masseum - Fore Dack & States - Wood Massich House Masseum - Fore Dack & States - Wood Massich House Masseum - Fore Dack & States - Wood Massich House Masseum - Fore Dack & States - Wood Massich House Masseum - Fore Dack & States - Wood Massich House Masseum - Wood Stating Massich House Masseum - Wo | 2006 1982 1982 1981 1981 2004 1985 1963 1963 1963 1963 1963 1985 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 20 1199 71 71 71 120 20 71 139 71 139 71 139 71 139 19 17 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,206 \$1,206 \$1,206 \$20,000 \$30,025 \$30,025 \$27,600 \$20,030 \$31,250 \$31,250 \$31,750 \$40,250 \$40,250 \$40,025 \$1,750 \$1,150 \$1 | -0.0002000000 -0.00020000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 Treatment Require |
| 202 Liverary 203 Liverary 204 Liverary 205 Liverary 205 Liverary 206 Liverary 206 Liverary 206 Liverary 206 Liverary 207 Liverary 208 Liverary 208 Mission Floure 209 Mission Floure 209 Mission Floure 209 Mission Floure 209 Mission Floure 200 Mission Floure 200 Mission Floure 200 Mission Floure 201 Mission Floure 201 Mission Floure 201 Mission Floure 202 Mission Floure 203 Mission Floure 204 Mission Floure 205 Mission Floure 206 Mission Floure 207 Mission Floure 207 Mission Floure 207 Mission Floure 208 Mission Floure 208 Mission Floure 209 Mission Floure 209 Mission Floure 209 Mission Floure 200 | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE SSELL | GGO STER MEMPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STORE STERROR VERTICAL STORE STORE STERROR VERTICAL ENCLOSURES SED EXTERIOR VERT | G0000 Apphalet Paving and Starkering G0000 Pedestration Paving G0000 Pedestration Paving G0000 Pedestration Paving G0000 Site Legisling A1010 Starkering A1010 | Jamay - Angelet Pawing and Surfacing Jamay - Concrete Walksay Jamay - Fornet leps Bare Flack Jamay - Fornet leps Massich House Masserun - Wall Foundation - Stone Series House Masserun - Wall Foundation - Promet Description - Fornet Massich House Masserun - Column Foundation - Stone Massich House Masserun - Column Foundation - Wen Massich House Masserun - Column Foundation - Wen Massich House Masserun - Stonen Fornet Selet Massich House Masserun - Forne Drack & State - Wood Massich House Masserun - Forne Drack & State - Wood Massich House Masserun - Forne Drack & State - Wood Massich House Masserun - Forne Drack & State - Wood Massich House Masserun - Forne Drack & State - Wood Massich House Masserun - Wood Stelling Massich House Masse | 2006 1982 1982 1981 1981 2004 1985 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 20 139 71 71 71 71 71 139 71 139 71 139 71 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,206 \$1,206 \$1,206 \$1,206 \$20,030 \$20,030 \$20,030 \$20,030 \$20,030 \$21,250 \$3,738 \$40,250 \$4 | -0.000200900 -0.000200900 -0.000200900 -0.000200900 -0.000200900000 -0.0002000000000000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 1020 to 2022 Treatment Required in 1020 to 2022 Treatment Required in 1020 to 2022 |
| 202 Livery 203 Livery 204 Livery 205 Livery 206 Livery 206 Livery 206 Livery 206 Livery 207 Livery 207 Livery 208 Livery 208 Livery 208 Livery 209 Mission focuse 200 Mission focuse 200 Mission focuse 200 Mission focuse 200 Mission focuse 201 Mission focuse 202 Mission focuse 203 Mission focuse 203 Mission focuse | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE SSELL S | GOS STER MEMOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STO SUPPERSTRUCTURE CON METEROR CONSTRUCTION CON STAMS CON INTERIOR FRANSISS | G0000 Apphalet Pawing and Starkering G0000 Pedestrian Pawing G0000 Pedestrian Pawing G0000 Pedestrian Pawing G0000 Pedestrian Pawing G0000 Site Lighting A1010 Starkerian Pawing G0000 Site Lighting A1010 Starkerian Pawing G0000 Pedestrian Pawing A1010 Starkerian Pawindstons B1010 Peter Construction B1010 Peter Construction B1010 Peter Construction B1010 Floor Construction C1010 Floor Floor C1010 Floor C1010 Floor Floor Floor Floor Floor Floor Floor Floor | Jamay - Angelet Pawing and Surfacing Jamay - Concrete Walksay Jamay - Fornet steps Jamay - Fo | 2006 1982 1982 1981 2004 1985 1963 1963 1963 1963 1963 1985 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 37 43 20 1199 71 71 71 129 20 71 139 71 139 71 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$9,821 \$6,050 \$1,206 \$1,206 \$1,206 \$1,206 \$1,206 \$2,700 \$30,225 \$20,700 \$30,225 \$27,600 \$20,030 \$11,250 \$37,36 \$41,250 \$41 | -0.000250908 -0.00 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 2022 Treatment Require |
| 202 Livery 203 Livery 204 Livery 205 Livery 205 Livery 205 Livery 206 Livery 206 Livery 207 Livery 207 Livery 208 Massion founce 209 Massion founce 200 Massion founce 200 Massion founce 200 Massion founce 201 Massion founce 201 Massion founce 202 Massion founce 203 Massion founce 204 Massion founce 205 Massion founce 205 Massion founce 206 Massion founce 207 Massion founce 208 Massion founce 208 Massion founce 209 Massion founce 209 Massion founce 209 Massion founce 200 Massion founc | G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE G SPEEL G S | GOS SITE MAPPOVEMENT GOS SITE | G0000 Apphalet Parving and Starkering G0000 Predestrain Parving G0000 Predestrain Parving G0000 Predestrain Parving G0000 Predestrain Parving G0000 Site Lighting A1010 Standard Foundations B1010 Four Constitution C1010 Four State Constitution C1010 Four State Constitution C1010 Four State Constitution C1010 Four Four State Constitution C1010 Four State C | Jamay - Angelet Reving and Surfacing Jamay - Control Walksony Jamay - Forted Reps Jama | 2006 1982 1982 1981 2004 1885 1885 1983 2004 1983 1983 1983 1985 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 37 139 171 71 71 139 71 139 139 139 139 139 139 139 139 139 13 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$30,225 \$30,225 \$27,000 \$22,000 \$27,000 \$27,000 \$27,000 \$27,000 \$37,280 \$37,280 \$40,250 \$40,250 \$40,250 \$40,450 \$40,250 \$40,450 \$40,250 \$40,450 \$40,250 | -0.08025998 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment in long term Treatment Required in 2021 or 2022 Treatment in long term Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2022 Tr |
| 202 Lizerry 203 Lizerry 204 Lizerry 205 Lizerry 205 Lizerry 205 Lizerry 205 Lizerry 206 Lizerry 206 Lizerry 207 Lizerry 208 Massionel Guse 209 Massionel Guse 200 Massionel Guse 201 Massionel Guse 201 Massionel Guse 201 Massionel Guse 202 Massionel Guse 203 Massionel Guse 203 Massionel Guse 204 Massionel Guse 205 Massionel Guse 206 Massionel Guse 206 Massionel Guse 207 Massionel Guse 208 Massionel Guse 208 Massionel Guse 209 Massionel Guse 209 Massionel Guse 209 Massionel Guse 200 Massionel Guse | G STEWORK A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE G SHELL G SHEL | GOS SITE MAPPOLYBENT GOS SITE MAPPOLYBEN GOS SITE MAPPOLYBE GOS MAPPOLYBE GOS MAPPOLYBE GOS MAPPOLYBE GOS MAPPOLYBE GOS M | G0000 Apphalat Paving and Surfacing G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Pedestrian Paving G0000 Site Lighting A1010 Standard Foundations B1001 Foundations B | Linary - Connected Wallways Linary - Frost steps Bion Flask Linary - Protest steps Bion Flask Linary - Protest Steps Massion House Masseum - Wall Foundation - Store Massion House Masseum - Wall Foundation - Store Massion House Masseum - Wall Foundation - Store Massion House Masseum - Column Foundation - Store Massion House Masseum - Store Dack & States - Wood Massion House Masseum - Store Dack & States - Wood Massion House Masseum - Foor Dack & States - Wood Massion House Masseum - Foor Dack & States - Wood Massion House Masseum - Foor Dack & States - Wood Massion House Masseum - Foor Dack & States - Wood Massion House Masseum - Foor Dack & States - Wood Massion House Masseum - Foor Dack & States - Wood Massion House Masseum - Wood Stefany Massion House Masseum - Wellow - Stemm Massion House Masseum - Wellow - Stemm Massion House Masseum - Wellow Dack Massion House Masseum - Wellow Dack Massion House Masseum - Wellow Dack Massion House Masseum - Johns Plantin & Store Massion House Masseum - Wood Foorting | 2006 1982 1982 1981 1981 2004 1885 1885 1953 1953 1953 1953 1953 1955 1955 195 | 16 42 36 43 37 43 20 139 771 71 139 71 139 139 139 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$9,821 \$8,050 \$2,070 \$1,208 \$40,825 \$30,225 \$20,700 \$1,208 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$21,000 \$21,000 \$40,250 | -0.000010998 -0.00001091091 -0.000001091 -0.00001091091 -0.000001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.00001091091 -0.000001091 -0.00001091091 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment |
| 202 Lizerry 203 Lizerry 204 Lizerry 205 Lizerry 205 Lizerry 205 Lizerry 205 Lizerry 206 Lizerry 206 Lizerry 207 Lizerry 208 Massionel Guse 209 Massionel Guse 200 Massionel Guse 201 Massionel Guse 201 Massionel Guse 201 Massionel Guse 202 Massionel Guse 203 Massionel Guse 204 Massionel Guse 205 Massionel Guse 205 Massionel Guse 206 Massionel Guse 207 Massionel Guse 208 Massionel Guse 209 Massionel Guse 209 Massionel Guse 209 Massionel Guse 200 Massionel Guse 201 Massionel Guse 200 Massionel Guse 201 Massionel Guse 201 Massionel Guse 201 Massionel Guse 201 Massionel Guse 202 Massionel Guse 203 Massionel Guse 203 Massionel Guse 203 Massionel Guse 204 Massionel Guse 205 Massionel Guse 205 Massionel Guse 206 Massionel Guse 207 Massionel Guse 207 Massionel Guse 208 Massionel Guse 208 Massionel Guse 209 Massionel Guse 209 Massionel Guse 209 Massionel Guse 200 Massionel Guse 201 Massionel Guse 201 Massionel Guse 201 Massionel Guse 202 Massionel Guse 203 Massionel Guse | G STEWORK A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE G SHELL G SHE | GOS SITE MAPPOLYBEINT | G0000 Apphalet Paving and Starkering G0000 Predestration Praving G0000 Predestration Praving G00000 Predestration Praving G00000 State Usylving A1010 Standard Foundations B1010 Foundations A1010 Standard Foundations B1010 Foundations B10 | Linary - Connect Walkway Linary - Frost steps Bine Flask Linary - Protect Lights Massich House Massam - Wall Foundation - Store Massich House Massam - Store Davis & States - Wood Massich House Massam - Store Davis & States - Wood Massich House Massam - Foor Davis & States - Wood Massich House Massam - Foor Davis & States - Wood Massich House Massam - Foor Davis & States - Wood Massich House Massam - Foor Davis & States - Wood Massich House Massam - Foor Davis & States - Wood Massich House Massam - Foor Davis & States - Wood Massich House Massam - Foor Davis & States - Wood Massich House Massam - Wood Stefny Massich House Massam - Wood Contra Massich House Massam - Wedd Down Massich House Massam - Wedd Contra Massich House Massam - Wedd Down Massich House Massam - Wood Contra Massich House Massam - House Massam - Wood Stefny Massich House Massam - House Massam - Wood Stefny Massich House Massam - House Massam - Stefn - Carpet Massich House Massam - Wood Contra Massich House | 2006 1982 1982 1981 1981 2004 1885 1885 1953 1953 1953 1953 1953 1953 1953 195 | 16 42 36 43 37 43 20 139 771 71 139 139 139 139 139 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$39,420 \$8,520 \$2,070 \$1,208 \$2,070 \$1,208 \$40,825 \$30,225 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$20,700 \$40,250 \$40,450 \$40,450 \$40,450 \$1,300 \$1,300 \$1,200 \$1 | -0.00000000000000000000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 Treatme |
| 200 Listery 200 Li | GSTEWORK ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE SSELL GSSELL GS | GOS STER MEMPOVEMENT GOS STER MEMPO GOS STER MEMPOVEMENT GOS STER MEMPO GOS | G0000 Apphalat Pawing and Starkening G0000 Pedestrian Pawing G0000 Sile Lighting A1010 Sile Lighting A1010 Sile Lighting A1010 Sandreat Foundations B1010 Four Construction C1010 Fairmen C1010 Firehes C1010 Firehes C1010 Firehes C1010 Firehes C1010 Firehes C1010 Firehes | Jamay - Angelet Pawing and Surfacing Jamay - Concrete Walksay Jamay - Fornet legs Massich House Masseum - Wall Foundation - Store Massich House Masseum - Wall Foundation - Power Jamas - Massich House Masseum - Column Foundation - Store Massich House Masseum - Column Foundation - Wall Massich House Masseum - Column Foundation - Wall Massich House Masseum - Column Foundation - Wall Massich House Masseum - Forne Dack & State - Wood Massich House Masseum - Forne Dack & State - Wood Massich House Masseum - Forne Dack & State - Wood Massich House Masseum - Forne Dack & State - Wood Massich House Masseum - Forne Dack & State - Wood Massich House Masseum - Forne Dack & State - Wood Massich House Masseum - Wood Stelling Massich House Masseum - Wood Colorie Massich House Masseum - Wood Stelling Massich House Masseum - Wood Doors Massich House Masseum - Wood Doors Massich House Masseum - Wood Doors Massich House Masseum - Wood Deors Massich House Masseum - Wood Doors | 2006 1982 1982 1981 1981 2004 1885 1953 1953 1985 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 37 43 20 1199 71 71 71 72 71 139 71 139 71 139 71 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$8,550 \$2,070 \$1,208 \$1,208 \$1,208 \$1,208 \$1,208 \$20,700 \$1,208 \$20,700 \$20,700 \$20,700 \$20,700 \$21,200 \$37,28 \$37,28 \$40,250 \$40,250 \$40,450 \$40, | -0.0002000000 -0.00020000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2023 Treatment Required in 2024 Treatmen |
| 200 Listery 201 Listery 202 Listery 203 Listery 204 Listery 204 Listery 205 Li | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE SSELL | GOS STEE MAPPOVEMENT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STORY GOS STEELE STORY GOS STEELE STORY MAPPOVEMENT GOS STEELE GOS S | G0000 Apphalat Pawing and Surfacing G0000 Pedestrain Pawing G0000 State Lighting A1010 Standard Foundations A1010 Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundatio | Jamay - Angelet Pawing and Surfacing Jamay - Control Wallsony Jamay - Fornet legs Mascin House Maseum - Wall Foundation - Stone Session House Maseum - Wall Foundation - Stone Mascin House Maseum - Wall Foundation - Prove Ofe Mascin House Maseum - Column Foundation - Wall Mascin House Maseum - Column Foundation - Wall Mascin House Maseum - Column Foundation - Wall Mascin House Maseum - Root Decks & Stabs - Wood Mascin House Maseum - Finor Decks & Stabs - Wood Mascin House Maseum - Finor Decks & Stabs - Wood Mascin House Maseum - Finor Decks & Stabs - Wood Mascin House Maseum - Finor Decks & Stabs - Wood Mascin House Maseum - Finor Decks & Stabs - Wood Mascin House Maseum - Finor Decks & Stabs - Wood Mascin House Maseum - Finor Decks & Stabs - Wood Mascin House Maseum - Wall Staffing Mascin House Maseum Officer Broomy Mascin House Maseum Officer Broomy Mascin Hous | 2006 1982 1982 1981 1981 2004 1885 1953 1953 1953 1985 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 37 43 20 1199 71 71 71 129 20 71 139 71 139 71 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$9,821 \$6,050 \$1,206 \$1,206 \$1,206 \$1,206 \$1,206 \$1,206 \$2,700 \$1,200 \$2,000 \$2,000 \$2,000 \$1,20 | -0.0002000000 -0.0002000000 -0.00020000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2022 Treatment Required in 2021 or 2022 Treatment Required in Require |
| 200 Listery 201 Li | G STEWORK A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE B SHELL C SHELL B SHELL B SHELL C SHELL B SHELL C SHELL B SHELL C SH | GOS STEE MERPOLYMENT STEE AND FOLMBATIONS AND FOLMBATIONS AND FOLMBATIONS STORY STEELE MERPOLYMENT STEELE MERPOLY | G0000 Apphalat Pawing and Surfacing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Site Lighting A1010 Standard Foundations A101 | Latery - Appail Parries and Surfacing Latery - Concrete Wallway Latery - Front steps Bine Rack Latery - Projector Lights Massich House Massers - Wall Foundation - Store Massich House Massers - Wall Foundation - Store Massich House Massers - Wall Foundation - Store Massich House Massers - Column Foundation - Store Massich House Massers - Column Foundation - Store Massich House Massers - Column Foundation - Store Massich House Massers - Standard Salo on Code Massich House Massers - Rich Dack & State - Wood Massich House Massers - Rich Dack & State - Wood Massich House Massers - Rich Dack & State - Wood Massich House Massers - Rich Dack & State - Wood Massich House Massers - Word Dack - State Massich House Massers - Word Dack Massich House Massers - Word Dock Massich House Masse | 2006 1982 1981 2004 1885 1885 1985 1985 1985 1985 1985 1985 | 16 42 36 43 43 20 139 71 71 71 71 139 139 149 159 171 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$30,420 \$8,201 \$8,050 \$2,070 \$1,208 \$1,208 \$2,070 \$1,208 \$2,070 \$1,208 \$2,070 \$3,025 \$3,025 \$3,025 \$3,025 \$3,025 \$3,008 \$3,009 \$3,000 \$ | -0.080250986 -0.080315137 -0.080415137 -0.080415137 -0.0804151247 -0.080415042 -0.0 | Treatment Required in 2021 or 2022 Treatment Required in 2022 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 orationed in long term Treatment Required in 2022 orationed in long term Treatment Required in 2022 orationed in long term authorised in long term authorised in long term authorised in long term treatment Required in 2022 Authorised in long term authorised long term autho |
| 200 Listery 201 Li | GSTEWORK ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE ASUBSTRUCTURE GSRELL G | GOS STER MAPPOLYBEINT GOS STERMAN AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS GOS SUPPERSTRUCTURE GO | G0000 Apphalat Pawing and Sarkariang G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Site Lighting A1010 Standard Foundations B1010 Four Constitution B1010 Four Firehes B1010 Four | James - Apaille Faverig and Surfacing James - Concrete Malesay Johan - Concrete Malesay Johan - Front sleps Bion Flack Johan - Profest Seps Bion Flack Johan - Projector Lights Massion House Massaum - Wall Foundation - Store Massion House Massaum - Wall Foundation - Power Johnson House Massaum - Wall Foundation - Power Johnson House Massaum - Column Foundations - Store Massion House Massaum - Column Foundations - Store Massion House Massaum - Standard State on Grade Massion House Massaum - Standard State on Grade Massion House Massaum - Standard State on Grade Massion House Massaum - Foor Dack & States - Wood Massion House Massaum - Foor Dack & States - Wood Massion House Massaum - Foor Dack & States - Wood Massion House Massaum - Foor Dack & States - Wood Massion House Massaum - Foor Dack & States - Wood Massion House Massaum - Foor Dack & States - Wood Massion House Massaum - Foor Dack & States - Wood Massion House Massaum - Wood Stding Massion House Massaum - Stding Company Massion House Massaum - Stding Company Massion House Massaum - Wood Stding Massion House Massaum - Wood Stding Massion House Massaum - Wood Down Massion House Massaum - Wood Stding Massion Ho | 2006 1982 1982 1981 1981 2004 1885 1983 2004 1983 1983 1983 2005 2005 2005 2005 2005 2005 2005 | 16 42 36 43 37 43 20 139 77 71 71 139 71 139 71 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$35,420 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$1,208 \$1,208 \$20,700 \$1,208 \$20,700 \$20,000 \$20,000 \$21,000 \$21,200 \$31,230 \$40,250 \$40,250 \$40,450 \$4 | -0.08025096 -0.08015187 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 Treatment Required in 2022 |
| 200 Listery 201 Listery 202 Listery 203 Listery 203 Listery 203 Listery 203 Listery 203 Listery 203 Listery 204 Listery 205 Listery 205 Listery 206 Listery 207 Listery 208 Massicref touse 209 Massicref touse 209 Massicref touse 200 Massicref touse 200 Massicref touse 200 Massicref touse 200 Massicref touse 201 Massicref touse 201 Massicref touse 203 Massicref touse 204 Massicref touse 205 Massicref touse 206 Massicref touse 207 Massicref touse 208 Massicref touse 208 Massicref touse 209 Massicref touse 209 Massicref touse 209 Massicref touse 200 Massicref touse 200 Massicref touse 200 Massicref touse 201 Massicref touse 201 Massicref touse 201 Massicref touse 202 Massicref touse 203 Massicref touse 203 Massicref touse 204 Massicref touse 205 Massicref touse 206 Massicref touse 207 Massicref touse 208 Massicref touse 208 Massicref touse 209 Massicref touse 209 Massicref touse 200 Massicref touse 200 Massicref touse 200 Massicref touse 201 Massicref touse 201 Massicref touse 201 Massicref touse 201 Massicref touse 202 Massicref touse 203 Massicref touse 203 Massicref touse 204 Massicref touse 205 Massicref touse 205 Massicref touse 205 Massicref touse 206 Massicref touse 207 Massicref touse | G STEWORK A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE G SIELL G SIEL | GOS SITE MAPPOLYBENTY | G0000 Apphalat Pawing and Sarkariang G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Site Lighting A1010 Standard Foundations B1010 Four Constitution B1010 Four Four Four Four Four Four Four Four | James - Apphalit Pewing and Surfacing James - Control Malloway James - Crost steps Bion Flask James - Crost steps Bion Flask James - Frost steps Bion Flask James - Prote steps Bion Flask James - Protes Steps Massion House Masseum - Wall Foundation - Store Massion House Masseum - Wall Foundation - Proceed Assion House Masseum - Wall Foundation - Step Assion House Masseum - Wall Foundation - Step Massion House Masseum - Column Foundations - Step Massion House Masseum - Step Desk & States - Wood Massion House Masseum - Step Desk & States - Wood Massion House Masseum - Foor Desk & States - Wood Massion House Masseum - Foor Desk & States - Wood Massion House Masseum - Foor Desk & States - Wood Massion House Masseum - Foor Desk & States - Wood Massion House Masseum - Foor Desk & States - Wood Massion House Masseum - Foor Desk & States - Wood Massion House Masseum - Foor Desk & States - Wood Massion House Masseum - Wood Stefng Massion House Masseum - Willows - Willow Massion House Masseum - Willow Chorn Massion House Masseum - Willows - Willow Massion House Masseum - Willows - Willow Massion House Masseum - District Guardenia & Screen Massion House Masseum - Courtering Massion House Masseum - Courtering Massion House Masseum - Wood Ceeling Massion House Masseum - Courtering - Massion House Masseum - Wood Ceeling Massion House Masseum - Courtering - Massion House Masseum - Wood Ceeling Massion House Masseum - Courtering - Massion House Masseum - Wood Ceeling Massion House Masseum - Courtering - Massion House Masseum - Wood Ceeling Massion House Masseu | 2006 1982 1982 1983 1981 2004 1885 1885 1953 1953 1953 1953 1955 1955 1955 195 | 16 42 36 43 37 43 20 139 771 71 71 139 71 139 139 139 139 139 139 159 159 159 159 159 159 159 159 159 15 | \$39,420 \$40,420 \$2,070 \$1,020 \$40,025 | -0.0002000000 -0.000010000000000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 282 Liverary 284 Liverary 285 Liverary 286 Liverary 286 Liverary 286 Liverary 286 Liverary 287 Liverary 287 Liverary 288 Missoori-House 289 Missoori-House 280 Missoori-House 281 Missoori-House 281 Missoori-House 281 Missoori-House 281 Missoori-House 281 Missoori-House 282 Missoori-House 283 Missoori-House | G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE G SHELL G | GOS STEE MAPPOLYBEINT GOS STEEMANT AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS SID SUPPERSTRUCTURE GOS GOS SUPPERSTRUCTURE GOS | G0000 Apphalat Pareing and Sarkariang G0000 Pedestrain Pareing G0000 Pedestrain Pareing G0000 Pedestrain Pareing G0000 Pedestrain Pareing G0000 Stee Lighting A1010 Standard Foundations B1010 F | James - Apphalit Pewing and Surfacing James - Control Malloway Lorary - Front sleps Bion Flack Johany - Oncred Walloway Lorary - Front sleps Bion Flack Johany - Propisor Lights Massion House Massaum - Wall Foundation - Store Massion House Massaum - Wall Foundation - Store Massion House Massaum - Wall Foundation - Power Of Control Massion House Massaum - Wall Foundation - Word Massion House Massaum - Standard State on Grade Massion House Massaum - Fron Dack & Blatts - Wood Massion House Massaum - Fron Dack & Blatts - Wood Massion House Massaum - Fron Dack & Blatts - Wood Massion House Massaum - Fron Dack & Blatts - Wood Massion House Massaum - Fron Dack & Blatts - Wood Massion House Massaum - Fron Dack & Blatts - Wood Massion House Massaum - Fron Dack & Blatts - Wood Massion House Massaum - Wood Siding Massion H | 2006 1982 1982 1981 1981 2004 1885 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 37 43 38 43 20 139 77 1 71 139 139 139 139 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$39,420 \$8,050 \$2,070 \$1,208 \$1,208 \$1,208 \$1,208 \$30,225 \$30,225 \$30,225 \$20,700 \$40,425 \$21,200 \$31,286 \$40,425 \$40, | -0.0002000000 -0.00000000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 280 Eurory 284 Eurory 284 Eurory 285 Eurory 286 Mission House 287 Mission House 286 Mission House 287 Mission House 286 Mission House 287 Mission House | GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK GSTEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B SUBSTRUCTURE | GOS STEE MAPPOLYMENTY AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS STO SUPPERSTRUCTURE STO SUPPERSTRUCTURE STO SUPPERSTRUCTURE STO SUPPERSTRUCTURE STO SUPPERSTRUCTURE STO SUPPERSTRUCTURE SOD SETTEROR VERTICAL ENCLOSURES SOD EXTEROR PRISES CON INTEROR PRISES | G0000 Apphalat Pawing and Surfacing G0000 Pedestrain Pawing G0000 State Lighting A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundations A1010 Foundations A1010 Standard Foundatio | James - Robert Beweig and Surfacing James - Control Wallsamy James - Crost Reps Barry - Control Reps Barry - Control Reps Barry - Export Reps Barry - Robert - Wall Foundation - Store Massion House Masseum - Wall Foundation - Proceed Barry - Column Foundation - Store Massion House Masseum - Column Foundation - Store Massion House Masseum - Column Foundation - Store Massion House Masseum - Robert Dack & States - Wood Massion House Masseum - Flore Dack & States - Wood Massion House Masseum - Flore Dack & States - Wood Massion House Masseum - Flore Dack & States - Wood Massion House Masseum - Robert Dack & States - Wood Massion House Masseum - Robert Dack & States - Wood Massion House Masseum - Wood Stating Massion House Masseum - Wood Massion Massion House Masseum - Wood Stating Massion H | 2006 1982 1982 1981 1981 2004 1985 1985 1985 1985 1985 1985 1985 1985 | 16 42 36 43 37 43 20 139 71 71 71 71 71 159 159 159 77 71 71 159 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$39,420 \$9,420 \$1,206 \$ | -0.00001001001001001001001001001001001001 | Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 T |
| 280 Eurory 281 Eurory 284 Eurory 285 Eurory 286 Massion House 287 Massion House 286 Massion House 287 Massion House 287 Massion House 286 Massion House 287 Massion House 287 Massion House 287 Massion House 288 Massion House 288 Massion House 289 Massion House 280 Massion House 280 Massion House 280 Massion House 281 Massion House 282 Massion House 283 Massion House 283 Massion House 283 Massion House 284 Massion House 285 Massion House 285 Massion House 285 Massion House 286 Massion House 287 Massion House 286 Massion House 287 Massion House | G STEWORK A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE B SHELL C STEWORK C ST | GOS SITE MAPPOVEMENT GOS SITEMATION GOS SITEMATI | G0000 Apphalat Pawing and Surfacing G0000 Pedestrian Pawing G0000 Site Lighting A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundation | Lintary - Charlest Wallway Lintary - Charlest Wallway Lintary - Charlest Wallway Lintary - Front steps Bine Ripak Lintary - Projector Lights Mission House Massam - Wall Foundation - Store Mission House Massam - Wall Foundation - Store Mission House Massam - Wall Foundation - Store Mission House Massam - Column Foundation - Store Mission House Massam - Column Foundation - Wood Mission House Massam - Foun Deals & Stole - Wood Mission House Massam - Foun Deals & Stole - Wood Mission House Massam - Foun Deals & Stole - Wood Mission House Massam - Roof Deals & Stole - Wood Mission House Massam - Wood Soling Mission House Massam - Wood Doors Mission House Massam - Wood Doors | 2006 1982 1981 2004 1885 1885 1985 1985 1985 1985 1985 1985 | 16 42 36 43 43 20 139 77 71 71 71 139 139 149 159 171 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$39,420 \$8,201 \$8,050 \$2,070 \$1,208 \$1,208 \$2,070 \$1,208 \$2,070 \$1,208 \$2,070 \$3,025 \$3,025 \$3,025 \$3,025 \$3,025 \$3,025 \$3,008 \$3,009 \$3,009 \$3,009 \$3,000 \$ | -0.0000100000 -0.00001000000000000000000 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 Treatment Required in 2022 treatment In long term Treatment Required in 2021 or 2022 treatment in long term Treatment Required in 2021 or 2022 treatment in long term Treatment Required in 2021 or 2022 treatment in long term Treatment Required in 2021 or 2022 treatment in long term Treatment Required in 2021 or 2022 treatment in long term Treatment Required in 2022 |
| 200 Liberary 201 Missister House 201 Missister House 202 Missister House 203 Missister House 204 Missister House 205 Missister House 206 Missister House 207 Missister House 207 Missister House 208 Missister House 208 Missister House 209 Missister House 209 Missister House 209 Missister House 200 Missister House 200 Missister House 200 Missister House 201 Missister House 202 Missister House 203 Missister House 203 Missister House 203 Missister House 204 Missister House 205 Missister House 205 Missister House 206 Missister House 207 Missister House 207 Missister House 207 Missister House 208 Missister House 208 Missister House 209 Missister House 209 Missister House 209 Missister House 201 Missister House 201 Missister House 201 Missister House 202 Missister House 203 Missister House | G STEWORK A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE A SLESTRUCTURE B SHELL C SHELL B SHELL C SH | GOS STE MAPPOVEMENT GOS STEMPOST GOS AND FOUNDATIONS GOS STEMPOST GOS GOS STEMPOST GOS SUPPERSTRUCTURE GOS EXTERNOR VERTICAL ENCLOSURES GOS TAMBOS GOS EXTERNOR VERTICAL ENCLOSURES GOS ON TRESTOR FOR THE CONTROL ON THE | G0000 Apphalit Paring and Starkering G0000 Pedestrian Paring G0000 Starkery A1010 Standard Foundations A1010 Foundations A1010 Foundations A1010 Foundations A1010 Foundations A1010 Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundations A1010 Stand | Lintary - Charlest Wallway Lintary - Charlest Wallway Lintary - Front steps Bine Rack Lintary - Projector Lights Massich Protest Manage Bine Rack Lintary - Projector Lights Massich Place Manage Massich Place Massich - Wall Foundation - Store Massich Place Massich - Wall Foundation - Store Massich Place Massich - Wall Foundation - Deute of Lintary Massich Place Massich - Column Foundation - Wood Massich Place Massich - Column Foundation - Wood Massich Place Massich - Column Foundation - Wood Massich Place Massich - Wood Store - Wood Massich Place Massich - Foundation - Wood Massich Place Massich - Wood Storing - Wood S | 2006 1982 1982 1981 2004 1885 1885 2004 1953 1953 1953 1953 1955 1955 1955 1955 | 16 42 36 43 43 20 139 771 71 20 71 139 139 139 139 149 159 177 119 19 19 19 19 19 19 19 19 19 19 19 19 | \$39,420 \$8,201 \$8,050 \$2,070 \$1,208 \$1,208 \$2,070 \$1,208 \$2,070 \$1,208 \$2,070 \$3,025 \$3,025 \$3,025 \$3,025 \$3,025 \$3,025 \$3,008 \$ | | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 treatment In long term Treatment Required in 2022 treatment in long term Treatment Required in 2022 treatment in long term Treatment Required in 2022 treatment in long term seatment in long term seatment in long term treatment Required in 2021 or 2022 treatment in long term seatment in long term Treatment Required in 2021 or 2022 seatment in long term s |
| 2021 Liverary 2031 Liverary 2031 Liverary 2032 Liverary 2032 Liverary 2032 Liverary 2032 Liverary 2033 Liverary 2034 Liverary 2035 Liverary 2036 Liverary 2036 Liverary 2037 Liverary 2037 Liverary 2038 Missocire focuse 2039 Missocire focuse 2030 Missocire focuse 2031 Missocire focuse 2031 Missocire focuse 2031 Missocire focuse 2034 Missocire focuse 2034 Missocire focuse 2035 Missocire focuse 2036 Missocire focuse 2037 Missocire focuse 2036 Missocire focuse 2037 Missocire focuse 2036 Missocire focuse 2037 Missocire focuse 2037 Missocire focuse 2037 Missocire focuse 2038 Missocire focuse 2038 Missocire focuse 2038 Missocire focuse 2037 Missocire focuse 2037 Missocire focuse 2037 Missocire focuse 2037 Missocire focuse 2038 Missocire focuse 2038 Missocire focuse 2038 Missocire focuse 2038 Missocire focuse 2037 Missocire focuse 20 | GSTEWORK AS BESTEWORK GSTEWORK AS BESTEWORK BOSELL | GOS STE MAPPOVEMENT GOS STEMPOST GOS | G0000 Apphalat Pawing and Surfacing G0000 Pedestrain Pawing G0000 Site Lighting A1010 Standard Foundations A1010 Foundation | James - Protes Masses - Protes Sales - Vision Masses - Protes Masses - Vision | 2006 1982 1982 1981 2004 1885 1885 2004 1953 1963 1963 1963 1965 1965 1965 1965 1965 1965 1965 1965 | 16 42 36 43 36 43 37 43 20 139 171 71 139 139 171 139 139 19 171 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$39,420 \$8,050 \$2,070 \$1,208 \$2,070 \$1,208 \$2,070 \$1,208 \$2,070 \$1,208 \$2,070 \$2,070 \$3,025 \$3,025 \$3,025 \$3,025 \$3,025 \$3,025 \$3,030 \$3,030 \$3,030 \$3,030 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$40,420 \$41 | -0.080219916 -0.080219916 -0.080219917 -0.08 | Treatment Required in 2021 or 2022 Treatment Required in 2021 Treatment Required in 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2021 or 2022 treatment Required in 2022 |
| 200 Listery 201 Li | GSTEWORK ASJABSTRUCTURE ASJABSTRUCTURE ASJABSTRUCTURE ASJABSTRUCTURE GSRELL | GOS STEE MAPPOLYBEINT GOS STEEMAN AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS AND FOUNDATIONS GOS SUPPERSTRUCTURE GOS SU | G0000 Aprilate Pareing and Starkering G0000 Prodestration Pareing G0000 Prodestration Pareing G0000 Prodestration Pareing G00000 State Decomposed G0000 State Decomposed G0000 State Lighting A1010 Standard Foundations B1010 Four Constitution B1010 Four Firelines | James - Protes Masses - Very March Service Masses - Very Masses - Very March Service Masses - Very M | 2006 1982 1982 1981 1981 2004 1885 1981 2004 1983 1983 1983 1983 1983 1983 2005 2005 2005 1983 2006 2005 1983 2006 2005 1983 2006 2006 2006 2006 | 16 42 36 43 36 43 37 43 20 139 171 71 139 139 171 139 139 19 19 19 19 19 19 19 19 19 19 19 19 19 | \$39,420 \$8,050 \$2,070 \$1,208 \$2,070 \$1,208 \$1,208 \$1,208 \$1,208 \$20,700 \$1,208 \$20,700 \$1,208 \$20,700 \$20,700 \$20,000 \$20,000 \$20,000 \$21,200 \$21,200 \$21,200 \$3,738 \$40,250 \$41,200 \$ | | Treatment Required in 2021 a 2022 Treatment Required in 2022 a 2022 Treatment Required in 2022 a 2022 Treatment Required in 2021 a 2022 Treatment Required in 2022 Treatment |
| 200 Listery 201 Li | GSTEWORK ASJASTRUCTURE ASJASTRUCTURE ASJASTRUCTURE ASJASTRUCTURE GSHELL | GOS STE MAPPOVEMENT GOS PROFITCH GOS STE MAPPOVEMENT | G0000 Aprilate Pareing and Starkering G0000 Prodestration Pareing G0000 Prodestration Pareing G0000 Prodestration Pareing G00000 State Decomposed G0000 State Decomposed G0000 State Lighting A1010 Standard Foundations B1010 Foundations B1 | James - Protes Masses - Very March States - Very Masses - Very March States - Very March - Very March States - Very March States - Very March States - Very March - Ver | 2006 1982 1982 1981 1981 2004 1985 1986 1987 1988 1988 1985 1985 1985 1985 1985 1985 | 16 42 36 43 36 43 37 43 38 43 20 139 139 71 71 139 71 139 139 139 139 139 139 139 139 139 13 | \$35,420 \$8,050 \$2,070 \$1,208 \$2,070 \$1,208 \$20,700 \$1,208 \$20,700 \$1,000 \$20,000 \$20,000 \$20,000 \$21,000 \$21,000 \$21,000 \$3,738 \$40,250 \$41,250 \$40,250 \$40,250 \$40,450 \$4 | -0.080250986 -0.08051510-0 -0. | Treatment Required in 2021 a 2022 Treatment Required in 2022 a 2022 Treatment Required in 2022 a 2022 Treatment Required in 2021 a 2022 Treatment Required in 2021 Treatment Required in 2021 Treatment Required in 2022 Treatment Require |
| 2021 Liverary 2031 Liverary 2031 Liverary 2032 Liverary 2032 Liverary 2032 Liverary 2032 Liverary 2033 Liverary 2033 Liverary 2034 Liverary 2035 Liverary 2036 Liverary 2036 Liverary 2037 Liverary 2037 Liverary 2038 Missocire focuse 2039 Missocire focuse 2030 Missocire focuse 2031 Missocire focuse 2031 Missocire focuse 2034 Missocire focuse 2034 Missocire focuse 2034 Missocire focuse 2035 Missocire focuse 2036 Missocire focuse 2037 Missocire focuse 2038 Missocire focuse 2038 Missocire focuse 2038 Missocire focuse 2039 Misso | G STEWORK A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE A SUBSTRUCTURE B SHELL C SHELL B SHELL C SHELL B SHELL C SH | GOS STER MAPPOVEMENT GOS STERMAN | G0000 Apphalat Pawing and Surfacing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Pedestrain Pawing G0000 Site Lighting A1010 Standard Foundations A1010 Foundations A1010 Foundations A1010 Foundations A1010 Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Standard Foundations A1010 Foundations A1010 Standard Foundat | Larray - Fonds also as Marken Larray - Connected Wallway Larray - Fonds steps Bible Rack Larray - Fonds steps Massich House Masson - Vall Foundation - Steps Massich House Masson - Vall Foundation - Steps Massich House Masson - Vall Foundation - Power Massich House Masson - Column Foundation - Woo Massich House Masson - Column Foundation - Woo Massich House Masson - Column Foundation - Woo Massich House Masson - Steps Steps & State - Wood Massich House Masson - Foun Decks & State - Wood Massich House Masson - Foun Decks & State - Wood Massich House Masson - Foun Decks & State - Wood Massich House Masson - Wood Stelley Massich House Masson - Wood Doors Massich House Masson - | 2006 1982 1982 1981 2004 1988 1981 2004 1988 1988 1988 1985 1985 1985 1985 1985 | 16 42 36 43 43 20 139 771 71 71 139 139 139 139 139 149 159 171 139 159 171 139 159 171 139 159 171 139 159 171 139 159 171 139 159 171 159 171 159 171 171 181 181 181 181 181 181 181 181 | \$39,420 \$40,20 \$40,20 \$1,208 \$1,208 \$1,208 \$1,208 \$1,208 \$1,208 \$1,209 \$1,200 \$ | -0.08025998 -0.08051919 | Treatment Required in 2021 or 2022 Treatment Required in 2022 2021 or 2022 Treatment Required in 2022 or 2022 Treatment Required in 2022 Treat |

| 347 MissionHouse | G SITEWORK | G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting | Mission House Museum - Exterior Lighting Fixtures | 2005 | 19 | \$575 | -0.089552619 | Treatment Required in 2022 |
|--|---|--|---|---|----------------------|----------------|----------------------------------|---|--|
| | | | | | | | | | |
| 348 Municipal Office 349 Municipal Office | A SUBSTRUCTURE A SUBSTRUCTURE | A10 FOUNDATIONS A10 FOUNDATIONS | A1010 Standard Foundations A1030 Slab on Grade | Municipal Office - Foundation and Footings Municipal Office - Standard Slab on Grade | 1959 1959 | 65 65 | \$285,200 \$154,560 | -0.089295996 0.570968469 | Treatment Requried in 2021 or 2022 treatment in long term |
| 350 Municipal Office 351 Municipal Office | B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B1010 Floor Construction B1020 Roof Construction | Municipal Office - Floor Decks & Slabs - Wood Frame Municipal Office - Canopies | 1959 2001 | 65 23 | \$154,560 \$2,300 | 0.571241523 | treatment in long term treatment in long term |
| 352 Municipal Office | B SHELL | B10 SUPERSTRUCTURE | B1020 Roof Construction | Municipal Office - Roof Decks & Slabs - Wood Deck | 1959 | 65 | \$267,375 | 0.661524023 | treatment in long term |
| 353 Municipal Office 354 Municipal Office 355 Municipal Office | B SHELL B SHELL | B10 SUPERSTRUCTURE B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls B2010 Exterior Walls | Municipal Office - Brick Walls Municipal Office - Concrete Blocks | 1959 1959 | 65 65 | \$22,080 \$75,900 | -0.088183042 -0.087878526 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 358 Municipal Office 358 Municipal Office 357 Municipal Office | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls B2020 Exterior Windows | Municipal Office - Vinyl Siding Municipal Office - Aluminum Soffit Municipal Office - Windows - Vinyl | 2001 2001 2011 | 23 23 13 | \$11,500 \$13,340 \$45,540 | 0.672438921 0.622770894 | treatment in long term treatment in long term treatment in long term |
| 358 Municipal Office 359 Municipal Office | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2020 Exterior Windows B2020 Exterior Windows B2020 Exterior Windows | Municipal Office - Windows - Vinyl Municipal Office - Windows - Vinyl Municipal Office - Windows - Aluminum | 2020 1996 | 4 28 | \$6,728 \$13,973 | 0.773486465 0.823875224 | treatment in long term treatment in long term |
| 360 Municipal Office 361 Municipal Office | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2020 Exterior Windows B2020 Exterior Windows | Municipal Office - Windows - Sills Municipal Office - Windows - Caulking | 1959 2001 | 65 23 | \$11,644 \$5.175 | -0.0334375 -0.09962423 | Treatment Required in 2021 or 2022 |
| 362 Municipal Office 363 Municipal Office | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B2030 Exterior Doors B3010 Roof Coverings | Municipal Office - Roofing - Asphalt Shingles Municipal Office - Roofing - Asphalt Shingles | 1996 2015 | 23 28 9 | \$18,400 \$42,780 | -0.09962423 0.860532098 -0.081424654 | treatment in long term Treatment Required in 2021 or 2022 |
| 364 Municipal Office 365 Municipal Office | B SHELL C INTERIORS | B30 EXTERIOR HORIZONTAL ENCLOSURES C10 INTERIOR CONSTRUCTION | B3010 Roof Coverings C1010 Partitions | Municipal Office - Gutters and Downspouts Municipal Office - Interior Guardraits & Screens | 2001 2001 | 23 23 | \$3,985 \$1,150 | 0.72573455 0.676311587 | treatment in long term treatment in long term |
| | | | | | | | | | |
| 367 Municipal Office 367 Municipal Office 368 Municipal Office | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1010 Partitions C1010 Partitions C1020 Interior Doors | Municipal Office - Interior Guardrails & Screens Municipal Office - Interior Windows Municipal Office - Metal Clad Door | 2001 2011 2011 | 23 13 13 | \$7,406 \$345 \$2,875 | -0.084788094 0.73339806 0.68110266 | Treatment Required in 2021 or 2022 treatment in long term treatment in long term |
| oco municipal Onice | UNITERIOR | STORT LINE CONDITION OF | OTOLO III.C.I.O. DOOLS | municipal Onto - muai Onto Door | 2011 | 10 | 42,515 | 0.00110200 | acaument in rong com |
| 369 Municipal Office 370 Municipal Office | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors | Municipal Office - Wood Doors Municipal Office -Wood Closet Doors | 2001 1981 | 23 43 | \$21,563 \$2,875 | -0.02849352 0.367035068 | Treatment Required in 2021 or 2022 - wsha treatment required in medium term |
| 371 Municipal Office 372 Municipal Office | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors | Municipal Office - Interior Doors Municipal Office - Roll Up Doors | 2021 2016 | 3 8 | \$3,450 \$6,900 | -0.0927779 0.628571429 | Treatment Required in 2021 or 2022 treatment in long term |
| 373 Municipal Office 374 Municipal Office 375 Municipal Office | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings C1030 Fittings | Municipal Office - Cabinets Municipal Office - Cabinets Municipal Office - Countertop | 2006 2006 2006 | 18 18 18 | \$11,500 \$23,000 \$16,790 | 0.567411644 0.167603859 -0.092201085 | treatment in long term treatment required in medium term Treatment Required in 2021 or 2022 |
| 376 Municipal Office | CINTERIORS | C20 STAIRS | C2010 Interior Stair Construction | Municipal Office - Stairs - Wood | 1959 | 65 | \$11,500 | 0.517996995 | treatment in long term |
| 377 Municipal Office 378 Municipal Office | C INTERIORS C INTERIORS | C20 STAIRS C20 STAIRS | C2010 Interior Stair Construction | Municipal Office - Stairs - Wood Municipal Office - Stair Finish - Carpet | 2001 1991 | 23 33 | \$11,500 \$2,875 | -0.091801703 -0.091596963 | Treatment Required in 2021 or 2022 (small |
| 379 Municipal Office 380 Municipal Office | C INTERIORS C INTERIORS | C20 STAIRS C30 INTERIOR FINISHES | C2020 Stair Finishes C2020 Stair Finishes C3010 Wall Finishes | Municipal Office - Stair Finish - Ceramic Tites Municipal Office - Stair Finish - Ceramic Tites Municipal Office - Gypsum Board Walls | 2001 | 23 23 | \$2,933 \$17,250 | 0.118611447 -0.091176218 | treatment required in medium term Treatment Required in 2021 or 2022 |
| 381 Municipal Office 382 Municipal Office | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3020 Floor Finishes | Municipal Office - Wood Paneling Municipal Office - Ceramic Flooring | 1959 2001 | 65 23 | \$6,095 \$81,995 | 0.069040321 -0.090738631 | treatment required in medium term Treatment Required in 2021 or 2022 |
| 383 Municipal Office 384 Municipal Office 385 Municipal Office | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3030 Ceiling Finishes | Municipal Office - Carpet Flooring Municipal Office - Acoustic Ceiling Tiles Municipal Office - General Roard Ceilings | 2011 2011 2021 | 13 13 | \$29,739 \$39,514 \$5,750 | -0.081428571 0.819487263 | Treatment Required in 2021 or 2022 treatment in long term |
| 385 Municipal Office 386 Municipal Office 387 Municipal Office | D SERVICES D SERVICES | C30 INTERIOR FINISHES D10 Conveying D10 Conveying | C3030 Ceiling Finishes D1010 Elevators and Lifts D1010 Elevators and Lifts | Municipal Office - Gypsum Board Ceilings Municipal Office - Wheelchair Lift Municipal Office - Wheelchair Lift - Cabinet Modernizat | 2021 2001 2001 | 3 23 23 | \$5,750 \$51,750 \$23,000 | -0.090281627 0.750621824 0.700953797 | Treatment Required in 2021 or 2022 treatment in long term treatment in long term |
| 388 Municipal Office 389 Municipal Office | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2020 Domestic Water Distribution | Municipal Office - Plumbing Fixtures Municipal Office - Domestic Water Equipment | 1991 2011 | 33 13 | \$10,350 \$4,025 | 0.001271244 0.651575761 | treatment required in medium term treatment in long term |
| 390 Municipal Office 391 Municipal Office | D SERVICES D SERVICES | D20 PLUMBING D30 HVAC | D2020 Domestic Water Distribution D3020 Heat Generating Systems | Municipal Office - Domestic Hot Water Tank Municipal Office - Furnaces | 2016 1994 | 8 30 | \$2,300 \$14,950 | -0.108131305 -0.107848804 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 392 Municipal Office 393 Municipal Office 394 Municipal Office | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D30 HVAC | D3020 Heat Generating Systems D3030 Cooling Generating Systems D3040 Distribution Systems | Municipal Office - Ductwork Municipal Office - Condenser Municipal Office - Exhaust Fans | 1959 1994 1991 | 65 30 33 | \$17,250 \$9,775 \$2,415 | -0.10757575 -0.100894304 -0.081428571 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 395 Municipal Office 396 Municipal Office | D SERVICES D SERVICES D SERVICES | D30 HVAC D40 FIRE PROTECTION | D3050 Terminal and Package Units D4030 Fire Protection Specialties | Municipal Office - Baseboard Heaters Municipal Office - Baseboard Heaters Municipal Office - Fire Extinguishing Devices | 2001 | 23 | \$7,763 \$4,715 | 0.584615385 -0.125384615 | treatment in long term Treatment Required in 2022 |
| 397 Municipal Office 398 Municipal Office | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5010 Electrical Service and Distribution D5010 Electrical Service and Distribution | Municipal Office - Electrical Distribution - Panels and S Municipal Office - Electrical Distribution - Panels and S | 1994 2001 | 30 23 | \$17,825 \$575 | -0.125384615 0.534615385 | electrical is fine treatment in long term |
| 399 Municipal Office 400 Municipal Office | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | Municipal Office - Lighting - Fluorescent Municipal Office - Lighting - T8 Fluorescent | 2001 2011 | 23 13 | \$31,395 \$1,610 | -0.125384615 -0.125384615 | Treatment Requried in 2022 Treatment Requried in 2022 |
| 401 Municipal Office 402 Municipal Office 403 Municipal Office | D SERVICES D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5030 Communications and Security D5030 Communications and Security | Municipal Office - Lighting - Incandescent Municipal Office - Security System Municipal Office - CCTV | 2001 2011 2018 | 23 13 6 | \$805 \$2,875 \$4,025 | -0.125384615 -0.025710863 0.529656755 | Treatment Required in 2022 treatment required in medium term treatment in long term |
| 404 Municipal Office 405 Municipal Office | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5030 Communications and Security D5030 Communications and Security D5090 Other Electrical Systems | Municipal Office - PA System Municipal Office - Emergency Lighting and Power - Exi | 2013 2018 | 11 | \$4,025 \$3,450 | 0.026958783 -0.088947368 | treatment required in medium term Treatment Required in 2022 |
| 406 Municipal Office 407 Municipal Office | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5090 Other Electrical Systems D5090 Other Electrical Systems | Municipal Office - Emergency Lighting and Power - Em Municipal Office - Emergency Lighting and Power - Tra | 2004 2004 | 20 20 | \$17,250 \$5,750 | 0.53 0.648943659 | treatment in long term treatment in long term |
| 408 Municipal Office 409 Municipal Office | D SERVICES E EQUIPMENT AND FURNISHINGS | | D5090 Other Special Systems & Devices E1010 Commercial Equipment | Municipal Office - Special Systems & Devices Municipal Office - Security and Vault Equipment | 2019 1959 | 5 65 | \$2,875 \$40,250 | 0.674732732 0.627700188 | treatment in long term treatment in long term |
| 410 Municipal Office 411 Municipal Office 412 Municipal Office | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | E1090 Other Equipment G2020 Parking Lots G2030 Pedestrian Paving | Municipal Office - Food Service Equipment - Kitchen Municipal Office - Asphalt Paving and Surfacing Municipal Office - Concrete Pad | 2001 2001 2001 | 23 23 23 | \$9,603 \$151,340 \$8,970 | 0.400273415 -0.090044886 0.720197945 | appliances are OK for now Treatment Required in 2021 or 2022 treatment in long term |
| 413 Municipal Office 414 Municipal Office | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Pedestrian Paving G2040 Site Development | Municipal Office - Guardrails & Barriers Municipal Office - Exterior Furnishings - Wood Bench | 2001 2001 | 23 23 | \$575 \$1,150 | 0.770447381 0.070704004 | treatment in long term treatment required in medium term |
| 415 Municipal Office 416 Municipal Office | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G30 SITE MECHANICAL UTILITIES | G2040 Site Development G3060 Fuel Distribution | Municipal Office - Flagpoles Municipal Office - Liquid Fuel Storage Tanks - Oil | 2001 2012 | 23 12 | \$4,025 \$2,300 | 0.860219027 | treatment in long term treatment in long term |
| 417 Municipal Office 418 Municipal Office 419 North Firehall | G SITEWORK G SITEWORK A SUBSTRUCTURE | G20 SITE IMPROVEMENT G40 SITE ELECTRICAL UTILITIES A10 FOLINDATIONS | G3060 Fuel Distribution G4020 Site Lighting A1010 Standard Foundations | Municipal Office - Liquid Fuel Storage Tanks - Diesel Municipal Office - Exterior Lighting Fixtures North Firehall - Foundation and Footings | 2012 2001 1988 | 12 23 36 | \$2,300 \$1,208 \$156,400 | 0.721241523 -0.088475977 -0.088183042 | treatment in long term Treatment Required in 2022 Treatment Required in 2021 or 2022 |
| 420 North Firehall 421 North Firehall | A SUBSTRUCTURE A SUBSTRUCTURE B SHELL | A10 FOUNDATIONS A10 FOUNDATIONS B10 SUPERSTRUCTURE | A1010 Standard Foundations A1030 Slab on Grade B1010 Floor Construction | North Firehall - Foundation and Footings North Firehall - Standard Slab on Grade North Firehall - Floor Decks & Slabs - Wood Frame | 1988 1988 | 36 36 | \$123,625 \$18,975 | -0.088183042 -0.087878526 0.672438921 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 treatment in long term |
| 422 North Firehall 423 North Firehall | B SHELL B SHELL | B10 SUPERSTRUCTURE B20 EXTERIOR VERTICAL ENCLOSURES | B1020 Roof Construction B2010 Exterior Walls | North Firehall - Roof Decks & Slabs - Metal Deck North Firehall - Exterior Concrete Blocks | 1988 1988 | 36 36 | \$123,625 \$12,420 | 0.722770894 | treatment in long term treatment in long term |
| 424 North Firehall 425 North Firehall | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | North Firehall - Metal Cladding North Firehall - Aluminum Soffit Panel | 1988 1988 | 36 36 | \$135,240 \$460 | 0.623486465 0.573875224 | treatment in long term treatment in long term |
| 426 North Firehall 427 North Firehall 428 North Firehall | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2020 Exterior Windows B2030 Exterior Doors B2030 Exterior Doors | North Firehall - Windows - Aluminum North Firehall - Glazed Entrances North Firehall - Exterior Doors and Frames - Steel | 1988 1988 1988 | 36 36 36 | \$10,868 \$5,750 \$8,625 | -0.0334375 0.11037577 0.160532098 | Treatment Required in 2021 or 2022 treatment required in medium term treatment required in medium term |
| 429 North Firehall 430 North Firehall | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B2030 Exterior Doors B3010 Roof Coverings | North Firehall - Overhead Door - Plexiglass North Firehall - Roofing - Modified Bitumen | 2016 2020 | 8 4 | \$41,400 \$148,350 | 0.528575346 0.87573455 | treatment in long term treatment in long term |
| 431 North Firehall 432 North Firehall | B SHELL C INTERIORS | B30 EXTERIOR HORIZONTAL ENCLOSURES C10 INTERIOR CONSTRUCTION | B3010 Roof Coverings C1010 Partitions | North Firehall - Gutters and Downspouts North Firehall - Interior Guardrails & Screens | 1988 1988 | 36 36 | \$5,750 \$6,325 | 0.826311587 0.775211906 | treatment in long term treatment in long term |
| 433 North Firehall 434 North Firehall 435 North Firehall | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors | North Firehall - Interior Doors North Firehall - Interior Doors North Firehall - Interior Doors | 2011 1988 1988 | 13 36 36 | \$575 \$7,188 \$1,725 | 0.73339806 0.23110266 | treatment in long term treatment required in medium term |
| 436 North Firehall 436 North Firehall 437 North Firehall | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C20 STAIRS | C1020 Interior Doors C1030 Fittings C2010 Interior Stair Construction | North Firehall - Interior Doors North Firehall - Countertop North Firehall - Stairs - Wood | 1988 1988 1988 | 36 36 36 | \$1,725 \$1,150 \$11,500 | 0.33150648 0.317035068 0.8672221 | treatment required in medium term treatment required in medium term treatment in long term |
| 438 North Firehall 439 North Firehall | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes | North Firehall - Concrete Block Walls North Firehall - Gypsum Board Walls | 1988 1988 | 36 36 | \$23,000 \$28,750 | 0.628571429 0.567411644 | treatment in long term treatment in long term |
| 440 North Firehall 441 North Firehall | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3020 Floor Finishes | North Firehall - Plywood Walls North Firehall - Plywood Flooring | 1988 1988 | 36 36 | \$1,001 \$3,864 | 0.517603859 0.567798915 | treatment in long term treatment in long term |
| 442 North Firehall 443 North Firehall 444 North Firehall | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes C3030 Ceiling Finishes | North Firehall - VCT Resilient Flooring North Firehall - Carpet Flooring North Firehall - Stucco Ceiling | 1988 1988 1988 | 36 36 36 | \$8,280 \$2,024 \$7,452 | 0.367996995 -0.091801703 0.658403037 | treatment required in medium term Treatment Required in 2022 treatment in long term |
| 445 North Firehall 446 North Firehall | C INTERIORS C INTERIORS D SERVICES | C30 INTERIOR FINISHES C30 INTERIOR FINISHES D20 PLUMBING | C3030 Ceiling Finishes D2010 Plumbing Fixtures | North Firehall - Stucco Ceiling North Firehall - Gypsum Board Ceilings North Firehall - Plumbing Fixtures | 1988 1988 | 36 36 | \$45,540 \$7,475 | 0.668611447 -0.091176218 | treatment in long term treatment in long term Treatment Required in 2022 |
| 447 North Firehall 448 North Firehall | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2020 Domestic Water Distribution D2020 Domestic Water Distribution | North Firehall - Domestic Water Equipment North Firehall - Domestic Hot Water Tank | 2020 2011 | 4 13 | \$2,300 \$1,725 | -0.090959679 0.619261369 | Treatment Required in 2021 or 2022 treatment in long term |
| 449 North Firehall 450 North Firehall 451 North Firehall | D SERVICES D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING D30 HVAC | D2090 Other Plumbing Systems D2090 Other Plumbing Systems | North Firehall - Compressed Air Systems North Firehall - Filling Station | 2016 2016 | 8 8 | \$11,500 \$23,000 | 0.728571429 0.769487263 0.819718373 | treatment in long term treatment in long term |
| 451 North Firehall 452 North Firehall 453 North Firehall | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D30 HVAC | D3040 Distribution Systems D3040 Distribution Systems D3040 Distribution Systems | North Firehall - Exhaust Fan - Propeller Fan North Firehall - Exhaust Fans North Firehall - Ventilation Fans | 1988 1988 2001 | 36 36 23 | \$2,875 \$1,035 \$5,750 | 0.819718373 -0.109378176 0.850953797 | treatment in long term Treatment Requried in 2022 treatment in long term |
| 454 North Firehall 455 North Firehall | D SERVICES D SERVICES | D30 HVAC D30 HVAC | D3050 Terminal and Package Units D3050 Terminal and Package Units | North Firehall - Suspended Radiant Unit Heaters North Firehall - Suspended Electric Unit Heaters | 2020 2011 | 4 13 | \$18,975 \$21,850 | 0.701271244 0.651575761 | treatment in long term treatment in long term |
| 456 North Firehall 457 North Firehall | D SERVICES D SERVICES | D30 HVAC D30 HVAC | D3050 Terminal and Package Units D3050 Terminal and Package Units | North Firehall - Wall-Mounted Electric Unit Heaters North Firehall - Baseboard Heaters | 1988 1988 | 36 36 | \$863 \$4,313 | 0.102151196 | treatment required in medium term treatment required in medium term |
| 458 North Firehall 459 North Firehall 460 North Firehall | D SERVICES D SERVICES D SERVICES | D30 HVAC D40 FIRE PROTECTION D50 ELECTRICAL | D3060 Controls and Instrumentation D4030 Fire Protection Specialties D5040 Electrical Service and Distribution | North Firehall - Exterior Lighting Controls North Firehall - Fire Extinguishing Devices North Firehall - Main Switch | 1988 2021 1988 | 36 3 36 | \$2,300 \$2,300 \$10,350 | 0.059105696 0.728571429 0.634615385 | treatment required in medium term treatment in long term |
| 460 North Firehall 461 North Firehall 462 North Firehall | D SERVICES D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL D50 ELECTRICAL | D5010 Electrical Service and Distribution D5010 Electrical Service and Distribution D5010 Electrical Service and Distribution | North Firehall - Main Switch North Firehall - Electrical Distribution - Panels and Swit North Firehall - Electrical Distribution - Panels and Swit | 1988 1988 1988 | 36 36 36 | \$10,350 \$24,150 \$6,900 | 0.634615385 0.584615385 0.534615385 | treatment in long term treatment in long term treatment in long term |
| 463 North Firehall 464 North Firehall | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | North Firehall - Lighting - T12 Fluorescent North Firehall - Lighting - T8 Fluorescent | 1988 2011 | 36 13 | \$17,250 \$460 | -0.015384615 -0.065384615 | treatment required in medium term treatment required in medium term |
| 465 North Firehall 466 North Firehall | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5030 Communications and Security | North Firehall - Lighting - Incandescent North Firehall - Telecommunication Systems | 1988 2001 | 36 23 | \$230 \$17,250 | -0.015384615 -0.125384615 | treatment required in medium term Treatment Required in 2022 |
| 467 North Firehall 467 North Firehall 468 North Firehall | D SERVICES D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL D50 ELECTRICAL | D5090 Other Electrical Systems D5090 Other Electrical Systems D5090 Other Electrical Systems | North Firehall - Emergency Lighting and Power - Exit L Generator North Firehall - Emergency Lighting and Power - Exit L | 1988 2021 1988 | 36 3 36 | \$1,725 \$26,450 \$345 | -0.085710863 0.924289137 -0.080343245 | Treatment Required in 2022 New in 2021 Treatment Required in 2022 |
| 469 North Firehall 470 North Firehall | D SERVICES D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5090 Other Electrical Systems D5090 Other Electrical Systems D5090 Other Electrical Systems | North Firehall - Emergency Lighting and Power - Exit L North Firehall - Emergency Lighting and Power - Emer North Firehall - Emergency Lighting and Power - Strob | 1988 1988 2020 | 36 4 | \$345 \$173 \$345 | -0.083041217 0.521052632 | Treatment Required in 2022 Treatment Required in 2022 treatment in long term |
| 471 North Firehall | E EQUIPMENT AND FURNISHINGS | | E1090 Other Equipment | North Firehall - Food Service Equipment - Kitchen | 1988 | 36 | \$1,725 | 0.03 | treatment required in medium term |

| 472 North Firehall | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2020 Parking Lots G2030 Pedestrian Paying | North Firehall - Asphalt Paving and Surfacing North Firehall - Concrete Sidewalk | 2001 | 23 | \$58,363 \$8,050 | -0.101056341 0.124732732 | Treatment Required in 2021 or 2022 treatment required in medium term |
|--|---|--|--|---|----------------------|----------------|-----------------------------------|--|---|
| 474 North Firehall 475 North Firehall | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G40 SITE ELECTRICAL UTILITIES | G2040 Site Development G4020 Site Lighting | North Firehall - Steel Bollards North Firehall - Exterior Lighting Fixtures - LED | 2020 2020 | 4 | \$9,200 \$4,140 | 0.827700188 0.750273415 | treatment in long term treatment in long term |
| 476 North Firehall 477 North Firehall | G SITEWORK G SITEWORK | G40 SITE ELECTRICAL UTILITIES G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting G4030 Site Communication and Security | North Firehall - Exterior Light Fixtures - Soffit North Firehall - Towers, Poles and Stands | 1988 2011 | 36 13 | \$460 \$23,000 | -0.090044886 0.720197945 | Treatment Required in 2022 treatment in long term |
| 478 North Firehall 479 PW Garage1 480 PW Garage1 | G SITEWORK A SUBSTRUCTURE A SUBSTRUCTURE | G40 SITE ELECTRICAL UTILITIES A10 FOUNDATIONS A10 FOUNDATIONS | G4030 Site Communication and Security A1010 Standard Foundations A1030 Slab on Grade | North Firehall - Towers, Poles and Stands Wall Foundations - North and South Standard Slab on Grade with embedded heating cable | 1988 1985 1985 | 36 39 39 | \$17,250 \$420,900 \$79,925 | -0.089552619 0.670704004 -0.089031531 | Treatment Required in 2022 treatment in long term Treatment Required in 2021 or 2022 |
| 481 PW Garage1 482 PW Garage1 | A SUBSTRUCTURE B SHELL | A10 FOUNDATIONS B10 SUPERSTRUCTURE | A1030 Slab on Grade B1010 Floor and Wall Construction | Standard Stab on Grade Standard Stab on Grade Mezzanine Floor - Wood | 1985 2007 | 39 17 | \$195,500 \$5,750 | 0.610219027 0.571241523 | treatment in long term treatment in long term |
| 483 PW Garage1 484 PW Garage1 | B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B1010 Floor and Wall Construction B1020 Roof Construction | Block wall Steel Structure - Roof Deck | 1994 1985 | 30 39 | \$23,575 \$195,759 | 0.521524023 0.571816958 | treatment in long term treatment in long term |
| 485 PW Garage1 486 PW Garage1 | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | Metal Cladding Split face block | 2007 1985 1985 | 17 39 | \$33,465 \$38,640 | -0.087878526 0.662438921 | Treatment Required in 2022 treatment in long term |
| 487 PW Garage1 488 PW Garage1 489 PW Garage1 | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls B2020 Exterior Windows | Regular Block - North Regular Block - South Windows - Vinyl | 2007 1996 | 39 17 28 | \$35,190 \$74,750 \$6,210 | 0.922770894 0.673119304 -0.086513535 | Fixed in 2021 treatment in long term Treatment Required in 2021 or 2022 |
| 490 PW Garage1 491 PW Garage1 | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2020 Exterior Windows B2020 Exterior Windows | Windows - Vinyl Windows - Aluminum | 2007 2007 | 17 17 | \$1,380 \$7,452 | 0.623875224 0.7765625 | treatment in long term treatment in long term |
| 492 PW Garage1 493 PW Garage1 | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2030 Exterior Doors B2030 Exterior Doors B2030 Exterior Doors | Exterior Doors and Frames - Steel Exterior Doors - Steel South Bay | 1994 2007 2007 | 30 17 17 | \$5,750 \$8,625 \$72,450 | 0.16037577 0.210532098 0.778575346 | treatment required in medium term treatment required in medium term |
| 494 PW Garage1 495 PW Garage1 496 PW Garage1 | B SHELL B SHELL | B30 EXTERIOR VERTICAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B3010 Roof Coverings B3010 Roof Coverings | Overhead Doors Roof Construction - External - South Roof Construction - External - North | 2007 2017 2020 | 7 | \$12,450 \$139,035 \$96,186 | -0.08426545 0.826311587 | treatment in long term Treatment Required in 2021 or 2022 treatment in long term |
| 497 PW Garage1 498 PW Garage1 | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1010 Partitions C1010 Partitions | Interior Windows - Wood Interior Windows - Wood | 1985 2007 | 39 17 | \$2,070 \$1,035 | 0.875211906 0.73339806 | treatment in long term treatment in long term |
| 499 PW Garage1 500 PW Garage1 | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Door C1020 Interior Door | Interior Doors - Wood Interior Doors - Steel | 1989 2007 | 35 17 17 | \$2,300 \$1,725 | 0.28110266 0.38150648 | treatment required in medium term treatment required in medium term |
| 501 PW Garage1 502 PW Garage1 503 PW Garage1 | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Door C1020 Interior Door C1020 Interior Door | Interior Doors - Steel Interior Doors Interior Doors | 2007 1994 1985 | 30 39 | \$1,150 \$1,150 \$2,875 | 0.367035068 0.1672221 0.128571429 | treatment required in medium term treatment required in medium term treatment required in medium term |
| 504 PW Garage1 505 PW Garage1 | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C20 STAIRS | C1030 Fittings C2010 Stair Construction | Lockers Straight Stairs - Wood - north | 1994 1994 | 30 30 | \$2,760 \$2,300 | 0.067411644 0.667603859 | treatment required in medium term treatment in long term |
| 506 PW Garage1 507 PW Garage1 | C INTERIORS C INTERIORS | C20 STAIRS C30 INTERIOR FINISHES | C2010 Stair Construction C3010 Wall Finishes | Straight Stairs - Wood - south Plywood Walls | 1992 1985 | 32 39 | \$4,600 \$28,676 | 0.717798915 0.667996995 | treatment in long term treatment in long term |
| 508 PW Garage1 509 PW Garage1 510 PW Garage1 | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes C3010 Wall Finishes | Wood Barrier Wall Gypsum Board Walls Metal Panel Walls | 1985 1994 2007 | 39 30 17 | \$1,242 \$3,726 \$46,023 | 0.618198297 -0.091596963 0.568611447 | Treatment in long term Treatment Required in 2021 or 2022 treatment in long term |
| 511 PW Garage1 512 PW Garage1 | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | Plywood Flooring Resilient Flooring - Tile | 2001 1994 | 23 | \$2,277 \$2,484 | 0.518823782 0.019040321 | treatment in long term treatment required in medium term |
| 513 PW Garage1 514 PW Garage1 | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3030 Ceiling Finishes C3030 Ceiling Finishes | Ceiling Tiles Gypsum Plaster Ceiling Finish | 1994 1994 | 30 30 | \$6,670 \$4,112 | 0.869261369 0.828571429 | treatment in long term treatment in long term |
| 515 PW Garage1 516 PW Garage1 517 PW Garage1 | D SERVICES D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Laundry Equipment Eyewash - Shower Station Plumbing Fixtures | 2007 2006 1994 | 17 18 30 | \$1,093 \$2,875 \$1,150 | -0.090512737 -0.090281627 -0.109378176 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 518 PW Garage1 519 PW Garage1 | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Plumbing Fixtures Plumbing Fixtures Plumbing Fixtures | 1994 2007 2007 | 30 17 17 | \$1,150 \$1,150 \$3,450 | -0.109378176 0.750953797 0.701271244 | Treatment Required in 2022 treatment in long term treatment in long term |
| 520 PW Garage1 521 PW Garage1 | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2020 Domestic Water Distribution | Plumbing Fixtures Electric Hot Water Tank | 2007 2018 | 17 6 | \$1,150 \$2,875 | 0.651575761 0.601868695 | treatment in long term treatment in long term |
| 522 PW Garage1 523 PW Garage1 | D SERVICES D SERVICES D SERVICES | D20 PLUMBING D30 HVAC D30 HVAC | D2020 Domestic Water Distribution D3020 Heat Generating Systems | Water Meter Heating Boiler | 2020 2006 | 4 18 17 | \$4,025 \$11,500 \$2,875 | 0.552151196 0.509105696 -0.081428571 | treatment in long term treatment in long term |
| 524 PW Garage1 525 PW Garage1 526 PW Garage1 | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D30 HVAC | D3030 Cooling Generating Systems D3040 Distribution Systems D3040 Distribution Systems | Air Conditioning unit Exhaust Fan - Propeller Exhaust Fan | 2007 2007 1992 | 17 17 32 | \$2,875 \$4,600 \$345 | -0.081428571 0.534615385 -0.125384615 | Treatment Required in 2022 treatment in long term Treatment Required in 2022 |
| 527 PW Garage1 528 PW Garage1 | D SERVICES D SERVICES | D30 HVAC | D3040 Distribution Systems D3040 Distribution Systems | Ventilation Fan Supply Fan | 1985 2007 | 39 17 | \$3,450 \$8,625 | -0.125384615 0.624615385 | Treatment Required in 2021 or 2022 treatment in long term |
| 529 PW Garage1 530 PW Garage1 | D SERVICES D SERVICES | D30 HVAC | D3040 Distribution Systems D3040 Distribution Systems | Ceiling Fans Heating Pumps | 2007 2018 | 17 6 | \$4,600 \$2,588 | -0.065384615 0.634615385 | treatment required in medium term treatment in long term |
| 531 PW Garage1 532 PW Garage1 533 PW Garage1 | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D40 FIRE PROTECTION | D3050 Terminal and Package Units D3060 Controls and Instrumentation D4030 Fire Protection Specialties | Electric Unit Heaters Compressed Air Systems Extinguishers | 1994 1997 2018 | 30 27 6 | \$1,150 \$3,450 \$2,013 | -0.015384615 -0.085710863 0.079656755 | treatment required in medium term Treatment Required in 2022 treatment required in medium term |
| 534 PW Garage1 535 PW Garage1 | D SERVICES D SERVICES | D40 FIRE PROTECTION D40 FIRE PROTECTION | D4090 Other Fire Protection Systems D4090 Other Fire Protection Systems | Heat Detector Chemical Storage | 2013 1985 | 11 39 | \$2,070 \$6,900 | -0.083041217 -0.088947368 | Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 536 PW Garage1 537 PW Garage1 | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5010 Electrical Service and Distribution D5010 Electrical Service and Distribution | Main Switch + Electrical Panel Electrical Panel | 1985 2007 | 39 17 | \$10,350 \$3,450 | 0.08 0.608943659 | treatment required in medium term treatment in long term |
| 538 PW Garage1 539 PW Garage1 540 PW Garage1 | D SERVICES D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL D50 ELECTRICAL | D5010 Electrical Service and Distribution D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | Electrical Panel Lighting - Fluorescent Lighting - Fluorescent | 2007 1985 1985 | 17 39 39 | \$11,500 \$6,440 \$1,840 | 0.724732732 -0.082299812 -0.100728585 | Treatment in long term Treatment Required in 2022 Treatment Required in 2022 |
| 541 PW Garage1 542 PW Garage1 | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | Lighting - Fluorescent Lighting - T8 LED | 1985 2007 | 39 17 | \$920 \$7,820 | -0.090044886 0.170197945 | Treatment Required in 2022 treatment required in medium term |
| 543 PW Garage1 544 PW Garage1 545 PW Garage1 | D SERVICES D SERVICES E EQUIPMENT AND FURNISHINGS | D50 ELECTRICAL D50 ELECTRICAL E1010 Commercial Equipment | D5030 Communications and Security D5090 Other Electrical Systems E1090 Other Equipment | Security System Exit Lighting Kitchen Equipment | 2018 1999 2012 | 6 25 12 | \$3,450 \$345 \$2,875 | 0.770447381 -0.089295998 0.220968469 | treatment in long term Treatment Required in 2022 treatment required in medium term |
| 546 PW Garage1 547 PW Garage1 | E EQUIPMENT AND FURNISHINGS G SITEWORK | E20 FURNISHINGS G20 SITE IMPROVEMENT | E2010 Fixed Furnishings G2020 Parking Lots | Cabinetry Asphalt Paving and Surfacing | 2007 2007 | 17 17 | \$7,130 \$35,058 | 0.810219027 -0.088758477 | treatment in long term Treatment Required in 2021 or 2022 |
| 548 PW Garage1 549 PW Garage1 550 PW Garage1 | G SITEWORK G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G40 SITE ELECTRICAL UTILITIES | G2020 Parking Lots G2030 Pedestrian Paving G4020 Site Lighting | Steel Bollards Exterior Doors - Concrete Pads Exterior Lights - HPS | 2007 2007 2002 | 17 17 22 | \$16,100 \$6,900 \$4,025 | 0.871524023 0.721816958 -0.087878526 | treatment in long term treatment in long term Treatment Required in 2022 |
| 551 PW Garage1 552 PW Garage1 | G SITEWORK G SITEWORK | G40 SITE ELECTRICAL UTILITIES G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting G4020 Site Lighting | Lighting Exterior Lighting Timer | 2006 2007 | 18 | \$288 \$575 | 0.272438921 0.322770894 | treatment required in medium term treatment required in medium term |
| 553 PW Garage 2 554 PW Garage 2 | A SUBSTRUCTURE A SUBSTRUCTURE | A10 FOUNDATIONS A10 FOUNDATIONS | A1010 Standard Foundations A1010 Standard Foundations | Wall Foundations Column Foundations - Brick | 1991 1991 | 33 33 | \$146,625 \$6,900 | 0.673119304 0.723486465 | treatment in long term treatment in long term |
| 555 PW Garage 2 556 PW Garage 2 557 PW Garage 2 | A SUBSTRUCTURE B SHELL B SHELL | A10 FOUNDATIONS B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | A1030 Slab on Grade B1010 Floor and Wall Construction B1010 Floor and Wall Construction | Standard Stab on Grade Concrete Block Wall Exposed Concrete Floor | 1991 1991 1991 | 33 33 33 | \$158,125 \$79,638 \$13,973 | -0.086124776 0.7265625 0.61037577 | Treatment Required in 2021 or 2022 treatment in long term treatment in long term |
| 558 PW Garage 2 559 PW Garage 2 | B SHELL B SHELL | B10 SUPERSTRUCTURE B20 EXTERIOR VERTICAL ENCLOSURES | B1020 Roof Construction B2010 Exterior Walls | Structural Frame Metal Cladding - older | 1991 | 33 33 | \$316,250 \$184,000 | 0.560532098 0.528575346 | treatment in long term treatment in long term |
| 560 PW Garage 2 561 PW Garage 2 | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | Metal Cladding - newer Brick Veneer | 2011 1991 | 13 33 | \$310,500 \$67,160 | 0.82573455 0.776311587 | treatment in long term treatment in long term |
| 562 PW Garage 2 563 PW Garage 2 564 PW Garage 2 | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls B2020 Exterior Windows | Brick Chimney Aluminum Soffit Panel Aluminum Windows / Wood Frame | 2009 2001 2001 | 15 23 23 | \$3,450 \$25,300 \$5,589 | 0.725211908 0.68339806 0.38110266 | treatment in long term treatment in long term treatment required in medium term |
| 565 PW Garage 2 566 PW Garage 2 | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2030 Exterior Doors B2030 Exterior Doors | Exterior Doors and Frames Overhead Doors | 2006 2019 | 18 | \$11,500 \$43,125 | -0.02849352 -0.092964932 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 567 PW Garage 2 568 PW Garage 2 | B SHELL B SHELL | B30 EXTERIOR HORIZONTAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B3010 Roof Coverings B3010 Roof Coverings | Sloped Metal Gutters and Downspouls | 2001 2001 | 23 23 | \$313,950 \$7,590 | -0.0927779 0.178571429 | Treatment Required in 2021 or 2022 on metal treatment required in medium term |
| 569 PW Garage 2 570 PW Garage 2 571 PW Garage 2 | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1010 Partitions C1020 Interior Doors C1020 Interior Doors | Steel Cubicles (Interior Doors - Steel (Interior Doors - Steel - newer | 2011 1991 2011 | 13 33 13 | \$2,300 \$9,775 \$1,725 | 0.617411644 0.117603859 0.067798915 | treatment in long term treatment required in medium term treatment required in medium term |
| 572 PW Garage 2 573 PW Garage 2 | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors | Interior Doors - Wood Interior Doors - Wood - newer | 1996 2016 | 28 8 | \$6,900 \$1,150 | 0.017998995 -0.031801703 | treatment required in medium term treatment required in medium term treatment required in medium term |
| 574 PW Garage 2 575 PW Garage 2 | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | Galvanized Steel Countertop MDF Countertop and Wood Cabinets | 2003 2003 | 21 21 | \$13,800 \$8,050 | 0.568403037 0.518611447 | treatment in long term treatment in long term |
| 576 PW Garage 2 577 PW Garage 2 578 PW Garage 2 | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes C3010 Wall Finishes | Plywood Walls Gypsum Board Walls Metal Panel Walls | 1991 1991 1991 | 33 33 33 | \$890 \$29,900 \$57,960 | 0.568823782 0.659040321 0.669261369 | treatment in long term treatment in long term treatment in long term |
| 579 PW Garage 2 579 PW Garage 2 580 PW Garage 2 | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes C3020 Floor Finishes | Epoxy Coated Concrete Floor Vinyl Composite Tile (VCT) | 1991 1991 1997 | 33 27 | \$87,960 \$805 \$8,050 | -0.081428571 -0.090512737 | Treatment in long term Treatment Required in 2021 or 2022 Treatment Required in 2022 |
| 581 PW Garage 2 582 PW Garage 2 | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3030 Gypsum Plaster Ceiling Finish C3030 Special Ceiling Finishes | Gypsum Plaster Ceiling Finish Insulated Roof Panels | 1991 1991 | 33 33 | \$14,950 \$158,125 | 0.619718373 0.700621824 | treatment in long term treatment in long term |
| 583 PW Garage 2 584 PW Garage 2 585 PW Garage 2 | D SERVICES D SERVICES D SERVICES | D10 CONVEYING D20 PLUMBING D20 PLUMBING | D1030 Other Conveying Systems D2010 Plumbing Fixtures D2010 Plumbing Fixtures | Overhead Cranes Plumbing Fixtures Stainlane Steel Sink | 2012 2003 2013 | 12 21 11 | \$28,750 \$5,750 \$4,025 | 0.750953797 0.001271244 0.801575761 | treatment in long term treatment required in medium term treatment in long term |
| 586 PW Garage 2 586 PW Garage 2 587 PW Garage 2 | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures D2020 Domestic Water Distribution | Stainless Steel Sink Eyewash - Shower Station Water Meter - Well Water | 2013 2006 2018 | 11 18 6 | \$4,025 \$2,875 \$1,725 | -0.108131305 0.852151196 | Treatment in long term Treatment Required in 2021 or 2022 treatment in long term |
| 588 PW Garage 2 589 PW Garage 2 | D SERVICES D SERVICES | D30 HVAC D30 HVAC | D3020 Heat Generating Systems D3020 Heat Generating Systems | Hot Water Tank - Electric Furnace | 1993 2012 | 31 12 | \$2,300 \$8,625 | 0.059105696 0.728571429 | treatment required in medium term treatment in long term |
| 590 PW Garage 2 591 PW Garage 2 592 PW Garage 2 | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D30 HVAC | D3020 Heat Generating Systems D3040 Exhaust Ventilation Systems D3040 Exhaust Ventilation Systems | Baseboard Electric Unit Heaters Ducting Ceiling Fans | 2001 2011 1996 | 23 13 28 | \$5,175 \$13,800 \$4,313 | 0.084615385 0.634615385 0.134615385 | treatment required in medium term treatment in long term |
| 592 PW Garage 2 593 PW Garage 2 594 PW Garage 2 | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D30 HVAC | D3040 Exhaust Ventilation Systems D3040 Exhaust Ventilation Systems D3040 Exhaust Ventilation Systems | Ceiling Fans Exhaust Fan - Garage Bays Exhaust Fans | 1996 2001 1994 | 28 23 30 | \$4,313 \$8,625 \$345 | 0.134615385 -0.125384615 0.184615385 | treatment required in medium term Treatment Required in 2021 or 2022 treatment required in medium term |
| 596 PW Garage 2 596 PW Garage 2 | D SERVICES D SERVICES | D30 HVAC D30 HVAC | D3040 Exhaust Ventilation Systems D3040 Exhaust Ventilation Systems | Exhaust Fans Exhaust Fan - Locker Room | 1996 1994 | 28 30 | \$345 \$345 | 0.234615385 0.284615385 | treatment required in medium term treatment required in medium term |
| 597 PW Garage 2 598 PW Garage 2 | D SERVICES D SERVICES D SERVICES | D30 HVAC D40 FIRE PROTECTION | D3060 Controls and Instrumentation D4030 Fire Protection Specialties | Air Compressor Fire Extinguishers Carbon-Monoxide/Heat/Smoke Detectors | 2010 2013 2004 | 14 11 20 | \$3,220 \$1,438 \$10,350 | 0.724289137 0.679656755 0.376958783 | treatment in long term treatment in long term |
| 599 PW Garage 2 600 PW Garage 2 601 PW Garage 2 | D SERVICES D SERVICES D SERVICES | D40 FIRE PROTECTION D50 ELECTRICAL D50 ELECTRICAL | D4090 Other Fire Protection Systems D5010 Electrical Service and Distribution D5020 - Lighting and Branch Wiring | Carbon-Monoxide/Heat/Smoke Detectors Electrical Panel Exit Sign | 2004 1991 2001 | 20 33 23 | \$10,350 \$8,625 \$863 | 0.376958783 0.621052632 -0.13 | treatment required in medium term treatment in long term Treatment Required in 2021 or 2022 |
| 602 PW Garage 2 603 PW Garage 2 | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 - Lighting and Branch Wiring D5020 - Lighting and Branch Wiring | Lighting - Fluorescent Lighting - Compact Fluorescent Light | 2023 2001 | 23 23 | \$13,110 \$575 | -0.085267268 | New LED Exterior Lights in 2023 \$10k Treatment Required in 2021 or 2022 |
| 604 PW Garage 2 606 PW Garage 2 | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 - Lighting and Branch Wiring D5020 - Lighting and Branch Wiring | Lighting - Incandescent Lighting - T8 | 2001 2006 | 23 18 | \$1,150 \$4,140 | -0.082299812 0.150273415 | Treatment Required in 2021 or 2022 treatment required in medium term |
| 606 PW Garage 2 607 PW Garage 2 608 PW Garage 2 | D SERVICES D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL D50 ELECTRICAL | D5030 Communications and Security D5030 Communications and Security D5030 Communications and Security | Security System Security System - newer Security Cameras | 2018 2016 2015 | 6 8 9 | \$4,025 \$5,175 \$6,900 | 0.569955114 0.520197945 0.120447381 | treatment in long term treatment in long term treatment required in medium term |
| OUD FW Garage 2 | D GERVICES | DOU LLEG INIONL | SSSSS COMMUNICATIONS and Security | occurity Carrieras | 2010 | 7 | 40,900 | 0.120447381 | nouvrent required in medium term |

| 609 | PW Garage 2 | D SERVICES | D50 ELECTRICAL | D5030 Communications and Security | Security Cameras - newer | 2019 | 5 | \$3,450 | 0.670704004 | treatment in long term |
|---------------------------------|--|---|--|---|--|----------------------|-----------------|----------------------------------|--|--|
| | PW Garage 2 PW Garage 2 | D SERVICES E EQUIPMENT AND FURNISHINGS | D50 ELECTRICAL | D5090 - Other Electrical Systems E1090 Other Equipment | Emergency Lighting Kitchen Equipment | 2001 2013 | 23 11 | \$2,415 \$5,175 | -0.089031531 -0.099780973 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 612 613 | PW Garage 2 PW Garage 2 | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2010 Roadways G2020 Parking Lots | Wood Sign Asphalt Paving and Surfacing | 2006 2007 | 18 17 | \$1,150 \$115,518 | 0.071241523 -0.088475977 | treatment required in medium term Treatment Required in 2021 or 2022 |
| | PW Garage 2 PW Garage 2 | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2020 Parking Lots G2030 Pedestrian Paving | Steel Bollards Concrete Walkway | 2006 1991 | 18 33 | \$11,500 \$4,600 | 0.621816958 0.722121474 | treatment in long term treatment in long term |
| 617 | PW Garage 2 PW Garage 2 | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Pedestrian Paving G2030 Pedestrian Paving | Concrete Apron Concrete Pad | 1991 1991 | 33 33 | \$25,300 \$4,140 | 0.772438921 0.822770894 | treatment in long term treatment in long term |
| | PW Garage 2 PW Garage 2 PW Garage 2 | G SITEWORK G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G30 SITE MECHANICAL UTILITIES | G2040 Site Development G2040 Site Development G3060 Fuel Distribution | Steel Gate Chain Link Fence | 1984 2006 2014 | 40 18 10 | \$2,875 \$20,125 \$1,150 | 0.023119304 0.873486465 -0.086124776 | treatment required in medium term treatment in long term Treatment Required in 2022 |
| | PW Garage 2 PW Garage 2 | G SITEWORK G SITEWORK | G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting | Oil Tank High Pressure Sodium Lights | 2004 | 20 | \$3,623 | 0.0265625 | treatment required in medium term |
| 622 | Railway Museum | A SUBSTRUCTURE | A10 FOUNDATIONS | A1010 Standard Foundations | Railway Station Museum and Visitor Centre - Wall Fou | 1960 | 64 | \$144,900 | -0.09962423 | one brick to repair |
| | Railway Museum | A SUBSTRUCTURE | A10 FOUNDATIONS | A1010 Standard Foundations | Railway Station Museum and Visitor Centre - Column I | 1960 | | \$11,500 | -0.099467902 | |
| | Railway Museum Railway Museum | A SUBSTRUCTURE B SHELL | A10 FOUNDATIONS A10 FOUNDATIONS B10 SUPERSTRUCTURE | A1030 Slab on Grade B1010 Floor Construction | Railway Station Museum and Visitor Centre - Column i Railway Station Museum and Visitor Centre - Standard Railway Station Museum and Visitor Centre - Floor De | 1960 1960 1894 | 64 64 130 | \$11,500 \$29,756 \$71,415 | -0.093467902 -0.081424654 0.42573455 | Treatment Required in 2021 or 2022 Treatment Required in 2022 leak has been repaired |
| 626 | Railway Museum Railway Museum | B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B1010 Floor Construction B1010 Floor Construction B1010 Floor Construction | Railway Station Museum and Visitor Centre - Floor De Railway Station Museum and Visitor Centre - Floor De | 1894 2012 | 130 | \$28,750 \$33,925 | 0.726311587 0.675211906 | treatment in long term |
| | Railway Museum | B SHELL | B10 SUPERSTRUCTURE | B1020 Roof Construction | Railway Station Museum and Visitor Centre - Roof Dec | 1894 | 130 | \$57,500 | 0.73339806 | treatment in long term |
| 629 | Railway Museum | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls | Railway Station Museum and Visitor Centre - Wood Sie | 2023 | 64 | \$112,470 | 1 | \$136 on new sidin in 2023 |
| 631 | Railway Museum | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2010 Exterior Walls | Railway Station Museum and Visitor Centre - Wood Sh Railway Station Museum and Visitor Centre - Wood So | 1894 2023 | 130 64 | \$13,800 \$28,635 | 0.73150648 1 | treatment in long term \$136 on new sidin in 2023 |
| 632 633 | Railway Museum Railway Museum | B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls B2020 Exterior Windows | Railway Station Museum and Visitor Centre - Wood So Railway Station Museum and Visitor Centre - Windows | 2023 1994 | 64 30 | \$13,800 \$60,950 | -0.081428571 | \$136 on new sidin in 2023 1 window needs to be refurbished |
| 635 | Railway Museum Railway Museum Railway Museum | B SHELL B SHELL B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES B20 EXTERIOR VERTICAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B2030 Exterior Doors B2030 Exterior Doors B3010 Roof Coverings | Railway Station Museum and Visitor Centre - Wood Do Railway Station Museum and Visitor Centre - Wood Do | 1994 1960 2012 | 30 64 12 | \$6,900 \$8,625 \$43,125 | 0.567411644 -0.092396141 0.517798915 | treatment in long term Treatment Required in 2022 |
| | Railway Museum Railway Museum | B SHELL B SHELL B SHELL | B30 EXTERIOR HORIZONTAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B3010 Roof Coverings B3010 Roof Coverings | Railway Station Museum and Visitor Centre - Shingles Railway Station Museum and Visitor Centre - Flashings Railway Station Museum and Visitor Centre - Gutters a | 1960 2012 | 64 12 | \$43,125 \$11,500 \$2,588 | 0.867996995 0.818198297 | treatment in long term treatment in long term treatment in long term |
| 639 | Railway Museum Railway Museum | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1010 Partitions C1010 Partitions | Railway Station Museum and Visitor Centre - Interior G Railway Station Museum and Visitor Centre - Interior G | 1960 | 64 64 | \$2,875 \$6,900 | -0.091596963 0.768611447 | Treatment Required in 2022 treatment in long term |
| 641 642 | Railway Museum Railway Museum | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors | Railway Station Museum and Visitor Centre - Wood Do Railway Station Museum and Visitor Centre - Wood Do | 2012 1960 | 12 64 | \$2,300 \$5,750 | 0.718823782 0.669040321 | treatment in long term treatment in long term |
| 644 | Railway Museum Railway Museum | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1030 Fittings | Railway Station Museum and Visitor Centre - Wood Do Railway Station Museum and Visitor Centre - Countert | 2011 2010 | 13 14 | \$1,150 \$3,680 | 0.619261369 0.578571429 | treatment in long term treatment in long term |
| 646 | Railway Museum Railway Museum | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | Railway Station Museum and Visitor Centre - Counterly Railway Station Museum and Visitor Centre - Benches | 1960 1960 | 64 64 | \$5,520 \$14,260 | 0.519487263 | treatment in long term treatment in long term |
| 647 648 | Railway Museum Railway Museum Railway Museum | C INTERIORS C INTERIORS C INTERIORS | C20 STAIRS C20 STAIRS C20 STAIRS | C2010 Interior Stair Construction C2010 Interior Stair Construction C2020 Stair Einschap | Railway Station Museum and Visitor Centre - Stairs - V Railway Station Museum and Visitor Centre - Stairs - V Railway Station Museum and Visitor Centre - Stair Eini | 2012 1894 2002 | 12 130 | \$3,450 \$17,250 \$1,725 | 0.640621824 -0.109046203 | treatment in long term sshoudl eb straighted ou after the structura |
| 649 650 | Railway Museum Railway Museum Railway Museum | C INTERIORS C INTERIORS C INTERIORS | C20 STAIRS C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C2020 Stair Finishes C3010 Wall Finishes C3010 Wall Finishes | Railway Station Museum and Visitor Centre - Stair Fini Railway Station Museum and Visitor Centre - Gypsum Railway Station Museum and Visitor Centre - Wood Wi | 2002 1994 1960 | 22 30 64 | \$1,725 \$25,013 \$14,088 | 0.401271244 0.651575761 0.601868695 | carpet is oK treatment in long term treatment in long term |
| 652 653 | Railway Museum Railway Museum Railway Museum | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3020 Floor Finishes C3020 Floor Finishes | Railway Station Museum and Visitor Centre - Wood Wi Railway Station Museum and Visitor Centre - Plywood Railway Station Museum and Visitor Centre - Vinyl Flo | 1960 2012 1994 | 12 30 | \$14,088 \$587 \$483 | 0.601868695 0.702151196 -0.100894304 | treatment in long term treatment in long term Treatment Required in 2022 |
| | Railway Museum | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | Railway Station Museum and Visitor Centre - Vinyl Flor Railway Station Museum and Visitor Centre - Laminate | 2012 | 12 12 | \$690 \$21,735 | 0.778571429 0.784615385 | treatment in long term treatment in long term |
| 656 657 | Railway Museum Railway Museum | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3030 Ceiling Finishes | Railway Station Museum and Visitor Centre - Wood Flo Railway Station Museum and Visitor Centre - Wood Co | 2012 2006 | 12 18 | \$25,300 \$16,215 | 0.834615385 0.684615385 | treatment in long term treatment in long term |
| 658 659 | Railway Museum Railway Museum | C INTERIORS D SERVICES | C30 INTERIOR FINISHES D20 PLUMBING | C3030 Ceiling Finishes D2010 Plumbing Fixtures | Railway Station Museum and Visitor Centre - Gypsum Railway Station Museum and Visitor Centre - Plumbing | 1994 2006 | 30 18 | \$21,678 \$5,750 | 0.634615385 -0.015384615 | treatment in long term treatment required in medium term |
| 661 | Railway Museum Railway Museum | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2020 Domestic Water Distribution | Railway Station Museum and Visitor Centre - Eyewash Railway Station Museum and Visitor Centre - Domestic | 2016 2006 | 8 18 | \$863 \$2,875 | 0.684615385 0.634615385 | treatment in long term treatment in long term |
| 663 | Railway Museum | D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING | D2020 Domestic Water Distribution D2030 Sanitary Waste | Railway Station Museum and Visitor Centre - Domestic Railway Station Museum and Visitor Centre - Piping | 2010 1960 | 14 64 | \$1,725 \$3,450 | 0.624289137 0.579656755 | treatment in long term treatment in long term |
| | Railway Museum Railway Museum Railway Museum | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC | D3020 Heat Generating Systems D3030 Cooling Generating Systems D3040 Distribution Systems | Railway Station Museum and Visitor Centre - Furnacer Railway Station Museum and Visitor Centre - Condens Railway Station Museum and Visitor Centre - Exhaust | 2012 2013 2012 | 12 11 12 | \$6,900 \$5,750 \$805 | 0.821052632 | treatment in long term treatment in long term Treatment Required in 2021 or 2022 |
| 667 | Railway Museum | D SERVICES D SERVICES D SERVICES | D30 HVAC D30 HVAC D40 FIRE PROTECTION | D3040 Distribution Systems D3040 Distribution Systems D4030 Fire Protection Specialties | Railway Station Museum and Visitor Centre - Exhaust Railway Station Museum and Visitor Centre - Ceiling F Railway Station Museum and Visitor Centre - Fire Extir | 2012 2012 2020 | 12 12 4 | \$805 \$1,150 \$863 | 0.758943659 0.724732732 | treatment in long term |
| | Railway Museum Railway Museum | D SERVICES D SERVICES | D40 FIRE PROTECTION D50 ELECTRICAL | D4030 Fire Protection Specialties D5010 Electrical Service and Distribution | Railway Station Museum and Visitor Centre - Fire Extir Railway Station Museum and Visitor Centre - Electrical | 2011 2012 | 13 | \$1,725 \$4,600 | 0.077700188 0.650273415 | treatment required in medium term treatment in long term |
| 671 672 | Railway Museum Railway Museum | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5020 Lighting and Branch Wiring D5020 Lighting and Branch Wiring | Railway Station Museum and Visitor Centre - Lighting Railway Station Museum and Visitor Centre - Lighting - | 2004 2004 | 20 20 | \$3,910 \$1,898 | 0.119955114 0.170197945 | treatment required in medium term treatment required in medium term |
| 673 674 | Railway Museum Railway Museum | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5030 Communications and Security D5090 Other Electrical Systems | Railway Station Museum and Visitor Centre - Security Railway Station Museum and Visitor Centre - Emergen | 2012 2012 | 12 12 | \$1,725 \$1,725 | 0.220447381 0.270704004 | treatment required in medium term treatment required in medium term |
| 676 | Railway Museum Railway Museum | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | D5090 Other Electrical Systems D5090 Other Special Systems & Devices | Railway Station Museum and Visitor Centre - Emergen Railway Station Museum and Visitor Centre - Special S | 2012 2018 | 12 6 | \$863 \$2,875 | 0.320968469 0.610219027 | treatment required in medium term treatment in long term |
| | Railway Museum Railway Museum | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Pedestrian Paving G2030 Pedestrian Paving | Railway Station Museum and Visitor Centre - Asphalt I Railway Station Museum and Visitor Centre - Ramp Railway Station Museum and Visitor Centre - Wood De | 2011 1996 | 13 28 | \$2,300 \$5,175 | 0.571241523 0.371524023 | treatment in long term treatment required in medium term |
| 679 680 681 | Railway Museum Railway Museum Railway Museum | G SITEWORK G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2030 Pedestrian Paving G2040 Site Development G2040 Site Development | Railway Station Museum and Visitor Centre - Wood De Railway Station Museum and Visitor Centre - Exterior I Railway Station Museum and Visitor Centre - Exterior I | 2001 2011 2016 | 23 13 8 | \$1,725 \$1,725 \$1,725 | 0.521816958 0.572121474 0.662438921 | treatment in long term treatment in long term treatment in long term |
| 682 | Railway Museum Railway Museum | G SITEWORK G SITEWORK | G20 SITE IMPROVEMENT G20 SITE IMPROVEMENT | G2040 Site Development G2050 - Landscaping - General | Railway Station Museum and Visitor Centre - Exterior I Railway Station Museum and Visitor Centre - Exterior I Railway Station Museum and Visitor Centre - Irrigation | 2005 2016 | 19 | \$1,725 \$1,150 \$4,025 | -0.027229106 0.673119304 | treatment in long term treatment in long term |
| | Railway Museum Railway Museum | G SITEWORK G SITEWORK | G30 SITE MECHANICAL UTILITIES G40 SITE ELECTRICAL UTILITIES | G3060 Fuel Distribution G4020 Site Lighting | Railway Station Museum and Visitor Centre - Liquid Fu Railway Station Museum and Visitor Centre - Exterior I | 2006 2018 | 18 | \$2,300 \$345 | 0.623486465 -0.086124776 | treatment in long term Treatment Required in 2021 or 2022 |
| 686 687 | South Firehall South Firehall | A SUBSTRUCTURE A SUBSTRUCTURE | A10 FOUNDATIONS A10 FOUNDATIONS | A1010 Standard Foundations A1030 Stab on Grade | South Firehall - Foundation and Footings South Firehall - Standard Slab on Grade | 1972 1972 | 52 52 | \$154,100 \$187,680 | -0.0334375 -0.09962423 | Treatment Required in 2021 or 2022 Treatment Required in 2021 or 2022 |
| 688 | South Firehall South Firehall | B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B1020 Roof Construction B1020 Roof Construction | South Firehall - Steel Structure South Firehall - Canopy - Wood | 1972 2002 | 52 22 | \$402,500 \$3,450 | 0.710532098 -0.081424654 | treatment in long term Treatment Required in 2022 |
| 690 691 | South Firehall | B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B1020 Roof Construction B2010 Exterior Walls B2010 Exterior Walls | South Firehall - Canopy - Steel South Firehall - Metal Cladding | 1996 2001 | 28 23 | \$2,300 \$76,590 | 0.77573455 0.826311587 0.875211906 | treatment in long term treatment in long term |
| 692 693 | | B SHELL B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B2010 Extenor Walls B2020 Extenor Windows | South Firehall - Aluminum Soffit Panel South Firehall - Concrete Block Walls South Firehall - Windows and Frames - Steel | 2001 1972 2001 | 23 52 | \$19,665 \$36,225 \$12,650 | | treatment in long term treatment in long term |
| 694 696 | South Firehall South Firehall South Firehall | B SHELL B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B2020 Exterior Windows B2020 Exterior Windows B2030 Exterior Doors | South Firehall - Windows and Frames - Steel South Firehall - Windows and Frames - Steel South Firehall - Exterior Doors - Steel | 2001 1994 1972 | 23 30 52 | \$12,650 \$8,280 \$4,600 | 0.68110266 0.08150648 0.067035068 | treatment in long term treatment required in medium term treatment required in medium term |
| 697 | South Firehall South Firehall | B SHELL B SHELL | B10 SUPERSTRUCTURE B10 SUPERSTRUCTURE | B2030 Exterior Doors B2030 Exterior Doors B2030 Exterior Doors | South Firehall - Overhead Door - Metal Insulated South Firehall - Overhead Door - Metal Insulated | 1998 1998 | 26 26 | \$8,625 \$6,900 | 0.7172221 0.678571429 | treatment in long term treatment in long term |
| 699 700 | South Firehall South Firehall | B SHELL B SHELL | B10 SUPERSTRUCTURE B30 EXTERIOR HORIZONTAL ENCLOSURES | B2030 Exterior Doors B3010 Roof Coverings | South Firehall - Overhead Door - Metal Insulated South Firehall - Roofing - Metal | 2011 2006 | 13 18 | \$6,900 \$12,420 | 0.617411644 0.117603859 | treatment in long term treatment required in medium term |
| 701 702 | South Firehall South Firehall | B SHELL B SHELL | B30 EXTERIOR HORIZONTAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B3010 Roof Coverings B3010 Roof Coverings | South Firehall - Roofing - Metal South Firehall - Roofing - Shingles | 2006 2002 | 18 22 | \$74,520 \$24,581 | 0.167798915 -0.092003005 | treatment required in medium term Treatment Required in 2022 |
| | South Firehall South Firehall | B SHELL B SHELL | B30 EXTERIOR HORIZONTAL ENCLOSURES B30 EXTERIOR HORIZONTAL ENCLOSURES | B3010 Roof Coverings B3010 Roof Coverings | South Firehall - Gutters and Downspouts South Firehall - Fascia Wood | 2021 2006 | 3 18 | \$2,875 \$4,025 | -0.091801703 0.568403037 | Treatment Required in 2022 treatment in long term |
| 706 706 | South Firehall South Firehall South Firehall | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1010 Partitions C1020 Interior Doors C1020 Interior Doors | South Firehall - Interior Guardrails and Screens South Firehall - Interior Doors South Firehall - Interior Doors | 2016 2015 2018 | 9 6 | \$9,338 \$3,450 \$2,300 | 0.518611447 0.868823782 0.819040321 | treatment in long term treatment in long term treatment in long term |
| 708 | South Firehall South Firehall | C INTERIORS C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1020 Interior Doors C1020 Interior Doors C1020 Interior Doors | South Firehall - Interior Doors South Firehall - Interior Doors South Firehall - Interior Doors | 2015 2015 2015 | 9 | \$2,875 \$2,875 | 0.769261369 0.228571429 | treatment in long term treatment in long term treatment required in medium term |
| 710 | South Firehall South Firehall | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | South Firehall - Laminated Cabinet - Wood South Firehall - Laminated Cabinet - Wood | 1997 1997 | 27 27 | \$5,520 \$2,760 | -0.090512737 0.719718373 | Treatment Required in 2022 treatment in long term |
| | South Firehall South Firehall | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | South Firehall - Laminated Cabinet - Wood South Firehall - Countertop - Wood | 1997 2003 | 27 21 | \$2,760 \$2,875 | 0.250621824 0.650953797 | treatment required in medium term treatment in long term |
| | South Firehall South Firehall | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C10 INTERIOR CONSTRUCTION | C1030 Fittings C1030 Fittings | South Firehall - Countertop - Wood South Firehall - Countertop - Wood | 2003 2011 | 21 13 | \$2,875 \$575 | 0.301271244 0.601575761 | treatment required in medium term treatment in long term |
| 717 | South Firehall South Firehall | C INTERIORS C INTERIORS | C10 INTERIOR CONSTRUCTION C20 STAIRS | C1030 Fittings C2010 Interior Stair Construction | South Firehall - Metal Locker South Firehall - Stairs - Wood | 2019 1998 | 5 26 | \$863 \$3,450 | 0.551868695 0.502151196 | treatment in long term treatment in long term |
| | South Firehall South Firehall South Firehall | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes C3010 Wall Finishes | South Firehall - Metal Panel Walls South Firehall - Metal Panel Walls South Firehall - Concrete Walls | 2011 1974 1974 | 13 50 50 | \$64,032 \$17,768 \$4,600 | 0.55242425 0.359105696 0.668571429 | treatment in long term treatment required in medium term treatment in long term |
| 720 721 722 | South Firehall South Firehall South Firehall | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes C3010 Wall Finishes | South Firehall - Concrete Walls South Firehall - Plywood Walls South Firehall - Gypsum Board Walls | 1974 1991 2001 | 33 23 | \$4,600 \$15,295 \$16,675 | 0.688571429 0.634615385 0.584615385 | treatment in long term treatment in long term treatment in long term |
| 723 724 | South Firehall South Firehall | C INTERIORS C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3010 Wall Finishes C3010 Wall Finishes C3010 Wall Finishes | South Firehall - Ceramic Tile Walls South Firehall - Ceramic Tile Walls South Firehall - Pine Plank Walls | 1994 1998 | 23 30 26 | \$16,675 \$2,818 \$44,850 | -0.125384615 0.684615385 | Treatment in long term Treatment Required in 2022 treatment in long term |
| | South Firehall South Firehall | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | South Firehall - Carpet Flooring South Firehall - VCT Resilient Flooring | 1994 1972 | 30 52 | \$14,904 \$2,933 | -0.065384615 -0.125384615 | treatment required in medium term Treatment Required in 2022 |
| 727 728 | South Firehall South Firehall | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3020 Floor Finishes | South Firehall - VCT Resilient Flooring South Firehall - Plywood Flooring | 1972 2016 | 52 8 | \$8,625 \$8,711 | -0.015384615 0.774289137 | treatment required in medium term treatment in long term |
| | South Firehall South Firehall | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3020 Floor Finishes C3030 Ceiling Finishes | South Firehall - Linoleum Flooring South Firehall - Gypsum Board Ceiling | 2016 1993 | 8 31 | \$6,555 \$19,320 | 0.829656755 0.876958783 | treatment in long term treatment in long term |
| 724 | South Firehall South Firehall | C INTERIORS C INTERIORS | C30 INTERIOR FINISHES C30 INTERIOR FINISHES | C3030 Ceiling Finishes C3030 Ceiling Finishes | South Firehall - Gypsum Board Ceiling South Firehall - Plywood Ceiling | 2001 1991 | 23 33 | \$345 \$1,466 | 0.721052632 0.63 | treatment in long term treatment in long term |
| 732 | | C INTERIORS | C30 INTERIOR FINISHES | C3030 Ceiling Finishes D2010 Plumbing Fixtures | South Firehall - CT Ceiling South Firehall - Plumbing Fixtures | 2001 1997 | 23 27 | \$4,324 \$2,300 | 0.708943659 -0.085267268 | treatment in long term Treatment Required in 2022 |
| 732 733 734 | South Firehall South Firehall | D SERVICES | D20 PLUMBING | | Cough Cooked Disables C | 1007 | 27 | 89.750 | 0.07770040 | templement recognised in the contract of the c |
| 732 733 734 735 736 | | D SERVICES D SERVICES D SERVICES D SERVICES | D20 PLUMBING D20 PLUMBING D20 PLUMBING D20 PLUMBING | D2010 Plumbing Fixtures D2010 Plumbing Fixtures D2010 Plumbing Fixtures D2020 Domestic Water Distribution | South Firehall - Plumbing Fixtures South Firehall - Plumbing Fixtures South Firehall - Domestic Water Equipment | 1997 1994 2018 | 27 30 6 | \$3,450 \$1,725 \$2,875 | 0.077700188 0.100273415 0.669955114 | treatment required in medium term treatment required in medium term treatment in long term |

| 740 | South Firehall | D SERVICES | D20 PLUMBING | D0040 D143 - F - O - 1 | 0 4 5 1 5 5 1 | 2012 | | | | |
|---|--|--|--|--|--|--|---|---|---|--|
| | | | | D3040 Distribution Systems | South Firehall - Air Louver | 2018 | - 6 | \$6,900 | 0.570704004 | treatment in long term |
| | South Firehall | D SERVICES | D30 HVAC | D3040 Distribution Systems | South Firehall - Exhaust Fan - Propeller Fan | 1998 | 26 | \$3,450 | 0.220968469 | treatment required in medium term |
| | South Firehall | D SERVICES | D30 HVAC | D3040 Distribution Systems | South Firehall - Exhaust Fans | 2021 | 3 | \$575 | -0.099780973 | Treatment Required in 2022 |
| | South Firehall | D SERVICES | D30 HVAC | D3040 Distribution Systems | South Firehall - Air Condition Condenser | 1994 | 30 | \$1,725 | 0.271241523 | treatment required in medium term |
| | South Firehall | D SERVICES | D30 HVAC | D3050 Terminal and Package Units | South Firehall - Suspended Radiant Unit Heaters | 2006 | 18 | \$17,250 | 0.521524023 | treatment in long term |
| | South Firehall | D SERVICES | D30 HVAC | D3050 Terminal and Package Units | South Firehall - Wall-Mounted Electric Unit Heaters | 1999 | 25 | \$863 | 0.321816958 | treatment required in medium term |
| | South Firehall | D SERVICES | D40 FIRE PROTECTION | D4030 Fire Protection Specialties | South Firehall - Fire Extinguishing Devices | 2011 | 13 | \$2,875 | 0.822121474 | treatment in long term |
| | South Firehall | D SERVICES | D50 ELECTRICAL | D5010 Electrical Service and Distribution | South Firehall - Electrical Distribution - Panels and Sw | 1998 | 26 | \$4,600 | 0.772438921 | treatment in long term |
| | South Firehall | D SERVICES | D50 ELECTRICAL | D5010 Electrical Service and Distribution | South Firehall - Electrical Distribution - Panels and Sw | 1972 | 52 | \$5,750 | -0.087229106 | Treatment Required in 2022 |
| 749 | South Firehall | D SERVICES | D50 ELECTRICAL | D5020 Lighting and Branch Wiring | South Firehall - Lighting - T8, T12 Fluorescent | 2004 | 20 | \$9,775 | 0.373119304 | treatment required in medium term |
| 750 | South Firehall | D SERVICES | D50 ELECTRICAL | D5020 Lighting and Branch Wiring | South Firehall - Lighting - Incandescent | 1988 | 36 | \$863 | -0.086513535 | Treatment Requried in 2022 |
| 751 | South Firehall | D SERVICES | D50 ELECTRICAL | D5030 Communication System | South Firehall - Security Systems | 1972 | 52 | \$4,025 | -0.086124776 | Treatment Required in 2022 |
| | South Firehall | D SERVICES | D50 ELECTRICAL | D5030 Communication System | South Firehall - PA Systems | 2016 | 8 | \$3.450 | 0.7765625 | treatment in long term |
| | South Firehall | D SERVICES | D50 ELECTRICAL | D5030 Communication System | South Firehall - Telecommunication Systems | 2008 | 16 | \$17,250 | 0.16037577 | treatment required in medium term |
| | South Firehall | D SERVICES | D50 ELECTRICAL | D5090 Other Electrical Systems | South Firehall - Emergency Lighting and Power - Exit L | 2021 | 3 | \$1,610 | 0.1003/3// | Treatment Required in 2022 |
| | | D SERVICES D SERVICES | D50 ELECTRICAL D50 ELECTRICAL | | | 2021 | 22 | \$1,610 | -0.099467902 | |
| | South Firehall | | | D5090 Other Electrical Systems | South Firehall - Emergency Lighting and Power - Exit L | | | | | Treatment Required in 2022 |
| | South Firehall | E EQUIPMENT AND FURNISHINGS | | E1090 Other Equipment | South Firehall - Food Service Equipment - Kitchen | 2007 | 17 | \$1,093 | -0.08426545 | Treatment Required in 2022 |
| | South Firehall | E EQUIPMENT AND FURNISHINGS | | E1090 Other Equipment | South Firehall - Food Service Equipment - Kitchen | 2009 | 15 | \$4,025 | 0.226311587 | treatment required in medium term |
| | South Firehall | E EQUIPMENT AND FURNISHINGS | | E1090 Other Equipment | South Firehall - Food Service Equipment - Kitchen | 2007 | 17 | \$1,725 | -0.084788094 | Treatment Requried in 2022 |
| 759 | South Firehall | G SITEWORK | G20 SITE IMPROVEMENT | G2010 Asphalt Paving | South Firehall - Asphalt Paving and Surfacing | 1972 | 52 | \$33,856 | -0.07660194 | Treatment Requried in 2021 or 2022 |
| 760 | South Firehall | G SITEWORK | G20 SITE IMPROVEMENT | G2010 Asphalt Paving | South Firehall - Asphalt Paving and Surfacing | 1972 | 52 | \$2,300 | -0.07889734 | Treatment Required in 2021 or 2022 |
| 761 | South Firehall | G SITEWORK | G20 SITE IMPROVEMENT | G2040 Site Development | South Firehall - Concrete Apron | 1972 | 52 | \$5,520 | 0.23150648 | treatment required in medium term |
| 762 | South Firehall | G SITEWORK | G20 SITE IMPROVEMENT | G2040 Site Development | South Firehall - Wood Sign | 1994 | 30 | \$3,450 | 0.217035068 | treatment required in medium term |
| | South Firehall | G SITEWORK | G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting | South Firehall - Exterior Lighting Fixtures - LED | 2016 | 8 | \$1,610 | 0.6672221 | treatment in long term |
| | South Firehall | G SITEWORK | G40 SITE ELECTRICAL UTILITIES | | South Firehall - Incandescent Projector | 2016 | | \$403 | -0.081428571 | Treatment Required in 2022 |
| | South Firehall Wooden Water Tower | A SUBSTRUCTURE | A10 FOUNDATIONS | G4020 Site Lighting A1030 Slab on Grade | South Firehall - Incandescent Projector Wooden Water Tower - Standard Slab on Grade | 2016 1943 | 81 | \$403 \$20,700 | 0.0001428571 | Treatment Required in 2022 Treatment Required in 2021 or 2022 |
| | | | | | | | | | -0.092588356 | |
| | Wooden Water Tower | B SHELL | B10 SUPERSTRUCTURE | B1010 Floor Construction | Wooden Water Tower - Floor Decks & Slabs - Wood F | 1894 | 130 | \$71,300 | 0.617603859 | treatment in long term |
| | Wooden Water Tower | B SHELL | B10 SUPERSTRUCTURE | B1010 Floor Construction | Wooden Water Tower - Columns and Beams - Wood B | 1894 | 130 | \$172,500 | -0.092201085 | Treatment Required in 2021 or 2022 |
| | Wooden Water Tower | B SHELL | B10 SUPERSTRUCTURE | B1020 Roof Construction | Wooden Water Tower - Roof Decks & Slabs - Wood De | 1894 | 130 | \$65,263 | 0.567996995 | treatment in long term |
| | Wooden Water Tower | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls | Wooden Water Tower - Wood Siding | 1894 | 130 | \$109,365 | 0.518198297 | treatment in long term |
| 770 | Wooden Water Tower | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls | Wooden Water Tower - Wood Siding | 1894 | 130 | \$46,000 | -0.091596963 | Treatment Required in 2022 |
| 771 | Wooden Water Tower | B SHELL | B20 EXTERIOR VERTICAL ENCLOSURES | B2010 Exterior Walls | Wooden Water Tower - Wood Soffit | 1894 | 130 | \$13,225 | 0.568611447 | treatment in long term |
| | | B SHELL | | B2030 Exterior Doors | Wooden Water Tower - Wood Doors | 1894 | 130 | \$2.875 | 0.658823782 | treatment in long term |
| | Wooden Water Tower | B SHELL | B30 EXTERIOR FORIZONTAL ENCLOSURES | B3010 Roof Coverings | Wooden Water Tower - Shingles | 2019 | 5 | \$39,158 | 0.669040321 | treatment in long term |
| | | | | E3010 Roof Coverings C3010 Wall Finishes | | | 130 | \$39,158 \$15,870 | 0.009040321 | |
| | Wooden Water Tower | C INTERIORS | C30 INTERIOR FINISHES | | Wooden Water Tower - Wood Walls | 1894 | | | -0.090738631 | Treatment Required in 2021 or 2022 |
| | Wooden Water Tower | D SERVICES | D20 PLUMBING | D2020 Domestic Water Distribution | Wooden Water Tower - Piping | 1894 | 130 | \$5,175 | 0.628571429 | treatment in long term |
| | Wooden Water Tower | D SERVICES | D50 ELECTRICAL | D5010 Electrical Service and Distribution | Wooden Water Tower - Electrical Distribution - Panels | 2016 | 8 | \$2,875 | 0.719487263 | treatment in long term |
| | Wooden Water Tower | D SERVICES | D50 ELECTRICAL | D5020 Lighting and Branch Wiring | Wooden Water Tower - Lighting - LED | 2011 | 13 | \$173 | 0.769718373 | treatment in long term |
| 778 | | G SITEWORK | G20 SITE IMPROVEMENT | G2030 Pedestrian Paving | Wooden Water Tower - Asphalt Walkway | 2011 | 13 | \$1,150 | -0.109378176 | Treatment Required in 2022 |
| 779 | Wooden Water Tower | G SITEWORK | G20 SITE IMPROVEMENT | G2040 Site Development | Wooden Water Tower - Fencing & Gates | 2012 | 12 | \$6,900 | 0.800953797 | treatment in long term |
| 780 | | G SITEWORK | G20 SITE IMPROVEMENT | G2040 Site Development | Wooden Water Tower - Ladder | 1943 | 81 | \$10,350 | 0.851271244 | treatment in long term |
| 781 | Wooden Water Tower | G SITEWORK | G20 SITE IMPROVEMENT | G2050 - Landscaping - General | Wooden Water Tower - Irrigation Systems | 2019 | 5 | \$920 | 0.701575761 | treatment in long term |
| | Wooden Water Tower | G SITEWORK | G20 SITE IMPROVEMENT | G2050 - Landscaping - General | Wooden Water Tower - Irrigation Systems | 2019 | 5 | \$4.025 | 0.651868695 | treatment in long term |
| | Wooden Water Tower | G SITEWORK | G30 SITE MECHANICAL UTILITIES | G3010 Water Supply | Wooden Water Tower - Piping | 1894 | 130 | \$8.625 | 0.702151196 | treatment in long term |
| | | | | | | | | | | 0 |
| | Wooden Water Tower | G SITEWORK | G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting | Wooden Water Tower - Exterior Lighting Fixtures | 2019 | 5 | \$575 | 0.659105696 | treatment in long term |
| | Wooden Water Tower | G SITEWORK | G40 SITE ELECTRICAL UTILITIES | G4020 Site Lighting | Wooden Water Tower - Exterior Lighting Fixtures | 2002 | 22 | \$230 | -0.081428571 | Treatment Required in 2022 |
| | Combermere Wharf Gazebo | all | all | all | | 2020 | 4 | \$32,200 | 1 | new in 2020 |
| 787 | Paul J. Yakabuski Communit | A Substructure | A10 Foundations | A1010 Standard Foundation | | 1984 | 40 | \$58,784 | 0.217068601 | refurb in medium term |
| 788 | Paul J. Yakabuski Communit | A Substructure | A10 Foundations | A1020 Special Foundation | | 1984 | 40 | \$4,216 | 0.217068601 | refurb in medium term |
| | | | | | | | | | | |
| | Paul J. Yakabuski Communit | A Substructure | A10 Basement Construction | A1030 Slab on Grade | arena slab | 1984 | 40 | \$1,800,000 | 0.95 | \$1.9M slab replacement in 2022 |
| 789 | | | | | arena slab | 1984 1984 | | | 0.95 | |
| 789 790 | Paul J. Yakabuski Communit | A Substructure | A20 Superstructure | A2020 Basement Walls | arena slab | 1984 | 40 | \$1,570 | 0.217068601 | refurb in medium term |
| 789 790 791 | Paul J. Yakabuski Communit Paul J. Yakabuski Communit | A Substructure B Shell | A20 Superstructure B10 Superstructure | A2020 Basement Walls B1010 Floor Construction | arena slab | 1984 1984 | 40 40 | \$1,570 \$5,161 | 0.217068601 0.217068601 | refurb in medium term refurb in medium term |
| 789 790 791 792 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substructure B Shell B Shell | A20 Superstructure B10 Superstructure B10 Exterior Enclosure | A2020 Basement Walls B1010 Floor Construction B1020 Roof Construction | arena slab | 1984 1984 1984 | 40 40 40 | \$1,570 \$5,161 \$4,406 | 0.217068601 0.217068601 0.227308074 | refurb in medium term refurb in medium term refurb in medium term |
| 789 790 791 792 793 | Paul J. Yakabuski Communii Paul J. Yakabuski Communii Paul J. Yakabuski Communii Paul J. Yakabuski Communii | A Substructure B Shell B Shell B Shell | A20 Superstructure B10 Superstructure B10 Exterior Enclosure B20 Exterior Enclosure | A2020 Basement Walls B1010 Floor Construction B1020 Roof Construction B2010 Exterior Walls | arena slab | 1984 1984 1984 1984 | 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 | 0.217068601 0.217068601 0.227308074 0.227308074 | refurb in medium term |
| 789 790 791 792 793 794 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi Paul J. Yakabuski Communi Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substructure B Shell B Shell B Shell B Shell B Shell | A20 Superstructure B10 Superstructure B10 Exterior Enclosure B20 Exterior Enclosure B20 Exterior Enclosure | A2020 Basement Walls B1010 Floor Construction B1020 Roof Construction B2010 Exterior Walls B2020 Exterior Windows | arena slab | 1984 1984 1984 1984 1984 | 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,784 | 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 | refurb in medium term |
| 789 790 791 792 793 794 796 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substructure B Shell B Shell B Shell B Shell B Shell B Shell | A20 Superstructure 810 Superstructure 810 Superstructure 810 Exterior Enclosure 820 Exterior Enclosure 820 Exterior Enclosure 820 Roofing | A2020 Basement Walls B1010 Floor Construction B1020 Roof Construction B2010 Exterior Walls B2020 Exterior Windows B2030 Exterior Doors | arena siab | 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,784 \$21,433 | 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 | refurb in medium term |
| 789 790 791 792 793 794 796 | Paul J. Yakabuski Communit Paul J. Yakabuski Communit | A Substructure B Shell | A20 Superstructure B10 Superstructure B10 Exterior Enclosure B20 Exterior Enclosure B20 Exterior Enclosure B20 Exterior Enclosure B20 Roofing B30 Roofing | A2020 Basement Walls B1010 Floor Construction B1010 Floor Construction B2010 Extenior Walls B2020 Extenior Walls B2020 Extenior Windows B2020 Extenior Doors B3010 Rod Coverings | arena siab | 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,784 \$21,433 \$17,438 | 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 | refurb in medium term |
| 789 790 791 792 793 794 796 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substructure B Shell | A20 Superstructure 810 Superstructure 810 Superstructure 810 Exterior Enclosure 820 Exterior Enclosure 820 Exterior Enclosure 820 Roofing | A2020 Basement Walls B1010 Floor Construction B1020 Roof Construction B2010 Exterior Walls B2020 Exterior Windows B2030 Exterior Doors | arena siab | 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,784 \$21,433 | 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 | refurb in medium term |
| 789 790 791 792 793 794 796 797 | Paul J. Yakabuski Communit Paul J. Yakabuski Communit | A Substructure B Shell | A20 Superstructure B10 Superstructure B10 Exterior Enclosure B20 Exterior Enclosure B20 Exterior Enclosure B20 Exterior Enclosure B20 Roofing B30 Roofing | A2020 Basement Walls B1010 Floor Construction B1010 Floor Construction B2010 Extenior Walls B2020 Extenior Walls B2020 Extenior Windows B2020 Extenior Doors B3010 Rod Coverings | arene slab | 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,784 \$21,433 \$17,438 | 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 | refurb in medium term |
| 789 790 791 792 793 794 796 797 | Paul J. Yakabuski Communit Paul J. Yakabuski Communit | A Substructure 8 Shell B Shell C Inderiors | A20 Superstructure B10 Superstructure B10 Superstructure B20 Exterior Enclosure B20 Roofing B30 Proofing | A0000 Basement Walls 31010 Floor Construction 31000 Roof Construction 31000 Roof Construction 30010 Editor Walls 30000 Editorio Windows 30010 Roof Coverings 30010 Roof Coverings 30010 Roof Coverings 30000 Roof Openings C1010 Partitions C10200 Interior Doors | orena sido | 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,784 \$21,433 \$17,438 \$8,927 | 0.217088601 0.217088601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.41924584 | refut is medium term refut in medium term refut in medium term refut is medium term |
| 789 790 791 792 793 794 796 797 798 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substructure B Shell C Shell C Shell C Shell C Shell C Interiors | AGS Spentinschure 810 Spentinschure 810 Spentinschure 810 Satterius Endosume GGD Enterius Endosume GGD Enterius Endosume GGD Enterius Endosume GGD Rodring GGD Rodring | A2020 Basement Walls B1010 Floor Construction B1020 Floor Construction B2010 Extenor Walls B2010 Extenor Walls B2020 Extenor Walls B2030 Extenor Doors B3010 Roof Coverings S3020 Roof Openings C1010 Partitions | preven slob | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,784 \$21,433 \$17,438 \$8,927 \$24,077 | 0.217088601 0.217088601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.41924584 0.217088601 | refurb in medium term |
| 789 790 791 792 793 794 796 797 798 799 800 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substructure 8 Shell 8 Shell 8 Shell 9 Shell 9 Shell 8 Shell 8 Shell 9 Shell 10 Shell C Interiors C Interiors C Interiors | AGO Supershockure 1810 Supershockure 1810 Exterior Enclosure 820 Redeling 820 Redeling 820 Redeling 820 Redeling 620 Redeling 620 Redeling 620 Redeling | A0000 Basement Walls 31010 Floor Construction 31000 Roof Construction 31000 Roof Construction 30010 Editor Walls 30000 Editorio Windows 30010 Roof Coverings 30010 Roof Coverings 30010 Roof Coverings 30000 Roof Openings C1010 Partitions C10200 Interior Doors | preva dido | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,764 \$21,433 \$17,438 \$8,927 \$24,077 \$9,985 | 0.217088601 0.217088601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.41924584 0.217088601 0.227308074 | refur in medium term refuto in medium term |
| 789 790 791 792 793 794 796 797 798 799 800 801 | Paul J. Yakabuski Communii Paul J. Yakabuski Communii | A Substructure S Shed C Shed S Shed C Interiors C Interiors C Interiors | ASS Superinschure 310 Septentschure 310 Setentschure 310 Setentschure 310 Setentschure 320 | A0200 Basement Walls 91020 Roof Construction 91020 Roof Construction 91020 Roof Construction 92000 Edention Walls 92000 Edention Windows 92000 Edention Windows 92000 Edention Work 92000 Edention Windows 92000 Edention Windows 92000 Edention Coors 92010 Roof Overrings 92010 Roof Overrings 92010 Roof Construction 10100 Pairs Construction 10200 Interior Coors 10300 Failings | preven slob | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 40 40 40 40 | \$1,570 \$5,161 \$4,400 \$0,975 \$8,784 \$21,433 \$17,438 \$8,927 \$9,985 \$6,669 \$50,069 | 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.41924584 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 | refur in medium term ordur in medium term |
| 789 790 791 792 793 794 796 796 797 798 800 801 802 | Paul J. Vakabuski Communi Paul J. Vakabuski Communi | A Substitutions Substitution Su | AGS Seprentructure 810 Setterior Enciosure 810 Setterior Enciosure 800 Setterior Enciosure 800 Setterior Enciosure 800 Restorior 800 Re | A0000 Basement Walls 9100 Floor Contentucion 9000 Esterior Windows 90000 Esterior Windows 90000 Floor Coverings 90000 Floor | preva stato | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1,570 \$5,161 \$4,406 \$50,975 \$58,764 \$21,433 \$17,438 \$8,927 \$24,077 \$9,985 \$55,699 \$52,039 \$1,281 | 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.217068601 0.227308074 0.227508074 0.2365659274 0.429164508 0.426166101 | which is medium term |
| 789 790 791 792 793 794 796 796 797 798 800 801 802 803 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substructure Sheel Chelerions C Interiors C Interiors C Interiors C Interiors C Interiors C Interiors | ASO Superintroducture 310 Extenter Enchancer 310 Extenter Enchancer 310 Extenter Enchancer 320 Extenter Enchancer 320 Extenter Enchancer 320 Extenter Enchancer 330 Roman Superintroducture CII Ol Meteror Construction CII Ol Meteror Construction CII Ol Meteror Construction CII Ol Meteror Finales CII Ol Meteror Finales | A0200 Basement Walls B1000 Floor Construction B1000 Root Construction B1000 Root Construction B1000 Root Construction B1000 Root Construction B0000 Extensive Walls B0000 Extensive Windows B0010 Root Coverings B0010 Root Coverings B0010 Root Coverings C1010 Partitions C1010 Interest Doors C1000 Interest Doors C1000 Falling Countries C2000 Size Finishes C2000 Walf Finishes | prevent slabb | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1,570 \$4,466 \$0,0975 \$88,784 \$21,438 \$17,48 \$8,927 \$9,985 \$5,009 \$1,281 \$2,009 \$1,281 \$4,124 | 0.217088601 0.217088601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.41924584 0.217088601 0.227308074 0.236959274 0.429154506 0.246106101 0.254815789 | action in medium term official in medium term |
| 789 790 791 792 793 794 796 796 797 798 800 801 802 803 804 | Paul J. Vakabuski Communi Paul J. Vakabuski Communi | A Substitutions Si Shed Si She | AGS Seprestructure 810 Esterior Enclosure 810 Esterior Enclosure 810 Esterior Enclosure 800 Resting 8 | A0000 Basement Walls 9100 Floor Contentucion 9100 Floor Contentucion 9100 Floor Contentucion 91000 Floor Covenings 91000 Floor Selection 91000 Floor Floor Covenings 91000 Floor Floor Floor Floor Covenings 91000 Floor Floor Floor Floor Floor Covenings 91000 Floor Floor Floor Floor Floor Floor Covenings 91000 Floor Floor Floor Floor Floor Floor Floor Covenings 91000 Floor F | prevent slabb | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.070 \$5.161 \$4.406 \$50.975 \$50.764 \$11.459 \$8.027 \$9.085 \$5.009 \$5.009 \$5.009 \$1.221 \$4.125 \$5.009 \$5.009 \$1.221 \$4.124 \$5.009 \$5.00 | 0.217068601 0.217068601 0.217068601 0.227308074 0.227308074 0.227308074 0.227308074 0.41924584 0.217068601 0.227308074 0.236959274 0.429154506 0.246108101 0.268108101 0.268108101 | which is medium term |
| 789 790 791 792 793 794 796 796 797 798 800 801 802 803 804 | Paul J. Yakabuski Communi Paul J. Yakabuski Communi | A Substitution S Debt C Interiors C Interiors C Interiors C Interiors C Interiors C Interiors | AGO Superinstrukture 310 Esterinstrukture 310 Esterinstrukture 310 Esterinstrukture 310 Esterinstrukture 320 Esterinstrukture 320 Esterinstrukture 320 Esterinstrukture 320 Esterinstrukture 330 Rechtoring 330 Rechtori | A0200 Basement Walls 91000 Floor Construction 91020 Roof Construction 91020 Roof Construction 91020 Roof Construction 92000 Extensive Walls 92000 Extensive Windows 10000 Floor Construction 10000 Floor Construction 10000 Floor Finishes 10000 Celling Finishes 10000 Celling Finishes | preva side | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1,000 \$1 | 0.217088601 0.217088601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.41924584 0.217088601 0.227308074 0.238699274 0.429154508 0.429154508 0.246106101 0.25314311 0.27133314 | action in medium term |
| 789 790 791 792 793 794 796 796 797 798 800 801 802 803 804 805 | Paul J Valabuski Communi | A Substitutions Substitution Su | AGS Seprentucture 810 Enterior Enclosure 810 Enterior Enclosure 810 Enterior Enclosure 800 Residen 80 | A0000 Basement Walls 9100 Floor Construction 91000 Roof Construction 91000 Roof Construction 91000 Roof Construction 91000 Roof Construction 90000 Esterior Windows 90000 Esterior Covering 90000 Roof Coverings 90000 Roof Roof Roof Roof Roof Roof Roof | prevent slabb | 1994 1994 1994 1994 1996 1996 1996 1996 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$5.161 \$4.406 \$50.975 \$50.975 \$50.764 \$17.489 \$8.527 \$9.985 \$50.099 \$50.099 \$50.099 \$1.281 \$4.124 \$53.590 \$71.435 \$71.435 | 0.217088601 0.217088601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.217088601 0.217088601 0.227308074 0.236959274 0.429154508 0.246106101 0.254816789 0.25314311 0.27183311 0.27183311 0.27183214 | which is medium term |
| 789 790 791 792 793 794 796 796 797 798 800 801 802 803 804 805 806 807 | Paul J Valabaski Communi | A Substance S Shed C C Interiors C C Interiors C C Interiors C C Interiors | AGS Seprentructure 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 320 Extent Enclosure 320 Extent Enclosure 320 Extent Enclosure 320 Extent Enclosure 330 Roofing | A0200 Basement Walls 91020 Roof Construction 91020 Roof Construction 91020 Roof Construction 91020 Roof Construction 92000 Esterior Windows 92000 Roof Owenings 92000 Roof Owenings 10100 Partitions 10100 Interior Doors 10300 Roof Construction 10300 Roof Construction 10300 Roof Construction 10300 Roof Printerior 10300 Roof Pri | preva sido | 1984 1984 1984 1984 1984 1984 1984 1984 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.570 \$1 | 0.217088601 0.217088601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.217088601 0.227308074 0.217088601 0.227308074 0.23659274 0.429154500 0.248108101 0.254815789 0.28613311 0.271133314 0.27882426 0.286247988 | action in medium term relation medium term |
| 789 790 791 792 793 794 796 797 798 800 801 802 803 804 806 807 808 | Paul J Valabaski Communi | A Substitutions Substitution Su | AGS Sepretivolene 810 Enterior Enclosure 810 Enterior Enclosure 810 Enterior Enclosure 850 Enterior 850 Indexing 950 Indexing | A0000 Basement Walls 91000 Floor Construction 91000 Roof Construction 91000 Roof Construction 91000 Roof Construction 91000 Roof Construction 90000 Edestor Windows 90000 Edestor Doors 90000 Roof Coverings 900000 Roof Coverings 900000000000000000000000000000000000 | prema slob | 1994 1994 1994 1995 1996 1996 1996 1996 1996 1996 1996 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.570 \$5.161 \$4.400 \$5.0975 \$56.774 \$17.438 \$3.4077 \$3.985 \$5.0099 \$5.2099 \$1.281 \$4.124 \$5.5099 \$7.445 \$5.5099 \$7.445 \$3.5090 \$7.445 \$3.5090 \$1.186 \$1.186 \$1 | 0.217088601 0.217088601 0.21708801 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.217088801 0.217088801 0.217088801 0.24708074 0.246106101 0.254815789 0.26314311 0.27183314 0.27882426 0.217088801 | which is medium term |
| 789 790 791 792 793 794 796 796 797 798 799 800 801 802 803 804 806 806 | Peul J Yakabuski Communi | A Substitution S Shed C Interiors C Inter | ASO Superintroducture 310 Extentir Enclosure 310 Extentir Enclosure 310 Extentir Enclosure 320 Extentir Enclosure 320 Extentir Enclosure 320 Extentir Enclosure 320 Extentir Enclosure 330 Roterior 330 | A0200 Basement Walls 91020 Roof Construction 91020 Roof Construction 91020 Roof Construction 92000 Esterior Walls 92000 Esterior Windows 92000 Roof Owenings 92000 Roof Owenings 10100 Partitions 10100 Interior Doors 10300 Roof Construction 10200 Interior Construction 10200 Wall Finishes 10300 Poeming Finishes 10100 Esteriors & Jith 10100 Esteriors & Jith 10100 Exerciors & Jith 10100 Exerciors & Jith 10100 Construction 10100 Construc | preva dido | 1994 1994 1994 1994 1995 1995 1996 1996 1996 1998 1998 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.570 \$1 | 0.217088601 0.217088601 0.21708801 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.217088601 0.227308074 0.236959274 0.246106101 0.254815799 0.26314311 0.2711333146 0.2786245 0.286247968 0.217088601 | action in medium term official in medium term |
| 789 790 791 792 793 794 795 796 797 798 800 801 802 803 804 805 806 807 808 | Paul J Valabaski Communi | A Substitutions Substitution Su | AGS Seprentivolene 810 Enterior Enclosure 810 Enterior Enclosure 810 Enterior Enclosure 850 Enterior Constitución COI Description COI D | A0000 Basement Walls 91000 Floor Construction 91000 Roof Construction 91000 Roof Construction 91000 Roof Construction 91000 Roof Construction 90000 Exterior Windows 90000 Exterior Windows 90000 Exterior Doors 90000 Exterior Doors 90000 Roof Coverings 90000 Roof Roof Roof Roof Roof 90000 Roof Roof Roof 90000 Roof Roof Roof 90000 Roof 900000 Roof 90000 Roof 900 | prena sido | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$5.161 \$4.400 \$5.0975 \$56.774 \$21.743 \$17.438 \$8.34077 \$9.345 \$5.009 \$5.2099 \$1.281 \$4.124 \$5.5090 \$71.415 \$2.000 \$11.800 \$1.3000 \$1.3 | 0.21708801 0.21708801 0.217088074 0.227380074 0.22738074 0.22738074 0.22738074 0.21738074 0.21738074 0.21738074 0.21738074 0.21738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 | which is medium term |
| 789 790 791 792 793 794 796 796 797 798 800 801 802 803 804 806 807 808 809 810 | Paul J Valaduski Communi | A Substitution A Substitution B Shed B Shed B Shed B Shed B Shed C Interiors C | ASI Superintroducture 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 320 Exte | A2020 Basement Walls B100 Floor Construction B1020 Roof Construction B1020 Roof Construction B1020 Roof Construction B2000 Extensive Walls B2000 Roof Coverings B2000 Roof Coverings B2000 Roof Coverings C1000 Floor C2000 Hater Coverings C2000 Floor C2000 Hater Finance C2000 Size Finance C2000 Floor C2000 Finance C2000 | preva dido | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.570 \$1 | 0.217088901 0.217088901 0.217088901 0.217088901 0.217088907 0.227398074 0.227398074 0.41924584 0.41924584 0.217088907 0.227389074 0.227388907 0.228451510 0.2584510 0.25845151 | and it is medium term which is medium term |
| 7899 7907 7911 7922 7933 794 7956 7966 800 801 802 803 804 805 806 809 801 811 | Peul J Valdabuski Communi | A Substance S Shed S Sh | ASS Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seterior Enclosurure 300 Seterior Enclosurure 300 Seterior Enclosurure 300 Seterior Enclosurure 300 Rechring 300 Rechring 300 Rechring 300 Rechring 300 Rechring 300 Rechring 500 Countryping 500 Countryping 500 Persenting | A0200 Basement Walls B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B2000 Extensive Windows B2000 Extensive Windows B2000 Extensive B0000 B2000 Extensive B0000 B2000 Roof Convenings B3000 Roof Convenings B3000 Roof Convenings B3000 Roof Convenings C1010 Partitions C1010 Baser Construction C1000 Interior Convenings C1000 Roof Convenings C2000 Roof Convenings C2000 Roof Frankings C2000 Roof Frankings C2000 Roof Frankings C2000 Roof Frankings D1000 Convenings D1000 | prevent slob | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$ 5.161 \$ 4.400 \$ 50.075 \$ 858.794 \$ 221.435 \$ 177.438 \$ 88.227 \$ 24.077 \$ 24.077 \$ 3.000 \$ 55.000 \$ 55.000 \$ 51.261 \$ 571.455 \$ 57 | 0.21708801 0.21708801 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.2874574 0.287 | and it is medium term which is medium term |
| 7899 7907 7911 7922 7933 794 7956 7966 800 801 802 803 804 805 806 809 801 811 | Paul J Valaduski Communi | A Substance S Shed S Sh | ASS Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seterior Enclosurure 300 Seterior Enclosurure 300 Seterior Enclosurure 300 Seterior Enclosurure 300 Rechring 300 Rechring 300 Rechring 300 Rechring 300 Rechring 300 Rechring 500 Countryping 500 Countryping 500 Persenting | A0200 Basement Walls B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B2000 Extensive Windows B2000 Extensive Windows B2000 Extensive B0000 B2000 Extensive B0000 B2000 Roof Convenings B3000 Roof Convenings B3000 Roof Convenings B3000 Roof Convenings C1010 Partitions C1010 Baser Construction C1000 Interior Convenings C1000 Roof Convenings C2000 Roof Convenings C2000 Roof Frankings C2000 Roof Frankings C2000 Roof Frankings C2000 Roof Frankings D1000 Convenings D1000 | prevent states | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.570 \$1 | 0.217088901 0.217088901 0.217088901 0.217088901 0.217088907 0.227398074 0.227398074 0.41924584 0.41924584 0.217088907 0.227389074 0.227388907 0.228451510 0.2584510 0.25845151 | and it is medium term which is medium term |
| 789 791 791 792 793 794 795 796 797 798 800 801 802 803 804 805 808 807 811 811 812 813 | Paul J Valabuski Communi | A Substitution A Substitution B Shed B Shed B Shed B Shed B Shed B Shed C Interiors C Inte | ASI Superintroducture 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 320 Exte | A2020 Basement Walls 11020 Root Construction 11020 Root Construction 11020 Root Construction 11020 Root Construction 10200 Esterior Walls 10200 Esterior Windows 10200 Esterior Windows 10200 Esterior Windows 10200 Esterior Windows 10200 Root Coverings 10200 Root Finishes 10200 Root Finishes 10200 Root Finishes 10100 Esterior Site All Moving Walls 10100 OPhum Root Finishes 10200 Down Covering Systems 10200 Sandards Walter Distribution 10200 Sandards Walter Distribution 10200 Root Walter Distribution 10200 Other Distribution | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$ 5.161 \$ 4.400 \$ 50.075 \$ 858.794 \$ 221.435 \$ 177.438 \$ 88.227 \$ 24.077 \$ 24.077 \$ 3.000 \$ 55.000 \$ 55.000 \$ 51.261 \$ 571.455 \$ 57 | 0.21708801 0.21708801 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.22738074 0.2874574 0.287 | and it is medium term which is medium term |
| 7899 7907 791 791 792 793 794 795 796 800 801 802 808 806 807 808 801 811 811 812 813 | Peul J Valabuski Communi | A Substance S Shed S Sh | ASI Superintroducture 310 Extenter Enclosurer 310 Extenter Enclosurer 310 Extenter Enclosurer 320 Extenter Enclosurer 320 Extenter Enclosurer 320 Extenter Enclosurer 320 Extenter Enclosurer 330 Roofing 330 Roofing 330 Roofing 330 Roofing 330 Roofing 330 Restorer Construction C10 Interior Construction C10 Interior Construction C10 Interior Enclosure C20 Interior Finishes C30 Interior Finishes C | A0200 Basement Walls 19100 Floor Controlucion 19100 Floor Controlucion 19100 Floor Controlucion 19100 Floor Controlucion 19200 Edentiro Windows 19200 Edentiro Windows 19200 Edentiro Windows 19200 Edentiro Doors 193010 Floor Coverings 19300 Floor Goverings 19300 Floor Goverings 19300 Floor Goverings 19100 Floor Coverings 19100 Floor Floor Floor 19100 Floor Floor 19100 Floor Floor 19100 Floor Floor 19100 Floor | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.00 | 0.21708801 0.21708801 0.22738074 | and it is medium term which is medium term |
| 789 790 791 791 792 793 794 795 795 795 795 795 795 795 795 795 795 | Paul J Valaduski Communi | A Substitution Since Si | ASI Superintroducture 310 Extenter Enclosurer 310 Extenter Enclosurer 310 Extenter Enclosurer 320 Extenter Enclosurer 330 Rooferge 330 Rooferg 330 Rooferge 330 Rooferge 330 Rooferge 330 Rooferge 330 Rooferg 330 Rooferge 330 Rooferg 330 Ro | A2020 Basement Walls B1020 Root Construction B1020 Root Construction B1020 Root Construction B1020 Root Construction B2030 Extensive Walls B2030 Extensive Walls B2030 Extensive Walls B2030 Extensive Walls B2030 Root Coverings B3030 Root Coverings B3030 Root Coverings B3030 Root Coverings C1030 Fairings C1030 Fairings C1030 Fairings C2030 Wall Finishers C3030 For Finishers C3030 For Finishers C3030 Colling Finishers D10300 Colling Finishers D10300 Colling Finishers D10300 Colling Finishers D3000 Finishers | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.00 | 0.27106801 0.27106801 0.22708074 0.22808789 | and it is medium term offet in in indexim term offet in indexim term |
| 789 790 791 791 792 793 794 795 795 796 797 796 800 801 802 803 804 806 807 807 808 809 801 801 801 801 801 801 801 801 801 801 | Peul J Valabuski Communi | A Substance S Shed S Sh | ASS Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 300 Setterior Enclosure 300 Setterior Enclosure 300 Setterior Enclosure 300 Recting 500 Recting | A0200 Basement Walls B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B2000 Exterior Windows B2000 Exterior Windows B2000 Exterior Doors B3010 Roof Coverings B3000 Roof Coverings B3000 Roof Coverings C1010 Partitions C1010 Balance Doors C1010 Partitions C1010 Balance Doors C1000 Roof Coverings C2000 Roof Coverings C2000 Roof Coverings C2000 Roof Coverings C2000 Roof Roof Roof Roof Roof Roof Roof R | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.570 \$5.161 \$4.400 \$50,075 \$60,764 \$21,435 \$17,438 \$17,435 \$8,927 \$24,607 \$0,865 \$65,609 \$1,281 \$4,124 \$5,1300 \$1,281 \$4,124 \$5,1300 \$1,281 \$1,145 \$1,14 | 0.27108801 0.27108801 0.27108074 0.27208074 0.22738074 0.22738074 0.22738074 0.22738074 0.271080 0.271080 0 | and/or in medium term witch is medium term |
| 789 799 799 799 799 799 799 799 799 799 | Paul J Valabuski Communi | A Substitutions S Shed S She | ASS Seprentructure 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 310 Extent Enclosure 320 Extent | A0200 Basement Walls B1000 Floor Construction B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B1000 Roof Construction B2000 Extensive Walls B2000 Extensive Walls B2000 Extensive Walls B2000 Extensive Walls B2000 Roof Openings C10100 Partitions C10100 Roof Converings B3000 Roof Openings C10100 Floor Extensive C2000 Staff Finance C2000 Staff Finance C3000 Floor Finance C3000 Calling Calling C3000 Calling C30000 Calling C30000 Calling C30000 Calling C30000 Calling C300000 Calling C3000000000000000000000000000000000000 | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.00 pt 10 | 0.27106801 0.27106801 0.22708074 0.22808789 | and/or in medium term offshi in offshi term offshi in medium term offshi in offshi offshi |
| 769 799 799 791 791 791 791 791 791 791 79 | Peul J Valabaski Communi | A Substitution S Shed S Shed | ASS Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 300 Setterior Enclosure 300 Setterior Enclosure 300 Setterior Enclosure 300 Setterior Enclosure 300 Recting 300 Recting 300 Recting 300 Recting 300 Recting 500 Recting | A0200 Basement Walls 91000 Floor Construction 91000 Roof Construction 91000 Roof Construction 92000 Extensive Walls 92000 Extensive Windows 92000 Extensive Windows 92000 Extensive Doors 92010 Roof Coverings 92000 Roof Roof Roof Roof Roof Roof Roof R | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$ 5.6161 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.0075 \$ 5.61764 \$ 5.71.435 \$ 5.71.435 \$ 5.71.435 \$ 5.70.435 \$ 5.80.27 \$ 5.20.075 \$ 5.80.855 \$ 5.5000 \$ 5.1261 \$ 5.2000 \$ 5.11.860 \$ 5.100.65 | 0.27106801 0.27106801 0.27206074 | action in medium term witch in medium term |
| 789 799 792 793 794 795 796 796 796 800 801 801 802 806 808 808 808 808 808 808 808 808 808 | Paul J Valaduski Communi | A Substitution S Shed S Shed | ASS Superintroducture 310 Extentire Dischaume 310 Extentire Dischaume 310 Extentire Dischaume 320 Extentire 320 Purmäning 320 Purmäning 320 Purmäning 320 Purmäning 320 Extentire 320 | A0000 Basement Walls 11000 Roor Construction 11000 Roof Construction 11000 Esterior Windows 11000 Esterior Windows 11000 Esterior Windows 11000 Roof Coverings 11000 Roof Roof Roof Roof Roof Roof Roof R | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.00 | 0.271068601 0.272068601 | action in medium term soften in medium term |
| 789 799 799 799 799 799 799 799 799 8000 799 8000 800 800 800 800 800 800 800 800 | Peul J Valabuski Communi | A Substitution S Shed S | ASS Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seprestructure 310 Seterior Enclosurure 300 Seterior Enclosurure 300 Seterior Enclosurure 300 Seterior Enclosurure 300 Recting 300 Recting 300 Recting 300 Recting 300 Recting 300 Recting 500 | A0200 Basement Walls 19100 Roor Construction 19100 Roof Construction 19100 Roof Construction 20200 Extensiv Windows 20200 Extensiv Windows 20200 Extensiv Doors 20200 Roof Coverings 20200 Roof Roof Roof Roof 20200 Roof Roof Roof 20200 Roof Roof 20200 Roof Roof 20200 Roof Roof 20200 R | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$ 5.6161 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.0075 \$ 5.61764 \$ 5.7435 \$ 5.7445 \$ 5.7445 \$ 5.7455 \$ 5.8005 \$ 5. | 0.271068601 0.227066074 0.22706074 | action in medium term witch in medium term |
| 789 799 799 799 799 799 799 799 799 799 | Paul J Valaduski Communi | A Substitution S End S E | ASS Superintroducture 310 Extention Enclosure 310 Extentior Enclosure 310 Extentior Enclosure 320 Extentior Enclosure 320 Extentior Enclosure 320 Extentior Enclosure 320 Extentior Enclosure 330 Rostorer 330 Rostor | A0200 Basement Walls 11000 Floor Construction 11000 Roof Construction 11000 Roof Construction 11000 Roof Construction 10000 Esterior Walls 10000 Esterior Windows 10000 Esterior Windows 10010 Roof Coverings 10010 Roof Roof Coverings 10010 Roof Roof Roof Roof Roof Roof Roof Roo | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.000 \$1 | 0.271068601 0.272068601 0.227206074 0.2272 | action in medium term soften in medium term |
| 769 799 799 799 799 799 799 799 799 799 | Peul J. Yakabuski Communi | A Substance S Shed S Sh | ASS Seprentinchure 310 Seprentinchure 310 Seprentinchure 310 Setentre Dicobaume 300 Setentre Endosaume 300 Setentre Endosaume 300 Setentre Endosaume 300 Setentre Endosaume 300 Setentre Candina 300 Rechting 300 Rec | A0200 Basement Walls 19100 Roor Construction 19100 Roof Construction 19100 Roof Construction 20200 Esterior Windows 20200 Esterior Windows 20200 Esterior Windows 20200 Esterior Doors 20200 Roof Coverings 20200 Roof Roof Roof Roof Roof Roof Roof Ro | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$ 5.6101 \$ 5.400 \$ 5.0075 \$ 5.611 \$ 5.400 \$ 5.0075 \$ 5.6176 \$ 5.6176 \$ 5.743 \$ 5.743 \$ 5.743 \$ 5.743 \$ 5.743 \$ 5.827 \$ 5.2000 \$ 5.2000 \$ 5.1201 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.100000 \$ 5.1 | 0.271068601 0.227066074 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060777 | action in medium term witch in medium term |
| 769 799 799 799 799 799 799 799 799 799 | Paul J Valaduski Communi | A Substance S Shed S Sh | ASS Superintroducture 310 Extention Enclosure 310 Extentior Enclosure 310 Extentior Enclosure 320 Extentior Enclosure 320 Extentior Enclosure 320 Extentior Enclosure 320 Extentior Enclosure 330 Rostorer 330 Rostor | A0200 Basement Walls 11000 Floor Construction 11000 Roof Construction 11000 Roof Construction 11000 Roof Construction 10000 Esterior Walls 10000 Esterior Windows 10000 Esterior Windows 10010 Roof Coverings 10010 Roof Roof Coverings 10010 Roof Roof Roof Roof Roof Roof Roof Roo | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.000 \$1 | 0.271068601 0.272068601 0.227206074 0.2272 | action in medium term soften in medium term |
| 789 799 799 799 799 799 799 799 799 799 | Peul J. Yakabuski Communi | A Substitution Since Si | ASS Seprentinchure 310 Seprentinchure 310 Seprentinchure 310 Setentre Dicobaume 300 Setentre Endosaume 300 Setentre Endosaume 300 Setentre Endosaume 300 Setentre Endosaume 300 Setentre Candina 300 Rechting 300 Rec | A0200 Basement Walls 19100 Roor Construction 19100 Roof Construction 19100 Roof Construction 20200 Esterior Windows 20200 Esterior Windows 20200 Esterior Windows 20200 Esterior Doors 20200 Roof Coverings 20200 Roof Roof Roof Roof Roof Roof Roof Ro | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$ 5.6101 \$ 5.400 \$ 5.0075 \$ 5.611 \$ 5.400 \$ 5.0075 \$ 5.6176 \$ 5.6176 \$ 5.743 \$ 5.743 \$ 5.743 \$ 5.743 \$ 5.743 \$ 5.827 \$ 5.2000 \$ 5.2000 \$ 5.1201 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.10000 \$ 5.100000 \$ 5.1 | 0.271068601 0.227066074 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060774 0.227060777 | which is medium term |
| 769 799 799 799 799 799 799 799 799 799 | Paul J Valaduski Communi | A Substance S Shed S | AGS Superstructure 310 Setteris Enclosure 310 Setteris Enclosure 310 Setteris Enclosure 310 Setteris Enclosure 320 Setteris Enclosure 320 Setteris Enclosure 320 Setteris Enclosure 320 Setteris Setteris 330 Roofing 330 Roofing 330 Roofing 330 Roofing 330 Restructure CIO Interior Construction CIO Interior Construction CIO Setteris Freinbes CIO Interior Construction CIO Setteris Freinbes CIO Interior Freinbes CIO Interior Construction CIO Setteris CIO Conveying CIO Purmiting CIO Pu | A2020 Basement Walls 1100 Floor Construction 1100 Floor Floor Floor 1100 Floor Construction 1100 Floor Floor 1100 Floor | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1.570 \$1 | 0.271068601 0.271068601 0.272060074 0.272060 | and the medium term soluth is medium term |
| 769 7790 7790 7790 7790 7790 7790 7790 7 | Peul J Valabuski Communi | A Substitution Signal Signal | ASS Seprestructure 310 Seprestru | A0200 Basement Walls 19100 Floor Controlucion 19100 Rod Construction 19100 Rod Construction 20100 Esterior Windows 20200 Esterior Windows 20200 Esterior Doors 2010 Rod Coverings 20200 Rod | | 1994 1994 1994 1994 1994 1994 1994 1994 1994 1994 1994 1994 1994 1995 19 | 40 40 40 40 40 40 40 40 40 40 | \$ 1.570 \$ 5.6101 \$ 5.400 \$ 5.0075 \$ 5.6101 \$ 5.400 \$ 5.0075 \$ 5.61764 \$ 5.1245 \$ 5.17.439 \$ 5.17.439 \$ 5.8027 \$ 5.2007 \$ 5.8085 \$ 5.5000 \$ 5.1281 \$ 5.2000 \$ 5.1281 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ | 0.271068601 0.227206074 0.227206074 0.227206074 0.227206074 0.227206074 0.227206074 0.227206074 0.227206074 0. | action in medium term witch in medium term |
| 789 789 789 789 789 789 789 789 789 789 | Peul J Valabuski Communi | A Substructure S Shed S Shed | ASS Seprestructure 310 Seprestru | A0200 Basement Walls 11000 Roof Construction 11000 Roof Construction 11000 Roof Construction 10000 Roof Construction 10000 Estation Vividous 10000 Estation Vividous 10000 Estation Coors 10010 Roof Coverings 10000 Roof Coverings 10010 Roof Roof Coverings 10010 Roof Roof Roof Roof Roof Roof Roof Roo | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 | \$ 1.570 \$ 5.6161 \$ 5.406 \$ 5.0075 \$ 5.61761 \$ 5.406 \$ 5.0075 \$ 5.61764 \$ 5.17.435 \$ 5.17.435 \$ 5.17.435 \$ 5.17.435 \$ 5.209 \$ 5.209 \$ 5.209 \$ 5.209 \$ 5.209 \$ 5.209 \$ 5.209 \$ 5.2009 \$ 5 | 0.271068601 0.227206074 0.2272 | action in medium term witch in medium term |
| 78997999999999999999999999999999999999 | Paul J Valaduski Communi | A Substitution Since Si | AGS Superstructure 310 Extenter Enclosure 310 Extenter Enclosure 310 Extenter Enclosure 310 Extenter Enclosure 320 Extenter Construction CIO Interior Construction CIO Interior Construction CIO Stairs CIO Interior Entente CIO Interior Entente CIO Interior Entente CIO Interior Construction CIO Stairs CIO Interior Entente CIO Inte | A0200 Basement Walls 11000 Floor Construction 11000 Roof Construction 11000 Electric Windows 11000 Electric Windows 11000 Roof Coverings 110000 Roof Finishers 110000 College Finishers 110000 College Finishers 110000 College Finishers 110000 College Finishers 110000 Roof Roof Roof Roof Roof Roof Roof | | 1994 1994 1994 1994 1994 1994 1994 1994 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1,000 \$1 | 0.277068601 0.277068601 0.277068601 0.27206074 | and the medium term which is medium term |
| 78987790791919191919191919191919191919191919 | Peul J Valabuski Communi | A Substructure S Shed S Shed | ASS Superstouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 350 Septentsouchure 350 Septentsouchure 350 Septentsouchure 350 Rodring 350 Rod | A0200 Basement Walls 11000 Roof Construction 11000 Roof Construction 11000 Roof Construction 10000 Roof Construction 10000 Edestire Vividose 10000 Edestire Vividose 10000 Edestire Obors 10010 Roof Coverings 10000 Roof Coverings 10010 Roof Roof Coverings 10010 Roof Roof Roof Roof Roof Roof Roof Roo | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 | \$ 1.570 \$ 5.161 \$ 5.400 \$ 5.0075 \$ 5.6161 \$ 5.400 \$ 5.0075 \$ 5.61764 \$ 5.1748 \$ 5.1748 \$ 5.1748 \$ 5.827 \$ 5.24.077 \$ 5.9885 \$ 5.6.6699 \$ 5.1281 \$ 5.2009 \$ 5.1281 \$ 5.2009 \$ 5.1281 \$ 5.2000 \$ 5.1281 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 \$ 5.1186 \$ 5.2000 | 0.271068601 0.227308074 0.227308074 0.227308074 0.227308074 0.227308074 0.217308074 0.217308074 0.217308074 0.217308074 0.217308074 0.217308074 0.227308074 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.22814911 0.2281491 0.228 | action in medium term witch in medium term |
| 7898779977997997997997997997997997997997 | Peul J Valabuski Communi | A Substitution A Substitution B Shell C Interiors C In | ASS Superstructure 310 Extent Enclosure 310 Extent | A2020 Basement Walls 11000 Floor Construction 11000 Roof Construction 11000 Electric Windows 11000 Electric Windows 11000 Roof Coverings 11000 Roof Roof Roof Roof Roof Roof Roof R | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$1,000 \$1 | 0.277068601 | and it is medium term which is medium term |
| 789 87 799 799 799 799 799 799 799 799 7 | Paul J Valabaski Communi | A Substructure S Shed C Interiors C Int | ASS Superstouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 350 Septentsouchure 350 Septentsouchure 350 Septentsouchure 350 Rechting 350 Rech | A0200 Basement Walls 11000 Roof Construction 11000 Roof Construction 11000 Roof Construction 11000 Roof Construction 10000 Edestire Vividose 10000 Edestire Obors 10010 Edestire Vividoses 10010 Edestire Vividoses 10010 Edestire Obors 10010 Edestire Obors 10010 Partitions 10100 Edestire A Moving Walls 10100 Partitions 101000 Partitions 10100 Partitions 101000 Partitions 101000 Partitions 1 | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 | \$1.570 \$5.161 \$4.406 \$50,975 \$50,776 \$50,776 \$50,776 \$21,435 \$17,438 \$51,743 \$50,977 \$9,986 \$50,699 \$13,281 \$4,124 \$50,509 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,281 \$22,009 \$11,009 | 0.271068601 0.2272080074 0.2272080074 0.2272080074 0.2272080074 0.2272080074 0.227208074 0.227208074 0.210208074 0.210208074 0.210208074 0.210208074 0.227208074 0.22814011 0.22 | action in medium term witch in medium term |
| 789 97 790 790 790 790 790 790 790 790 790 | Peul J. Valdabuski Communi Peul J. Valdabuski Co | A Submid Shall Sha | ASS Seprentinchure 310 Esterior Enclosure 310 Esterior Enclosure 300 Rodring | A0200 Basement Walls B1000 Roof Construction B2000 Edention Worksow B2000 Edention Doors B3010 Roof Coverings B3000 Roof Coverings B3010 Roof Coverings C1010 Baser Caverings C1010 C1 | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 | \$1.570 \$5.161 \$4.400 \$50.975 \$58.784 \$21.435 \$77.435 \$8.277 \$24.077 | 0.271006601 0.22700674 0.22700674 0.22700674 0.22700674 0.22700674 0.22700674 0.22700674 0.22700674 0.22700674 0.22700674 0.27100674 | and the medium term which is medium term |
| 789 97 790 790 790 790 790 790 790 790 790 | Paul J Valabaski Communi | A Substructure S Shed C Interiors C Inte | ASS Superstouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 320 Septentsouchure 320 Septentsouchure 320 Septentsouchure 320 Septentsouchure 320 Rechting 330 Rechting 3 | A0200 Basement Walls 19100 Floor Controlucion 19100 Rod Construction 19100 Rod Construction 19100 Rod Construction 19200 Edestro Walls 19200 Edestro Walls 19200 Edestro Workows 19200 Edestro Coors 19301 Rod Coverings 19300 Rod | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 | \$ 1.570 \$ 5.6161 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.1016 \$ 5.400 \$ 5.1016 \$ 5.400 \$ 5.1006 \$ 5.009 \$ 5.1281 \$ 5.200 \$ 5.1281 \$ 5.200 \$ 5.1281 \$ 5.200 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.100666 \$ 5.100666 \$ 5.100666 \$ 5.1006666 \$ 5.10066666 \$ 5.1006666666666666666666666666666 | 0.271068601 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.22730677 0.2286161760 0.2286161760 0.2286161760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.23861760 | and the in medium term which is medium term |
| 789 97 790 790 790 790 790 790 790 790 790 | Paul J Valabaski Communi | A Submid Shall Sha | ASS Seprentinchure 310 Esterior Enclosure 310 Esterior Enclosure 300 Rodring | A0200 Basement Walls B1000 Roof Construction B2000 Edention Worksow B2000 Edention Doors B3010 Roof Coverings B3000 Roof Coverings B3010 Roof Coverings C1010 Baser Caverings C1010 C1 | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 | \$1.570 \$5.161 \$4.400 \$50.975 \$58.784 \$21.435 \$77.435 \$8.277 \$24.077 | 0.2717068601 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.2715026074 | and the medium term which is medium term |
| 78987 79097 79197 79297 79497 79597 79598 8000 8000 8000 8000 8000 8000 8000 | Peul J. Valdabuski Communi Peul J. Valdabuski Co | A Substructure S Shed C Interiors C Inte | ASS Superstouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 310 Septentsouchure 320 Septentsouchure 320 Septentsouchure 320 Septentsouchure 320 Septentsouchure 320 Rechting 330 Rechting 3 | A0200 Basement Walls 19100 Floor Controlucion 19100 Rod Construction 19100 Rod Construction 19100 Rod Construction 19200 Edestro Walls 19200 Edestro Walls 19200 Edestro Workows 19200 Edestro Coors 19301 Rod Coverings 19300 Rod | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 | \$ 1.570 \$ 5.6161 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.0075 \$ 5.61761 \$ 5.400 \$ 5.1016 \$ 5.400 \$ 5.1016 \$ 5.400 \$ 5.1006 \$ 5.009 \$ 5.1281 \$ 5.200 \$ 5.1281 \$ 5.200 \$ 5.1281 \$ 5.200 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.2000 \$ 5.11866 \$ 5.100666 \$ 5.100666 \$ 5.100666 \$ 5.1006666 \$ 5.10066666 \$ 5.1006666666666666666666666666666 | 0.271068601 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.22730677 0.2286161760 0.2286161760 0.2286161760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.22861760 0.23861760 | and/or in medium term witch is medium term |
| 78997 7907 7917 7927 7917 7927 794 7959 7959 7959 800 801 801 805 805 805 807 806 807 810 811 814 815 819 812 823 824 825 826 826 826 8333 8333 | Paul J Valabaski Communi Paul Valabaski Communi Paul Valabaski Communi Paul Valabaski Communi Pa | A Substance S Shed S Sh | ASS Seprentinchure 310 Seprentinchure 310 Seprentinchure 310 Seprentinchure 310 Seprentinchure 310 Seprentinchure 300 Sether Enclosure 300 Sether Enclosure 300 Sether Enclosure 300 Sether Construction CIO Bristor Frishes CIO Conveying DIO Conveying DIO Conveying DIO Conveying DIO Conveying DIO Purmiting CIO Pu | A0200 Basement Walls B1000 Roof Construction B2000 Edention Windows B2000 Edention Doors B3010 Roof Coverings B3000 Roof Construction B3010 Roof Coverings B3000 Roof Coverings B3010 Roof Coverings C1010 Baser Finishers C1010 Baser Finisher C1010 Baser Finisher C1010 Baser Finisher C1010 Baser Finisher C | | 1994 19 | 40 40 40 40 40 40 40 40 40 40 40 40 40 4 | \$ 1.570 \$ 1.57 | 0.2717068601 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.227306074 0.2715026074 | and the in medium term which is medium term which i |

| Fleet | | | | | | | 15.30137 | \$9,443,307 | | |
|----------|----------------|--|---|---|-------------------------------|-------------------|----------|------------------------------------|------------------|-----------------------------------|
| Index | Asset ID | Category | Department | Asset Descriptor 1 - Description | Asset Descriptor 2 - Location | Construction Year | Age | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
| 1 | EQ006 | Vehicles | Waste Disposal | 1990 Blue Ford Garbage Cab Ovr | Bark Lake Landfill | 1998 | 26 | \$287,500 | | planned for 2022 |
| 2 | EQ009 EQ011 | Vehicles Vehicles | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | 1978 Thompson Steamer 1996 Red Ford Tandem | Yard 1 Yard 2 | 1978 1996 | 46 | \$17,595 | 0.88 | replaced in 2021 for \$400k |
| 3 | EQ011 | Vehicles | Waste Disposal | 1990 John Deere Loader | Yard 2 | 2004 | 28 | \$248,576 | -0.12 0.20 | |
| | | | · · | **** | | | 20 | \$90,562 | 0.20 | / |
| 5 | EQ017 | Vehicles | TRANSPORTATION SERVICES | 1987 Thompson Steamer | Yard 2 | 1987 | 37 | \$17,595 | -0.48 | |
| 6 | EQ018 EQ020 | Vehicles Vehicles | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | ""Mor Bark 8" chipper" 1991 Red INTL Tandem/Plow | Yard 2 Yard 1 | 1986 1991 | 38 | \$42,065 | -0.76 | |
| - 8 | EQ020 | Vehicles | TRANSPORTATION SERVICES | 1995 Red INTL Single axie | Yard 2 | 1995 | 33 29 | \$207,654 \$207,654 | -0.56 | |
| 9 | EQ023 | Vehicles | TRANSPORTATION SERVICES | 1988 Champion Grader | Yard 1 | 1988 | 36 | \$207,65 4 \$277,417 | -0.16 | |
| 10 | EQ027 | Vehicles | TRANSPORTATION SERVICES | Gardner Denver Compressor | Yard 1 | 1990 | 34 | \$39,494 | -0.36 | |
| 11 | EQ031 | Vehicles | PROTECTION SERVICES | 1990 GMC Pumper Truck-9650 | South Fire Hall | 1990 | 34 | \$469,200 | -0.36 | |
| 12 | EQ036 | Vehicles | PROTECTION SERVICES | 1988 International Tanker-9727 | North Fire Hall | 1988 | 36 | \$164,024 | -0.44 | |
| 13 | EQ038 | Vehicles | PROTECTION SERVICES | 1994 Freightliner | South Fire Hall | 2001 | 23 | \$224,844 | 0.08 | |
| 14 | EQ039 | Vehicles | Waste Disposal | 1988 Catapillar Compactor | Bark Lake Landfill | 2002 | 22 | \$125,260 | 0.64 | |
| 15 16 | EQ040 EQ041 | Vehicles Vehicles | Waste Disposal TRANSPORTATION SERVICES | 1991 Ford Compactor Truck 2002 Ford F250 Diesel | Bark Lake Landfill Yard 1 | 2002 | 22 | \$44,329 | 0.08 | |
| 10 | EQ041 | Vehicles | TRANSPORTATION SERVICES | 2002 Ford F250 Diesei 2003 International Dump | Yard 1 | 2002 | 22 | \$71,196 \$305,900 | -0.40 | |
| 18 | EQ044 | Vehicles | TRANSPORTATION SERVICES | 1996 John Deere 650E Bulldozer | Yard 1 | 2004 | 22 | \$305,900 | 0.88 | Replaced EQ042 in 2020 fpr \$266k |
| 19 | EQ045 | Vehicles | PARKS/RECREATION | 2004 Landscape Trailer | Yard 1 | 2004 | 20 | \$5,750 | 0.20 | |
| 20 | EQ046 | Vehicles | TRANSPORTATION SERVICES | 2006 International Tandem | Yard 2 | 2005 | 19 | \$278,530 | 0.24 | |
| 21 | EQ047 | Vehicles | TRANSPORTATION SERVICES | 2006 John Deere Loader | Yard 1 | 2006 | 18 | \$203,931 | 0.28 | |
| 22 | EQ048 | Vehicles | Waste Disposal | 2006 Freightliner Compactor | Yard 1 | 2006 | 18 | \$330,909 | 0.14 | |
| 23 | EQ050 | Vehicles | TRANSPORTATION SERVICES | 2006 Chev 4x4 % Ton | Municipal Office | 2006 | 18 | \$76,245 | -0.56 | |
| 24 25 | EQ051 EQ052 | Vehicles Vehicles | TRANSPORTATION SERVICES PARKS/RECREATION | Trackless Sidewalk Plow Kubota lawnmower | Yard 1 Yard 1 | 2006 2001 | 18 | \$82,124 | -0.67 | |
| 26 | EQ052 | Vehicles | TRANSPORTATION SERVICES | 2007 Volvo Motor Grader | Yard 1 | 2007 | 23 | \$13,913 | 0.08 | |
| 27 | EQ055 | Vehicles | PARKS/RECREATION | Poulan riding Lawnmower | Yard 1 | 2007 | 17 | \$322,678 | 0.75 | |
| 28 | EQ057 | Vehicles | PROTECTION SERVICES | 2007 International Pumper | North Fire Hall | 2007 | 17 | \$5,750 \$412,197 | -0.20 | |
| 29 | EQ059 | Vehicles | TRANSPORTATION SERVICES | Ford Truck 4 x 4 | Office | 2007 | 17 | \$44,519 | -0.70 | |
| 30 | EQ060 | Vehicles | TRANSPORTATION SERVICES | Landini Tractor & Attachments | Yard 2 | 2007 | 17 | \$68,889 | 0.32 | |
| 31 | EQ061 | Vehicles | TRANSPORTATION SERVICES | Sterling Plow Truck | Yard 1 | 2008 | 16 | \$263,356 | 0.12 | |
| 32 | EQ062 | Vehicles | TRANSPORTATION SERVICES | 2008 Ford F150 4x4 Red | Yard 1 | 2008 | 16 | \$35,016 | -0.36 | |
| 33 | EQ063 EQ064 | Vehicles Vehicles | TRANSPORTATION SERVICES | 2008 Ford F150 4x4 Red 2000 Ford 4x2 Regular Cab145 | Yard 1 | 2008 | 16 | \$35,344 | -0.36 | |
| 34 | EQ065 | Vehicles | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | 2000 Ford 4x2 Regular Cab145 Boom Lift | Yard 1 | 2008 | 16 | \$29,474 | -0.60 | |
| 36 | EQ066 | Vehicles | TRANSPORTATION SERVICES | John Deere Backhoe | Yard 2 | 2009 | 15 | \$20,635 \$97,280 | 0.16 | |
| 37 | EQ067 | Vehicles | Waste Disposal | 2009 Peterbuilt Organic Truck | Yard 1 | 2009 | 15 | \$97,280 \$360,175 | 0.70 | |
| 38 | EQ085 | Vehicles | PROTECTION SERVICES | 1996 GMC Cube Van | South Fire Hall | 2009 | 15 | \$115,000 | 0.88 | |
| 39 | EQ069 | Vehicles | PROTECTION SERVICES | 2007 Chev Cube Van | North Fire Hall | 2011 | 13 | \$57,597 | -0.06 | |
| 40 | EQ070 | Vehicles | TRANSPORTATION SERVICES | 2012 International Tandem Red | Yard 1 | 2011 | 13 | \$276,860 | 0.48 | 3 |
| 41 | EQ072 | Vehicles | Waste Disposal | 2013 International 7400 Garbage Truck | Yard 1 | 2012 | 12 | \$231,017 | 0.44 | |
| 42 | EQ073 | Vehicles | PROTECTION SERVICES | 2012 International Pumper Red 2013 International DSL Single-Axie Plow | South Fire Hall | 2012 | 12 | \$398,376 | 0.52 | |
| 43 | EQ074 | Vehicles | TRANSPORTATION SERVICES | Truck 2015 International DSL Single-Axie Plow Truck | Yard 1 | 2013 | П | \$287,818 | 0.32 | |
| 44 | EQ076 | Vehicles | TRANSPORTATION SERVICES | Truck Red | Yard1 | 2014 | 10 | \$262,286 | 0.36 | |
| 45 | | Vehicles | TRANSPORTATION SERVICES | 2017 Ford F250 Red w/Plow | Yard1 | 2016 | 8 | \$50,598 | 0.68 | |
| 46 | | Vehicles | TRANSPORTATION SERVICES | 2017 JD Loader 544K-II | Yard1 | 2017 | 7 | \$234,341 | 0.72 | |
| 47 | EQ080 | Vehicles | TRANSPORTATION SERVICES | 2018 Freightliner w/Viking Plow 2018 Ford F150 Red SN | | 2018 | 6 | \$295,860 | 0.76 | 5 |
| 48 | EQ081 | Vehicles | TRANSPORTATION SERVICES | 1FTEW1E51JKF45614 | | 2018 | 6 | \$48,569 | 0.64 | |
| 49 | EQ082 | Vehicles | PROTECTION SERVICES | 2017 Tanker | | 2018 | 6 | \$311,461 | 0.76 | |
| 50 | EQ083 | Vehicles | TRANSPORTATION SERVICES | 2018 Ford Escape | | 2019 | 5 | \$32,185 | 0.74 | |
| 51 52 | MAC10 MAC71 | Machinery & Equipment | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | Plastic Water Tank for Tandem Truck | Yard 1 Yard 1 | 2009 2011 | 15 | \$22,054 | 0.40 | |
| 52 | MAC/1 | Machinery & Equipment | TRANSPORTATION SERVICES | Towmaster Tag-a-long Trailer Compactor attachment for Volvo Grader | Yard 1 | 2011 | 13 | \$39,440 | 0.48 | 3 |
| 53 54 | MAC72 MAC74 | Machinery & Equipment Machinery & Equipment | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | #EQ053 Snow Wing for Backhoe EQ066 | Yard 1 | 2012 2014 | 12 | \$34,646 \$22,892 | 0.52 | |
| 55 | | Machinery & Equipment | TRANSPORTATION SERVICES | Wacker RD12 1Ton Roller | Yard 1 | 2013 | 11 | \$20,567 | 0.56 | |
| 56 | MAC76 | Machinery & Equipment | TRANSPORTATION SERVICES | Thompson Steamer w/ 100' hose | Yard 1 | 2018 | 6 | \$20,567 | 0.36 | |
| 57 | MAC77 | Machinery & Equipment | TRANSPORTATION SERVICES | AMI Snow Plow Valve | Yard 1 | 2019 | 5 | \$15,461 | 0.80 | |
| 58 | MAC78 | Machinery & Equipment | TRANSPORTATION SERVICES | Sander | Yard 1 | 2019 | 5 | \$9,191 | 0.80 | |
| 59 | MAC37 | Vehicles | PARKS/RECREATION | Olympia Ice Resurfacer | PYJCC | 2021 | 3 | \$24,150 | 0.88 | |
| 60 | MAC87 | Vehicles | TRANSPORTATION SERVICES | 5 Ton Dump Trailer | Yard 2 | 2020 | 4 | \$12,075 | | Bought new in 2020 |
| 61 | TBD 1 EQ086 | Vehicles | PARKS/RECREATION PARKS/RECREATION | PJYCC Floor Scrubber | | 2021 | 3 | \$10,925 | | Bought new in 2021 |
| 62 | EQ086 | Vehicles | PARKS/RECREATION | Lubota side-by-side | 1 | 2020 | 4 | \$25,300 | 0.88 | Bought new in 2020 |

| Parks | | | | 17.357 | \$1,168,924 | | |
|-------|-------------------------------------|---|-------------------|--------|-----------------------|------------------|---|
| Index | Asset Descriptor I - Description | Asset Descriptor 2 - Location | Construction Year | Age | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
| ı | Playground Equipment | Mill St., Combermere | 2007 | 17 | \$138,000 | -0.17 | park equipment needs replacement |
| 2 | Boat Launch & Wharf Lake Kamineskeg | Island Lane | 1997 | 27 | \$131,141 | 0.95 | \$24k upgrade in 2022 |
| 3 | Public Boat Launch | 39249 Combermere Rd | 1998 | 26 | \$131,141 | 0.83 | paved parking lot in 2020 for \$20k |
| 4 | Life Size Stuatue-Zurakowski park | Opeongo Line | 2006 | 18 | \$23,460 | 0.02 | |
| 5 | I.4 scale model Avro Arrow | Opeongo Line | 2006 | 18 | \$93,840 | 0.04 | |
| 6 | Parking lot | Old Barry's Bay Rd (crooked slide park) | 2006 | 18 | \$11,500 | 0.33 | |
| 7 | Playground Equipment | Lakeshore Park (Lions Park) | 2008 | 16 | \$138,000 | -0.16 | park equipment needs replacement |
| 8 | Tennis Court | Lakeshore Park (Lions Park) | 2017 | | \$172,500 | 0.67 | resurfaced tennis court in 2017 |
| 9 | General | Public Realm | 2013 | - 1 | \$57,500 | 0.48 | |
| 10 | Ballfield - Lighting & Bleachers | PJYCC - Murray Memorial Park | 1984 | 40 | \$131,141 | 0.82 | redone in 2021 |
| П | Rink Lighting | Farmer Rd - CO Rink | 1984 | 40 | \$34,500 | 0.33 | |
| 12 | Changeroom | Wadsworth Beach | 2021 | - 1 | \$9,200 | 0.82 | new in 2021 |
| 13 | Dock Fingers | 39249 Combermere Rd | 2023 | | \$57,000 | 1.00 | new in 2023 for \$57k |
| 14 | Retaining Wall | Lakeshore Park (Lions Park) | 2023 | | \$40,000 | 1.00 | retainign wall and draininge improvements in 2023 for \$341 |

| Transportation | 20.88235 | \$1,254,665 |
|----------------|----------|-------------|
|----------------|----------|-------------|

| | poi aacio | /!! | | | 20.00233 \$1,254,003 | | | | |
|------|-----------|---|--|----------|----------------------|------|-----------------------|--------------------|----------------------------------|
| | | | | | Construction | | | 2024 Performanc | |
| ndex | Asset ID | Asset Descriptor I - Description | Asset Descriptor 2 - Type | Quantity | | Age | 2024 Replacement Cost | | 2024 Performance Score Rationale |
| | I TI | Paved Walking Trail | Omanique Beach-Lakeshore Drive | 120 | 2008 | 16 | \$11,985 | 0.63 | |
| | 2 T2 | Paved Walking Trail | Omanique Beach-Lakeshore Drive | 142 | 2008 | 16 | \$14,234 | 0.58 | |
| | 3 T3 | Paugh Lake Boat Launch/Public Beach Docks | Paugh Lake/ Lakeshore Drive/ Mayflower Beach | \$1.00 | 2009 | 15 | \$20,125 | 0.53 | |
| | 4 T4 | Madawaska Valley Entrance Signs - Welcome | | I | 2015 | 9 | \$19,110 | 0.64 | |
| | 5 T5 | sidewalks | Throughout Municipality | 500 | 1985 | 39 | \$57,500 | -0.05 | Sidewalks are in poor condition |
| - | 5 T6 | sidewalks | Throughout Municipality | 500 | 1985 | 39 | \$57,500 | -0.05 | Sidewalks are in poor condition |
| | 7 T7 | sidewalks | Throughout Municipality | 500 | 1985 | 39 | \$57,500 | -0.05 | Sidewalks are in poor condition |
| - 1 | 8 T8 | sidewalks | Throughout Municipality | 454 | 1985 | 39 | \$52,210 | -0.05 | Sidewalks are in poor condition |
| | 9 T9 | sidewalks | Paugh Lake Rd - 750ft from Kelly to Philip Streets | 155 | 2012 | 12 | \$18,229 | 0.74 | |
| 10 | T10 | sidewalks | Inglis, Connecting Link, Bay St, Kelly St, CR62 | 202 | 2013 | - 11 | \$23,685 | 0.75 | |
| - 1 | TH | sidewalks | Dunn St and Stafford St | 335 | 2014 | 10 | \$39,328 | 0.77 | |
| 13 | 2 T12 | sidewalks | Peter Street & Peter Street North | 313 | 2015 | 9 | \$36,723 | 0.77 | |
| 13 | 3 T13 | Streetlights | | 358 | 1986 | 38 | \$726,066 | 0.65 | |
| ŀ | 4 T14 | Public Parking Lot #I | | ı | 2002 | 22 | \$25,157 | 0.53 | |
| 13 | T15 | Public Parking Lot #2 | | ı | 2002 | 22 | \$25,157 | 0.50 | |
| 10 | 5 T16 | Public Parking Lot #3 | | - 1 | 2007 | 17 | \$25,157 | 0.33 | |
| 13 | 7 T17 | Digital Sign - LED | Arena Rd | - 1 | 2022 | 2 | \$45,000 | 0.95 | New in 2022 for \$43k |

Waste Disposal 22.1429 \$468,731

| Index | Asset ID | Asset Descriptor I - Description | Asset Descriptor 2 - Type | Quantity | Construction Year | Age | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
|-------|----------|----------------------------------|---------------------------|----------|-------------------|-----|-----------------------|------------------|--------------------------------------|
| - 1 | WI | Public Realm Equipment | Waste Disposal Containers | 27 units | 2008 | 16 | \$129,030 | 0.15 | |
| 2 | W2 | Landfill Equipment | Large Containers | 32 units | 2014 | 10 | \$70,380 | 0.57 | |
| 3 | W3 | Landfill Equipment | Steel Cover Plates | 6 units | 2016 | 8 | \$70,380 | 0.90 | \$28k on covers at Bark Lake in 2021 |
| 4 | W4 | Wilno Site | Hwy 60 | | 1995 | 29 | \$49,735 | -0.01 | |
| 5 | W5 | Radcliffe Site | | | 2000 | 24 | \$49,735 | -0.03 | |
| 6 | W6 | Bark Lake Site | 17961 Hwy 60 | | 2000 | 24 | \$49,735 | 0.52 | |
| 7 | W7 | Paugh lake Site | Wilowski Drive-Paugh Lk | | 1980 | 44 | \$49,735 | 0.29 | |

| Fire | | | | | 7.083333 | \$294,070 | 1 | |
|-------|----------|----------------------------------|-------------------------------|----------------------|----------|-----------------------------|------------------|--|
| Index | Asset ID | Asset Descriptor I - Description | Asset Descriptor 2 - Location | Construction Year | | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
| | I FI | Misc Equipment | South Hall | 2010 | 14 | \$50,000 | -0.40 | |
| | 2 F2 | Misc Equipment | North Hall | 2023 | I | \$50,000 | 1.00 | \$21k on new pumps and hoses in 2023 |
| | 3 F3 | Extracation Equipment | South Hall | 2011 | 13 | \$58,650 | 0.40 | |
| | 4 F4 | Extracation Equipment | North Hall | 2023 | I | \$58,650 | 1.00 | \$29k on new extracation equipment in 2023 |
| | 5 F5 | Communication Equipment | South Hall | 2014 | 10 | \$4,106 | 0.00 | |
| | 6 F6 | Communication Equipment | North Hall | 2014 | 10 | \$4,106 | 0.00 | |
| | 7 F7 | Turnout (Bunker) Gear | South Hall | 2022 | 2 | \$14,076 | 0.80 | \$5k on new bunker suits in 2022 |
| - 1 | 8 F8 | Turnout (Bunker) Gear | North Hall | 2017 | 7 | \$14,076 | 0.30 | |
| | 9 F9 | Uniform | South Hall | 2016 | 8 | \$8,211 | 0.20 | |
| 10 | FI0 | Uniform | North Hall | 2016 | 8 | \$8,211 | 0.20 | |
| - 1 | FII | Oxygen tanks | North Hall | 2018 | 6 | \$8,879 | 0.40 | |
| 10 | 2 F12 | Oxygen tanks | South Hall | 2019 | 5 | \$15,105 | 0.50 | |

IT 9.55556 \$161,559

| Department | Asset Descriptor I - Description | Asset Descriptor 2 - Type | Construction Ye | Age | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
|--------------------|--|---|---|--|---|----------------------------------|--|
| General Government | Software | MS Office | 2010 | 12 | \$10,410 | -0.40 | Need to move to O365 but internet (cloud service) is not good enough |
| General Government | Hardware | Postage Meter | 2008 | 14 | \$9,384 | 0.40 | |
| General Government | Hardware | Server | 2011 | - 11 | \$21,849 | 0.38 | |
| General Government | Hardware | Copier/Printer | 2010 | 12 | \$11,611 | -0.33 | |
| General Government | Hardware | Misc Peripherals | 2012 | 10 | \$19,088 | -0.20 | |
| General Government | Hardware | Telephone | 2019 | 3 | \$10,171 | 0.50 | |
| Library | Hardware | | 2011 | - 11 | \$14,968 | -0.30 | |
| Library | Software | | 2010 | 12 | \$17,159 | -0.40 | |
| General Government | Software | Financial | 2021 | - 1 | \$46,920 | 0.70 | \$42k on new financial software in 2020/2021 |
| | General Government Library Library | General Government Software General Government Hardware Ubrary Hardware Ubrary Software | General Government Software MS Office General Government Hardware Postage Meter General Government Hardware Server General Government Hardware Copier/Printer General Government Hardware Misc Peripherals General Government Hardware Telephone Ubbrary Software | General Government Software MS Office 2010 General Government Hardware Postage Meter 2008 General Government Hardware Server 2011 General Government Hardware Copier/Printer 2010 General Government Hardware Misc Peripherals 2012 General Government Hardware Telephone 2019 Library Hardware 2011 Library Software 2010 | General Government Software MS Office 2010 12 General Government Hardware Postage Meter 2008 14 General Government Hardware Server 2011 11 General Government Hardware Copier/Printer 2010 12 General Government Hardware Misc Peripherals 2012 10 General Government Hardware Telephone 2019 3 Library Hardware 2010 11 Library Software 2010 12 | MS Office 2010 12 \$10,410 | MS Office 2010 12 \$10,410 -0.40 |

| Fleet | | | | | | | 15.30137 | \$9,443,307 | | |
|----------|----------------|--|---|---|-------------------------------|-------------------|----------|------------------------------------|------------------|-----------------------------------|
| Index | Asset ID | Category | Department | Asset Descriptor 1 - Description | Asset Descriptor 2 - Location | Construction Year | Age | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
| 1 | EQ006 | Vehicles | Waste Disposal | 1990 Blue Ford Garbage Cab Ovr | Bark Lake Landfill | 1998 | 26 | \$287,500 | | planned for 2022 |
| 2 | EQ009 EQ011 | Vehicles Vehicles | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | 1978 Thompson Steamer 1996 Red Ford Tandem | Yard 1 Yard 2 | 1978 1996 | 46 | \$17,595 | 0.88 | replaced in 2021 for \$400k |
| 3 | EQ011 | Vehicles | Waste Disposal | 1990 John Deere Loader | Yard 2 | 2004 | 28 | \$248,576 | -0.12 0.20 | |
| | | | · · | **** | | | 20 | \$90,562 | 0.20 | / |
| 5 | EQ017 | Vehicles | TRANSPORTATION SERVICES | 1987 Thompson Steamer | Yard 2 | 1987 | 37 | \$17,595 | -0.48 | |
| 6 | EQ018 EQ020 | Vehicles Vehicles | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | ""Mor Bark 8" chipper" 1991 Red INTL Tandem/Plow | Yard 2 Yard 1 | 1986 1991 | 38 | \$42,065 | -0.76 | |
| - 8 | EQ020 | Vehicles | TRANSPORTATION SERVICES | 1995 Red INTL Single axie | Yard 2 | 1995 | 33 29 | \$207,654 \$207,654 | -0.56 | |
| 9 | EQ023 | Vehicles | TRANSPORTATION SERVICES | 1988 Champion Grader | Yard 1 | 1988 | 36 | \$207,65 4 \$277,417 | -0.16 | |
| 10 | EQ027 | Vehicles | TRANSPORTATION SERVICES | Gardner Denver Compressor | Yard 1 | 1990 | 34 | \$39,494 | -0.36 | |
| 11 | EQ031 | Vehicles | PROTECTION SERVICES | 1990 GMC Pumper Truck-9650 | South Fire Hall | 1990 | 34 | \$469,200 | -0.36 | |
| 12 | EQ036 | Vehicles | PROTECTION SERVICES | 1988 International Tanker-9727 | North Fire Hall | 1988 | 36 | \$164,024 | -0.44 | |
| 13 | EQ038 | Vehicles | PROTECTION SERVICES | 1994 Freightliner | South Fire Hall | 2001 | 23 | \$224,844 | 0.08 | |
| 14 | EQ039 | Vehicles | Waste Disposal | 1988 Catapillar Compactor | Bark Lake Landfill | 2002 | 22 | \$125,260 | 0.64 | |
| 15 16 | EQ040 EQ041 | Vehicles Vehicles | Waste Disposal TRANSPORTATION SERVICES | 1991 Ford Compactor Truck 2002 Ford F250 Diesel | Bark Lake Landfill Yard 1 | 2002 | 22 | \$44,329 | 0.08 | |
| 10 | EQ041 | Vehicles | TRANSPORTATION SERVICES | 2002 Ford F250 Diesei 2003 International Dump | Yard 1 | 2002 | 22 | \$71,196 \$305,900 | -0.40 | |
| 18 | EQ044 | Vehicles | TRANSPORTATION SERVICES | 1996 John Deere 650E Bulldozer | Yard 1 | 2004 | 22 | \$305,900 | 0.88 | Replaced EQ042 in 2020 fpr \$266k |
| 19 | EQ045 | Vehicles | PARKS/RECREATION | 2004 Landscape Trailer | Yard 1 | 2004 | 20 | \$5,750 | 0.20 | |
| 20 | EQ046 | Vehicles | TRANSPORTATION SERVICES | 2006 International Tandem | Yard 2 | 2005 | 19 | \$278,530 | 0.24 | |
| 21 | EQ047 | Vehicles | TRANSPORTATION SERVICES | 2006 John Deere Loader | Yard 1 | 2006 | 18 | \$203,931 | 0.28 | |
| 22 | EQ048 | Vehicles | Waste Disposal | 2006 Freightliner Compactor | Yard 1 | 2006 | 18 | \$330,909 | 0.14 | |
| 23 | EQ050 | Vehicles | TRANSPORTATION SERVICES | 2006 Chev 4x4 % Ton | Municipal Office | 2006 | 18 | \$76,245 | -0.56 | |
| 24 25 | EQ051 EQ052 | Vehicles Vehicles | TRANSPORTATION SERVICES PARKS/RECREATION | Trackless Sidewalk Plow Kubota lawnmower | Yard 1 Yard 1 | 2006 2001 | 18 | \$82,124 | -0.67 | |
| 26 | EQ052 | Vehicles | TRANSPORTATION SERVICES | 2007 Volvo Motor Grader | Yard 1 | 2007 | 23 | \$13,913 | 0.08 | |
| 27 | EQ055 | Vehicles | PARKS/RECREATION | Poulan riding Lawnmower | Yard 1 | 2007 | 17 | \$322,678 | 0.75 | |
| 28 | EQ057 | Vehicles | PROTECTION SERVICES | 2007 International Pumper | North Fire Hall | 2007 | 17 | \$5,750 \$412,197 | -0.20 | |
| 29 | EQ059 | Vehicles | TRANSPORTATION SERVICES | Ford Truck 4 x 4 | Office | 2007 | 17 | \$44,519 | -0.70 | |
| 30 | EQ060 | Vehicles | TRANSPORTATION SERVICES | Landini Tractor & Attachments | Yard 2 | 2007 | 17 | \$68,889 | 0.32 | |
| 31 | EQ061 | Vehicles | TRANSPORTATION SERVICES | Sterling Plow Truck | Yard 1 | 2008 | 16 | \$263,356 | 0.12 | |
| 32 | EQ062 | Vehicles | TRANSPORTATION SERVICES | 2008 Ford F150 4x4 Red | Yard 1 | 2008 | 16 | \$35,016 | -0.36 | |
| 33 | EQ063 EQ064 | Vehicles Vehicles | TRANSPORTATION SERVICES | 2008 Ford F150 4x4 Red 2000 Ford 4x2 Regular Cab145 | Yard 1 | 2008 | 16 | \$35,344 | -0.36 | |
| 34 | EQ065 | Vehicles | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | 2000 Ford 4x2 Regular Cab145 | Yard 1 | 2008 | 16 | \$29,474 | -0.60 | |
| 36 | EQ066 | Vehicles | TRANSPORTATION SERVICES | John Deere Backhoe | Yard 2 | 2009 | 15 | \$20,635 \$97,280 | 0.16 | |
| 37 | EQ067 | Vehicles | Waste Disposal | 2009 Peterbuilt Organic Truck | Yard 1 | 2009 | 15 | \$97,280 \$360,175 | 0.70 | |
| 38 | EQ085 | Vehicles | PROTECTION SERVICES | 1996 GMC Cube Van | South Fire Hall | 2009 | 15 | \$115,000 | 0.88 | |
| 39 | EQ069 | Vehicles | PROTECTION SERVICES | 2007 Chev Cube Van | North Fire Hall | 2011 | 13 | \$57,597 | -0.06 | |
| 40 | EQ070 | Vehicles | TRANSPORTATION SERVICES | 2012 International Tandem Red | Yard 1 | 2011 | 13 | \$276,860 | 0.48 | 3 |
| 41 | EQ072 | Vehicles | Waste Disposal | 2013 International 7400 Garbage Truck | Yard 1 | 2012 | 12 | \$231,017 | 0.44 | |
| 42 | EQ073 | Vehicles | PROTECTION SERVICES | 2012 International Pumper Red 2013 International DSL Single-Axie Plow | South Fire Hall | 2012 | 12 | \$398,376 | 0.52 | |
| 43 | EQ074 | Vehicles | TRANSPORTATION SERVICES | Truck 2015 International DSL Single-Axie Plow Truck | Yard 1 | 2013 | П | \$287,818 | 0.32 | |
| 44 | EQ076 | Vehicles | TRANSPORTATION SERVICES | Truck Red | Yard1 | 2014 | 10 | \$262,286 | 0.36 | |
| 45 | | Vehicles | TRANSPORTATION SERVICES | 2017 Ford F250 Red w/Plow | Yard1 | 2016 | 8 | \$50,598 | 0.68 | |
| 46 | | Vehicles | TRANSPORTATION SERVICES | 2017 JD Loader 544K-II | Yard1 | 2017 | 7 | \$234,341 | 0.72 | |
| 47 | EQ080 | Vehicles | TRANSPORTATION SERVICES | 2018 Freightliner w/Viking Plow 2018 Ford F150 Red SN | | 2018 | 6 | \$295,860 | 0.76 | 5 |
| 48 | EQ081 | Vehicles | TRANSPORTATION SERVICES | 1FTEW1E51JKF45614 | | 2018 | 6 | \$48,569 | 0.64 | |
| 49 | EQ082 | Vehicles | PROTECTION SERVICES | 2017 Tanker | | 2018 | 6 | \$311,461 | 0.76 | |
| 50 | EQ083 | Vehicles | TRANSPORTATION SERVICES | 2018 Ford Escape | | 2019 | 5 | \$32,185 | 0.74 | |
| 51 52 | MAC10 MAC71 | Machinery & Equipment | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | Plastic Water Tank for Tandem Truck | Yard 1 Yard 1 | 2009 2011 | 15 | \$22,054 | 0.40 | |
| 52 | MAC/1 | Machinery & Equipment | TRANSPORTATION SERVICES | Towmaster Tag-a-long Trailer Compactor attachment for Volvo Grader | Yard 1 | 2011 | 13 | \$39,440 | 0.48 | 3 |
| 53 54 | MAC72 MAC74 | Machinery & Equipment Machinery & Equipment | TRANSPORTATION SERVICES TRANSPORTATION SERVICES | #EQ053 Snow Wing for Backhoe EQ066 | Yard 1 | 2012 2014 | 12 | \$34,646 \$22,892 | 0.52 | |
| 55 | | Machinery & Equipment | TRANSPORTATION SERVICES | Wacker RD12 1Ton Roller | Yard 1 | 2013 | 11 | \$20,567 | 0.56 | |
| 56 | MAC76 | Machinery & Equipment | TRANSPORTATION SERVICES | Thompson Steamer w/ 100' hose | Yard 1 | 2018 | 6 | \$20,567 | 0.36 | |
| 57 | MAC77 | Machinery & Equipment | TRANSPORTATION SERVICES | AMI Snow Plow Valve | Yard 1 | 2019 | 5 | \$15,461 | 0.80 | |
| 58 | MAC78 | Machinery & Equipment | TRANSPORTATION SERVICES | Sander | Yard 1 | 2019 | 5 | \$9,191 | 0.80 | |
| 59 | MAC37 | Vehicles | PARKS/RECREATION | Olympia Ice Resurfacer | PYJCC | 2021 | 3 | \$24,150 | 0.88 | |
| 60 | MAC87 | Vehicles | TRANSPORTATION SERVICES | 5 Ton Dump Trailer | Yard 2 | 2020 | 4 | \$12,075 | | Bought new in 2020 |
| 61 | TBD 1 EQ086 | Vehicles | PARKS/RECREATION PARKS/RECREATION | PJYCC Floor Scrubber | | 2021 | 3 | \$10,925 | | Bought new in 2021 |
| 62 | EQ086 | Vehicles | PARKS/RECREATION | Lubota side-by-side | 1 | 2020 | 4 | \$25,300 | 0.88 | Bought new in 2020 |

| Transportation | 20.88235 | \$1,254,665 |
|----------------|----------|-------------|
|----------------|----------|-------------|

| | poi aacio | /!! | | | 20.00233 \$1,254,003 | | | | |
|------|-----------|---|--|----------|----------------------|------|-----------------------|--------------------|----------------------------------|
| | | | | | Construction | | | 2024 Performanc | |
| ndex | Asset ID | Asset Descriptor I - Description | Asset Descriptor 2 - Type | Quantity | | Age | 2024 Replacement Cost | | 2024 Performance Score Rationale |
| | I TI | Paved Walking Trail | Omanique Beach-Lakeshore Drive | 120 | 2008 | 16 | \$11,985 | 0.63 | |
| | 2 T2 | Paved Walking Trail | Omanique Beach-Lakeshore Drive | 142 | 2008 | 16 | \$14,234 | 0.58 | |
| | 3 T3 | Paugh Lake Boat Launch/Public Beach Docks | Paugh Lake/ Lakeshore Drive/ Mayflower Beach | \$1.00 | 2009 | 15 | \$20,125 | 0.53 | |
| | 4 T4 | Madawaska Valley Entrance Signs - Welcome | | I | 2015 | 9 | \$19,110 | 0.64 | |
| | 5 T5 | sidewalks | Throughout Municipality | 500 | 1985 | 39 | \$57,500 | -0.05 | Sidewalks are in poor condition |
| - | 5 T6 | sidewalks | Throughout Municipality | 500 | 1985 | 39 | \$57,500 | -0.05 | Sidewalks are in poor condition |
| | 7 T7 | sidewalks | Throughout Municipality | 500 | 1985 | 39 | \$57,500 | -0.05 | Sidewalks are in poor condition |
| - 1 | 8 T8 | sidewalks | Throughout Municipality | 454 | 1985 | 39 | \$52,210 | -0.05 | Sidewalks are in poor condition |
| | 9 T9 | sidewalks | Paugh Lake Rd - 750ft from Kelly to Philip Streets | 155 | 2012 | 12 | \$18,229 | 0.74 | |
| 10 | T10 | sidewalks | Inglis, Connecting Link, Bay St, Kelly St, CR62 | 202 | 2013 | - 11 | \$23,685 | 0.75 | |
| - 1 | TH | sidewalks | Dunn St and Stafford St | 335 | 2014 | 10 | \$39,328 | 0.77 | |
| 13 | 2 T12 | sidewalks | Peter Street & Peter Street North | 313 | 2015 | 9 | \$36,723 | 0.77 | |
| 13 | 3 T13 | Streetlights | | 358 | 1986 | 38 | \$726,066 | 0.65 | |
| ŀ | 4 T14 | Public Parking Lot #I | | ı | 2002 | 22 | \$25,157 | 0.53 | |
| 13 | T15 | Public Parking Lot #2 | | ı | 2002 | 22 | \$25,157 | 0.50 | |
| 10 | 5 T16 | Public Parking Lot #3 | | - 1 | 2007 | 17 | \$25,157 | 0.33 | |
| 13 | 7 T17 | Digital Sign - LED | Arena Rd | - 1 | 2022 | 2 | \$45,000 | 0.95 | New in 2022 for \$43k |

Waste Disposal 22.1429 \$468,731

| Index | Asset ID | Asset Descriptor I - Description | Asset Descriptor 2 - Type | Quantity | Construction Year | Age | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
|-------|----------|----------------------------------|---------------------------|----------|-------------------|-----|-----------------------|------------------|--------------------------------------|
| - 1 | WI | Public Realm Equipment | Waste Disposal Containers | 27 units | 2008 | 16 | \$129,030 | 0.15 | |
| 2 | W2 | Landfill Equipment | Large Containers | 32 units | 2014 | 10 | \$70,380 | 0.57 | |
| 3 | W3 | Landfill Equipment | Steel Cover Plates | 6 units | 2016 | 8 | \$70,380 | 0.90 | \$28k on covers at Bark Lake in 2021 |
| 4 | W4 | Wilno Site | Hwy 60 | | 1995 | 29 | \$49,735 | -0.01 | |
| 5 | W5 | Radcliffe Site | | | 2000 | 24 | \$49,735 | -0.03 | |
| 6 | W6 | Bark Lake Site | 17961 Hwy 60 | | 2000 | 24 | \$49,735 | 0.52 | |
| 7 | W7 | Paugh lake Site | Wilowski Drive-Paugh Lk | | 1980 | 44 | \$49,735 | 0.29 | |

| Fire | | | | | 7.083333 | \$294,070 | 1 | |
|-------|----------|----------------------------------|-------------------------------|----------------------|----------|-----------------------------|------------------|--|
| Index | Asset ID | Asset Descriptor I - Description | Asset Descriptor 2 - Location | Construction Year | | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
| | I FI | Misc Equipment | South Hall | 2010 | 14 | \$50,000 | -0.40 | |
| | 2 F2 | Misc Equipment | North Hall | 2023 | I | \$50,000 | 1.00 | \$21k on new pumps and hoses in 2023 |
| | 3 F3 | Extracation Equipment | South Hall | 2011 | 13 | \$58,650 | 0.40 | |
| | 4 F4 | Extracation Equipment | North Hall | 2023 | I | \$58,650 | 1.00 | \$29k on new extracation equipment in 2023 |
| | 5 F5 | Communication Equipment | South Hall | 2014 | 10 | \$4,106 | 0.00 | |
| | 6 F6 | Communication Equipment | North Hall | 2014 | 10 | \$4,106 | 0.00 | |
| | 7 F7 | Turnout (Bunker) Gear | South Hall | 2022 | 2 | \$14,076 | 0.80 | \$5k on new bunker suits in 2022 |
| - 1 | 8 F8 | Turnout (Bunker) Gear | North Hall | 2017 | 7 | \$14,076 | 0.30 | |
| | 9 F9 | Uniform | South Hall | 2016 | 8 | \$8,211 | 0.20 | |
| 10 | FI0 | Uniform | North Hall | 2016 | 8 | \$8,211 | 0.20 | |
| - 1 | FII | Oxygen tanks | North Hall | 2018 | 6 | \$8,879 | 0.40 | |
| 10 | 2 F12 | Oxygen tanks | South Hall | 2019 | 5 | \$15,105 | 0.50 | |

IT 9.55556 \$161,559

| Department | Asset Descriptor I - Description | Asset Descriptor 2 - Type | Construction Ye | Age | 2024 Replacement Cost | 2024 Performance | 2024 Performance Score Rationale |
|--------------------|--|---|---|--|---|----------------------------------|--|
| General Government | Software | MS Office | 2010 | 12 | \$10,410 | -0.40 | Need to move to O365 but internet (cloud service) is not good enough |
| General Government | Hardware | Postage Meter | 2008 | 14 | \$9,384 | 0.40 | |
| General Government | Hardware | Server | 2011 | - 11 | \$21,849 | 0.38 | |
| General Government | Hardware | Copier/Printer | 2010 | 12 | \$11,611 | -0.33 | |
| General Government | Hardware | Misc Peripherals | 2012 | 10 | \$19,088 | -0.20 | |
| General Government | Hardware | Telephone | 2019 | 3 | \$10,171 | 0.50 | |
| Library | Hardware | | 2011 | - 11 | \$14,968 | -0.30 | |
| Library | Software | | 2010 | 12 | \$17,159 | -0.40 | |
| General Government | Software | Financial | 2021 | - 1 | \$46,920 | 0.70 | \$42k on new financial software in 2020/2021 |
| | General Government Library Library | General Government Software General Government Hardware Ubrary Hardware Ubrary Software | General Government Software MS Office General Government Hardware Postage Meter General Government Hardware Server General Government Hardware Copier/Printer General Government Hardware Misc Peripherals General Government Hardware Telephone Ubbrary Software | General Government Software MS Office 2010 General Government Hardware Postage Meter 2008 General Government Hardware Server 2011 General Government Hardware Copier/Printer 2010 General Government Hardware Misc Peripherals 2012 General Government Hardware Telephone 2019 Library Hardware 2011 Library Software 2010 | General Government Software MS Office 2010 12 General Government Hardware Postage Meter 2008 14 General Government Hardware Server 2011 11 General Government Hardware Copier/Printer 2010 12 General Government Hardware Misc Peripherals 2012 10 General Government Hardware Telephone 2019 3 Library Hardware 2010 11 Library Software 2010 12 | MS Office 2010 12 \$10,410 | MS Office 2010 12 \$10,410 -0.40 |



Appendix C – Planned Program

| Asset Class | Asset ID | Road | From To | Treatment Description | Forecast Cost (\$) | Forecast Year |
|----------------|------------|--|--|-------------------------------|------------------------|------------------|
| Roads | 70 | Hopefield Road | Dombroskie Rd-Kuiack Lake Rd | Rehabilitation | 452,357.98 | 2024 |
| Roads | 177 | Stafford Street | Inglis Street to Opeongo Line | Maintenance | 6,091.74 | 2024 |
| Roads | 192 | Inglis Street | Stafford to Dunn St | Rehabilitation | 32,714.82 | 2024 |
| Roads | 193 | Inglis Street | Dunn St. to End | Maintenance | 8,269.24 | 2024 |
| Roads | 194 | Sherwood Drive | Hwy 60-to-911-26 End | Maintenance | 446.66 | 2024 |
| | | | | | | |
| Roads Roads | 11 143 | Hopefield Road Rock Lane | Old Barry's Bay Rd-Dombroskie Rd 911-1 end-to-911-20 End | Reconstruction Maintenance | 426,577.87 8,963.18 | 2025 2025 |
| Roads | 155 | Dawson Street | Inglis Street-to-911-21 End | Maintenance | 2,510.78 | 2025 |
| Roads | 157 | Karol Woytyla Street | Bay Street-to-Dunn Street | Maintenance | 12,237.59 | 2025 |
| Roads | 164 | St. Francis Memorial Dr | Siberia Road-to-911-52 End | Maintenance | 10,223.75 | 2025 |
| Roads | 169 | Borutski Street | Wilno South Road-to-Burchat Street 911-30 | Maintenance | 3,251.73 | 2025 |
| Roads | 171 | Curtiss Road | Sunny Hill Rd to 91109 | Maintenance | 307.06 | 2025 |
| Roads | 176 | Philip Street | Paugh Lake Road-to-911-41 | Maintenance | 3,672.76 | 2025 |
| Roads | 180 | Opeongo Square | Opeongo Line-to-Stafford Street | Maintenance | 4,129.25 | 2025 |
| Roads | 182 | Third Street | Paugh Lake Road-to-Rock Lane | Maintenance | 1,772.05 | 2025 |
| Roads Roads | 207 219 | Murray Drive Spectacle Lake Road | Rock Lane-to-911-22 911-257 border-to-911-588 End | Maintenance Maintenance | 23,780.18 2,551.12 | 2025 2025 |
| | | | | | | |
| Roads | 116 | Cemetery Lane | Siberia Road-to-Island Drive Lane | Maintenance | 8,645.28 | 2026 |
| Roads | 136 | Lakeview Parkway | Sprucedale Avenue-to-911-100 End | Maintenance | 1,806.60 | 2026 |
| Roads | 146 | Lane Street | Paugh Lake Road-to-911-50 | Maintenance | 816.50 | 2026 |
| Roads | 152 | Pioneer Road | Cybulski Road-to-cemetery | Maintenance | 1,525.50 | 2026 |
| Roads | 167 | White Pine Crescent | Renfrew County Road 62-to-Renfrew County Rd 62 | Maintenance | 1,059.13 | 2026 |
| Roads | 168 | Yantha Crescent | Sprucedale Avenue-to-Sandhill Drive | Maintenance | 722.53 | 2026 |
| Roads Roads | 172 183 | Dam Lake Road Trebinski Road | Stanley Olsheski Road-to- 911-35 Paugh Lake Road-to-911-396 End | Maintenance Rehabilitation | 679.34 367,884.03 | 2026 2026 |
| Roads | 203 | Needham Street | Bay Street-to-911-89 | Rehabilitation | 76,517.49 | 2026 |
| Roads | 213 | Tilleman Road | Palmer Road-to-Kunkle Lane | Maintenance | 38,360.10 | 2026 |
| | | | | | | |
| Roads | 74 | Airport Road | from 911-1368 to 1487 | Maintenance | 9,178.92 | 2027 |
| Roads | 96 | Frank Street | Peter St to End | Maintenance | 4,601.79 | 2027 |
| Roads | 112 | Annie Mayhew Road | Maika Road-to-911-130 | Maintenance | 2,216.83 | 2027 |
| Roads | 120 | Mahon Street | (1 to 23) Stafford Street-to-Ignatius Drive | Maintenance | 536.24 | 2027 |
| Roads | 126 | Zilney Street | Paugh Lake Road-to-911-78 End | Maintenance | 8,851.66 | 2027 |
| Roads | 129 | Chapeskie Road | Combermere Road-to-911-3052 End | Maintenance | 6,721.18 | 2027 |
| Roads | 137 | Martin Street | Opeongo Line-to-911-20 | Maintenance | 439.26 | 2027 |
| Roads Roads | 151 170 | Yandreski Road Burchat Street | ChapeskiMillDr&Kedroski Rd-to-911-1660 -dead end Hwy 60-to-911-74 | Rehabilitation Maintenance | 417,664.78 | 2027 2027 |
| Roads | 214 | Carson Heights Road | Hwy 60-to-911-148 End | Maintenance | 30,971.14 19,815.94 | 2027 |
| | | | | | | |
| Roads | 67 | Bay Street | Queen ST To CR 62 | Maintenance | 10,176.11 | 2028 |
| Roads | 72 72 | Olsheski Service Road Pine Cliff Road | Hwy 60-to-911-29 End | Maintenance | 4,806.31 | 2028 |
| Roads Roads | 73 77 | Pine Citt Road Peter Street | Renfrew County Road 62-to-Bobolink Lane Paugh Lake Road-to-911-99 End | Maintenance Maintenance | 11,642.05 15,532.46 | 2028 2028 |
| Roads | 91 | Sprucedale Avenue | From 911-48 to Lakeview Parkway | Maintenance | 7,534.67 | 2028 |
| Roads | 99 | Murray Park Street | Paugh Lake Road-to-911-96 End | Maintenance | 11,341.96 | 2028 |
| Roads | 189 | Yeretch Road | Airport Road-to-911-118 | Maintenance | 17,155.00 | 2028 |
| | | | | | | |
| Roads | 55 | Hopefield Road | Kuiack Lake Rd-Opeongo Rd | Rehabilitation | 547,854.74 | 2029 |
| Roads | 68 | Beanish Street | Casey Street-to-911-20 | Maintenance | 3,210.36 | 2029 |
| Roads | 69 | Farmer Road | Mill Street-to-Renfrew County Road 62 | Maintenance | 9,329.55 | 2029 |
| Roads | 190 | CoulasRd(boundaryBangor | Twr Dafoe Road-to-Raglan Township 911-#47 | Rehabilitation | 118,291.98 | 2029 |
| Poads. | 50 | Hildsbrandt Ctt | Daugh Laka Bood to 011 124 Da-2 E-2 | Maintenance | 15 204 00 | 2020 |
| Roads Roads | 60 | Hildebrandt Street Stafford Street | Paugh Lake Road-to-911-124 Dead End County Road 62 to Inglis Street | Maintenance Maintenance | 15,204.88 25,961.55 | 2030 2030 |
| Roads | 64 | Kartuzy Road | 2.0km from start To End | Maintenance | 79,804.51 | 2030 |
| Roads | 75 | Maika Road | (1 to 126) Lower Craigmont Road-to-Malovic Lane | Maintenance | 17,839.81 | 2030 |
| Roads | 76 | Mill Street | Combermere Road-to-Farmer Road | Maintenance | 11,731.18 | 2030 |
| Roads | 92 | Stafford Street | Lakeshore to County Road 62 | Maintenance | 13,424.84 | 2030 |
| Roads | 95 | Bleski Road | from 911-157 to End | Maintenance | 1,623.02 | 2030 |
| Roads | 114 | Biernacki Street | Siberia Road-to-911-45 | Rehabilitation | 36,069.84 | 2030 |
| Roads | 124 | Queen Street | Stafford Street-to-Dunn Street | Maintenance | 889.89 | 2030 |
| Roads | 217 | Kosnaski Road | Hwy 60-to Dead End | Maintenance | 12,558.82 | 2030 |
| Roads | 38 | Fran-Stell Drive | Rockingham Road-to-911-80 End | Reconstruction | 107,367.97 | 2031 |
| Roads | 46 | Waska Way | Hwy 60 to End | Maintenance | 6,491.77 | 2031 |
| Roads | 51 | Long Lake Road | Combermere Road-to-911-682 | Maintenance | 11,505.38 | 2031 |
| Roads | 83 | Kelly Street | Hwy 60/Opeongo Line-to-Paugh Lake Road | Maintenance | 2,532.53 | 2031 |
| Roads | 104 | Casey Street | Siberia Road-to-911-133 End | Maintenance | 16,937.02 | 2031 |
| Roads | 181 | Steffan Road | Chapeski Mill Drive-to-911-173 | Rehabilitation | 96,851.13 | 2031 |
| Roads | 208 | Opeongo Road West | Hwy 60 West to Hwy 60 | Maintenance | 51,508.02 | 2031 |
| Roads | 209 | Chris Mullin Lane | Arbor Vitae Road-to-911-112 End | Maintenance | 15,546.15 | 2031 |
| Roads | 212 | Brotton Road | Peplinski Homestead Road to End | Maintenance | 7,169.51 | 2031 |
| Roads | 218 | Meadowlark Road | Combernere Road to 911- 54 | Maintenance | 591.30 | 2031 |
| Roads | 222 | Finch Road | 911-426-to-911-486 Dead End | Maintenance | 6,596.76 | 2031 |
| Roads | 11 | Honefield Poad | Old Barry's Bay Rd-Dombroskie Rd | Reconstruction | 426,577.87 | 2032 |
| Roads Roads | 31 | Hopefield Road Wilno North Road | Start of pavement to Paugh Lake Rd | Maintenance | 39,141.13 | 2032 |
| | 51 | North Road | or parement to I magnitude Nu | ameenance | 55,141.15 | 2002 |

| Roads | 35 | Theresa Trail | Bleski Road-to-91-36 End | Maintenance | 4,897.81 | 2032 |
|-------|-----|-------------------------|--|----------------|------------|------|
| Roads | 40 | Wilno North Road | Hwy 60 to 911-1344 | Maintenance | 5,046.08 | 2032 |
| | | | · | | | |
| Roads | 45 | Pinecrest Avenue | Sandhill Drive-to-911-38 | Maintenance | 4,969.81 | 2032 |
| Roads | 48 | Coveleski Street | Biernacki Street-to-911-39 | Maintenance | 591.02 | 2032 |
| Roads | 53 | Conway Street | Hwy 60-to-Inglis Street | Maintenance | 5,015.71 | 2032 |
| Roads | 56 | Mintha Street | Hwy 60-to-911-104 End | Maintenance | 1,738.25 | 2032 |
| Roads | 88 | Sandhill Drive | Opeongo Line-to-Yantha Crescent | Maintenance | 4,149.76 | 2032 |
| Roads | 94 | William Street | (1 to 115) Old Barry's Bay Road-to-911-115 end | Maintenance | 3,969.63 | 2032 |
| Roads | 186 | Cranberry Creek Road | Wilno North Road-to-911-150 | Rehabilitation | 132,440.18 | 2032 |
| | | | | | | |
| Roads | 191 | Coulas Road | Cybulski Road-to-911-726 dead end | Maintenance | 73,589.30 | 2032 |
| Roads | 201 | Kowal Road | Dafoe Road-to-911-110 End | Maintenance | 15,314.08 | 2032 |
| Roads | 202 | Krezel Road | Hwy 60-to-Opeongo Road | Maintenance | 21,398.75 | 2032 |
| Roads | 204 | Stans Cottage Road | Palmer Road-to-911-68 End | Maintenance | 7,086.14 | 2032 |
| | | Ü | | | · | |
| Roads | 18 | Arena Road | Hwy 60-to-911-65 | Maintenance | 10,168.71 | 2033 |
| | 27 | Weglarz Road | • | | | |
| Roads | | - | Matcheski Rd & WIltom Drive-to-911-440 to End maintained portion | | 9,036.53 | 2033 |
| Roads | 32 | Blackfish Bay Road | Combermere Road-to-911-259 AB | Maintenance | 4,429.16 | 2033 |
| Roads | 44 | Ohio Road | Combermere Road-to-911-926 Hastings County Border | Maintenance | 14,138.18 | 2033 |
| Roads | 71 | Kitts Street | Bay Street-to-Dunn Street | Maintenance | 2,889.05 | 2033 |
| Roads | 90 | Sprucedale Avenue | Sandhill Drive to 911-48 | Maintenance | 25,447.11 | 2033 |
| Roads | 179 | Mullen Road | Combermere Road-to-911-65 | Rehabilitation | 49,341.88 | 2033 |
| | | | | | | |
| Roads | 187 | Dam Lake Road | 1.3km from 911-35-to-911-614 Turnaround | Maintenance | 4,727.54 | 2033 |
| Roads | 195 | Luckovitch Road | Old Barry's Bay Road-to-911-126AB End | Maintenance | 90,178.27 | 2033 |
| Roads | 220 | Cranberry Creek Road | (150 to 310) 911-150-to-911-310 End | Maintenance | 2,731.05 | 2033 |
| | | | | | | |
| Roads | 12 | Mitchell Road | Hwy 60-to-911-782 End | Maintenance | 26,412.95 | 2034 |
| Roads | 15 | Dombroskie Road | Hopefield Road-to-911-962 | Maintenance | 28,776.35 | 2034 |
| Roads | 19 | Cybulski Road | Pioneer Road to 911-889 | Maintenance | 57,488.87 | 2034 |
| Roads | 28 | Biernacki Mountain Road | Siberia Road-to-end of pavement @911-300 | Maintenance | 67,738.53 | 2034 |
| Roads | 29 | Billings Street | Stafford Street-to-end of pavement 911-17 | Maintenance | 245.19 | 2034 |
| | | - | | | | |
| Roads | 36 | Airport Road | Hwy 60 to 911-1368 | Maintenance | 2,651.29 | 2034 |
| Roads | 49 | Cybulski Road | Hildebrandt Street-to-Pioneer Road | Maintenance | 5,828.23 | 2034 |
| Roads | 65 | Lower Craigmont Road | From Dafoe Rd - for 1.4 km | Maintenance | 5,098.93 | 2034 |
| Roads | 125 | Wilno Street | Dunn Street-to-911-89 & Tower Hill Road | Rehabilitation | 95,716.14 | 2034 |
| Roads | 162 | Parcher Road | 911-150-to-Bangor Twp Line - Hastings Cty | Rehabilitation | 408,598.21 | 2034 |
| | | | | | | |
| Roads | 174 | Murack-Flis Road | Wilno North Road-to-911-424 End | Maintenance | 69,058.79 | 2034 |
| Roads | 188 | Finch Road | Palmer Road-to-911-426 | Maintenance | 6,255.42 | 2034 |
| Roads | 211 | Madawaska River Drive | (912 to 936) 911-912-to-911-936 end | Maintenance | 2,260.23 | 2034 |
| Roads | 215 | Grouse Road | Brudenell boundary 911-39-to-911-508 Dead End | Maintenance | 5,977.02 | 2034 |
| | | | | | -,- | |
| Roads | 2 | Opeongo Road East Wilno | Krezel Road to 911-11761 | Maintenance | 29,229.66 | 2035 |
| | | | | | | |
| Roads | 6 | Opeongo Road East Wilno | Hwy 60 to Krezel Road | Maintenance | 18,314.83 | 2035 |
| Roads | 16 | Mission Road | Mill Street to 911-65 End | Maintenance | 7,699.77 | 2035 |
| Roads | 20 | Matcheski Road | Siberia Road-to-Wiltom Drive & Weglarz Road | Maintenance | 57,219.16 | 2035 |
| Roads | 22 | Wiltom Drive | Matcheski Road-to-911-336 End | Maintenance | 42,317.47 | 2035 |
| Roads | 33 | Arbor Vitae Road | Chris Mullen - End at 911-796A | Maintenance | 5,572.43 | 2035 |
| | | | | | | |
| Roads | 122 | Opeongo Road East Wilno | From 911-11775 to Wilno South Intersection | Maintenance | 202,561.34 | 2035 |
| Roads | 183 | Trebinski Road | Paugh Lake Road-to-911-396 End | Rehabilitation | 367,884.03 | 2035 |
| Roads | 196 | Skidder Trail Road | Stanley Olsheskie Rd-End | Maintenance | 848.11 | 2035 |
| Roads | 199 | Diamond Lake Road | Rockingham Road-to-911-286 | Maintenance | 4,479.67 | 2035 |
| Roads | 216 | Zappa Road | Old Barry's Bay Road-to-911-288 End | Maintenance | 3,786.54 | 2035 |
| Roads | 221 | Yeretch Road | 911-118-to-911-280 End | Maintenance | 2,132.60 | 2035 |
| | | | | | | |
| Roads | 25 | Lepinski Road | Old Barry's Bay Road-to-Hwy 60 | Maintenance | 488.00 | 2036 |
| Roads | 26 | Spectacle Lake Road | Hwy 60 front portion maintained by South Algonquin | Maintenance | 4,320.17 | 2036 |
| | | | | | | |
| Roads | 37 | Bleski Road | Kartuzy Rd-911-157 | Maintenance | 2,552.65 | 2036 |
| Roads | 47 | Chapeski Mill Drive | Into #704 - Chapeskie Mill drive to turnaround @ gate | Maintenance | 13,809.56 | 2036 |
| Roads | 54 | Drohan Street | Hwy 60-to-Peter Street | Maintenance | 1,518.80 | 2036 |
| Roads | 108 | Lower Craigmont Road | 1.4km to end-turnaround | Maintenance | 260,841.60 | 2036 |
| Roads | 121 | Micks Road | Dafoe Road-to-911-40 End | Maintenance | 5,782.42 | 2036 |
| Roads | 123 | Peplinskie Road | Dafoe Road-to-Bangor Township line | Maintenance | 34,335.29 | 2036 |
| | | | | | | |
| Roads | 178 | Zaluska Road | Cybulski Road-to-911-130 dead end | Maintenance | 16,186.51 | 2036 |
| Roads | 185 | Airport Road | from 911-1487-1554 | Rehabilitation | 76,983.39 | 2036 |
| Roads | 197 | Yakabuski Road | Siberia Road-to-911-216 End | Maintenance | 1,713.62 | 2036 |
| Roads | 205 | Carson Grove Road | Carson Heights Road-to-911-62 End | Maintenance | 1,145.09 | 2036 |
| Roads | 206 | Chippawa Road | 911-873 to End | Maintenance | 37,179.17 | 2036 |
| | | | | | | |
| Roads | 43 | Oak Street | Turnaround-to-911-56 | Maintenance | 826.65 | 2037 |
| Roads | 80 | Cameron Track Road | Hwy 60-to-911-294 End | Rehabilitation | 194,895.68 | 2037 |
| Roads | 81 | Country Forest Lane | Airport Road-to-911-150 End | Rehabilitation | 116,027.63 | 2037 |
| | | | | | | |
| Roads | 134 | Wernham Road | Combermere Road-to-911-30 End | Maintenance | 3,203.96 | 2037 |
| Roads | 138 | Mullen Road | 911-216-to-Perrier Road | Maintenance | 27,265.22 | 2037 |
| Roads | 141 | Shalla Street | Smaglinski-Stoppa Parkway-to-911-14 End | Maintenance | 1,575.67 | 2037 |
| Roads | 151 | Yandreski Road | ChapeskiMillDr&Kedroski Rd-to-911-1660 -dead end | Rehabilitation | 417,664.78 | 2037 |
| Roads | 210 | Kuiack Lake Road | Hopefield Road-to-911-178 | Maintenance | 2,671.43 | 2037 |
| | | | | | | |
| Roads | 3 | Mask Island Drive | Island Lane & Cemetery Lane | Maintenance | 1,103.27 | 2038 |
| Roads | 42 | Lakeshore Drive | Combermere Road-to-Bay Street | Maintenance | 27,573.74 | 2038 |
| | | | | | | |
| Roads | 52 | Sunny Hill Road | Siberia Road-to-911-532 | Maintenance | 8,816.56 | 2038 |
| Roads | 70 | Hopefield Road | Dombroskie Rd-Kuiack Lake Rd | Rehabilitation | 452,357.98 | 2038 |
| Roads | 117 | Cybulski Road | Cybulski Road-into 911-661 AB | Maintenance | 11,789.26 | 2038 |
| | | | | | | |
| | | | | | | |

| Roads | 5 | Peter Street North | Peter Street-to-911-15 End | Maintenance | 22,849.11 | 2039 |
|---|--|--|--|---|---|--|
| Roads | 9 | Old Barry's Bay Road | 911-1697 to Burbidge Lane | Maintenance | 16,049.37 | 2039 |
| Roads | 10 | | - | | | 2039 |
| | | Old Barry's Bay Road | From Burbidge Lane to Combermere Rd | Maintenance | 20,923.08 | |
| Roads | 14 | Ontario Street | Ohio Road-to-911-224 End | Reconstruction | 34,047.97 | 2039 |
| Roads | 21 | Tamarack Road | Chippawa Road-to-911-966 End | Maintenance | 7,320.85 | 2039 |
| Roads | 61 | Upper Rosenthal Road | Jewellville Road-to-Guiney Road | Maintenance | 17,233.81 | 2039 |
| Roads | 62 | Walker Street | Old Barry's Bay Road-to-911-190 | Maintenance | 922.14 | 2039 |
| | 85 | | • • | | | 2039 |
| Roads | | Mask Island Drive | Causeway end for 100m | Maintenance | 407.88 | |
| Roads | 100 | Olsheski Road | Old Barry's Bay Road-to-911-394 | Maintenance | 6,494.08 | 2039 |
| Roads | 105 | Cybulski Road | 911-889 TO Zaluska Coulas RD | Maintenance | 32,905.06 | 2039 |
| Roads | 115 | Carmel Hill Road | Dafoe Road-to-911-114 end | Maintenance | 15,429.44 | 2039 |
| Roads | 127 | Chanonhouse Road | Long Lake Road-to-911-286 End | Maintenance | 72,574.94 | 2039 |
| | | | | | | |
| Roads | 128 | Chapel Road | Kopernik Road-to-911-25 | Maintenance | 3,082.95 | 2039 |
| Roads | 133 | Stoppa Street | Paugh Lake Road-to-911-1534 End | Rehabilitation | 35,711.66 | 2039 |
| Roads | 135 | Kubesheski Road | Siberia Road-to-911-156 | Maintenance | 20,066.31 | 2039 |
| Roads | 158 | Kuiack Road | Wilno South Road-to-911-1376 | Maintenance | 44,477.83 | 2039 |
| | | | | | · | |
| | | | | | | |
| Roads | 8 | Bay Street | Lakeshore Drive To Queen ST | Maintenance | 6,506.06 | 2040 |
| Roads | 11 | Hopefield Road | Old Barry's Bay Rd-Dombroskie Rd | Reconstruction | 426,577.87 | 2040 |
| | | | | | | |
| Roads | 63 | Dovetail Road | Rockingham Road-to-Prince Road 911-192 | Maintenance | 21,609.52 | 2040 |
| Roads | 78 | Peterson Place | Palmer Road-to-911-46 End | Maintenance | 5,017.33 | 2040 |
| Roads | 87 | Prince Road | 911-501-to-Brudenell Twp. Boundary | Maintenance | 5,518.36 | 2040 |
| Roads | 110 | Rubyville Road | Combermere Road-to-911-120 | Maintenance | 17,949.51 | 2040 |
| | | | | | | |
| Roads | 111 | Stanley Olsheski Road | from Dam Lake intersection to End | Maintenance | 13,083.60 | 2040 |
| Roads | 132 | Martin Siding Road | Hwy 60-to-Cybulski Road | Maintenance | 48,147.14 | 2040 |
| Roads | 140 | Paugh Lake Road | Into 911-1719AB | Maintenance | 324.11 | 2040 |
| Roads | 142 | Wiloski Drive | from Paugh Lake Rd to 911-855 | Maintenance | 40,968.27 | 2040 |
| | | | - | | | |
| Roads | 145 | Chapeski Mill Drive | From 911-610 to 911-659 End | Maintenance | 9,761.94 | 2040 |
| Roads | 148 | Pioneer Road | From cemetery to 911-246 | Maintenance | 2,119.81 | 2040 |
| Roads | 198 | Babinski Road | Siberia Road-to-911-354 | Maintenance | 50,469.06 | 2040 |
| | | | | | | |
| | | | | | | |
| Roads | 17 | Perrier Road | Dafoe Road-to-Mullen Road - Hastings Cty Border | Maintenance | 214,436.51 | 2041 |
| Roads | 23 | Riverside Drive | Palmer Road-to-Palmer Road | Maintenance | 4,450.96 | 2041 |
| | | | | | | |
| Roads | 103 | Turners Road | KHR Twp-Burns Twp Border-to-Gunns Rd | Maintenance | 4,234.07 | 2041 |
| Roads | 106 | Grunwald Road | Old Barry's Bay Road-to-911-274 End | Maintenance | 5,133.70 | 2041 |
| Roads | 130 | Etmanski Road | Peplinski Homestead Road-to-Paugh Lake Road | Maintenance | 3,974.52 | 2041 |
| Roads | 131 | Martin Recoskie Road | Dam Lake Road-to-911 | Maintenance | 39,733.51 | 2041 |
| Roads | 139 | Paugh Lake Road | Into 911-1217 | Maintenance | 474.39 | 2041 |
| | | - | | | | |
| Roads | 147 | Peplinski Homestead | Wilno North Road-to-Paugh Lake Road | Maintenance | 17,298.05 | 2041 |
| Roads | 149 | Rumleski Road | 911-1-to-911-268 | Maintenance | 4,007.69 | 2041 |
| Roads | 154 | Chapeski Mill Drive | Paugh Lk to 911 610 | Maintenance | 93,133.19 | 2041 |
| Roads | 161 | McPhee Bay Road | Palmer Road-to-911-338 | Maintenance | 5,225.00 | 2041 |
| Roads | 184 | Vistula Road | (1 to 190) Old Barry's Bay Road-to-911-190 End | Maintenance | 2,894.86 | 2041 |
| Noaus | 104 | vistula Road | (1 to 190) Old Bally's Bay Road-to-911-190 Elid | Walltellance | 2,034.00 | 2041 |
| | | | | | | |
| | | | | | | |
| Ponds | 7 | Old Dawn's Day Dood | From Hyur 60 to 011 1607 | Maintonanco | 20 260 09 | 2042 |
| Roads | 7 | Old Barry's Bay Road | From Hwy 60 to 911-1697 | Maintenance | 39,369.98 | 2042 |
| Roads | 13 | Wiloski Drive | From 911- 855 to End | Maintenance Maintenance | 39,369.98 99,548.36 | 2042 |
| | | | | | | |
| Roads Roads | 13 | Wiloski Drive Wilno North Road | From 911- 855 to End Winnie Rd to start of pavement | Maintenance Maintenance | 99,548.36 22,587.21 | 2042 |
| Roads Roads Roads | 13 30 59 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 | 2042 2042 2042 |
| Roads Roads Roads Roads | 13 30 59 79 | Wiloski Drive Wilno North Road | From 911- 855 to End Winnie Rd to start of pavement | Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 | 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads | 13 30 59 79 97 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 | 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads | 13 30 59 79 97 107 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 | 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads | 13 30 59 79 97 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 | 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 | 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 77 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 77 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 224 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 16,160.78 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 224 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 16,160.78 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 224 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 16,160.78 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 224 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 16,160.78 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 224 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 16,160.78 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 79 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 224 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 16,160.78 | 2042 2042 2042 2042 2042 2042 2042 2042 |
| Roads | 13 30 59 97 97 107 109 118 144 173 175 200 223 225 41 84 102 150 159 160 177 213 224 | Wiloski Drive Wilno North Road Pecarski Road | From 911-855 to End Winnie Rd to start of pavement Hwy 60-to-911-148 End | Maintenance | 99,548.36 22,587.21 2,780.10 2,392.95 1,765.91 1,821.32 1,072.78 3,962.48 339.70 8,470.77 3,486.96 78,513.59 869.48 11,512.04 3,807.63 840.43 1,340.20 75,766.87 1,001.79 136.53 6,091.74 38,360.10 16,160.78 | 2042 2042 2042 2042 2042 2042 2042 2042 |

| Asset | | | | Treatment | Forecast | Forecast |
|--------------------------|----------------|--|----------------------------------|----------------------------------|------------------------|--------------|
| Class Facilities | Asset ID 15 | Facility CombermereCC | Type C INTERIORS | Description Rehabilitation | Cost (\$) 1,739.08 | Year 2024 |
| Facilities | 49 | CombernereCC | D SERVICES | Rehabilitation | 1,135.37 | 2024 |
| Facilities Facilities | 69 71 | CombermereCC CombermereCC | G SITEWORK G SITEWORK | Rehabilitation Rehabilitation | 9,913.02 | 2024 2024 |
| Facilities | 72 | CombermereCC | G SITEWORK | Rehabilitation | 6,565.39 6,215.31 | 2024 |
| Facilities Facilities | 80 81 | Adrian Museum Adrian Museum | A SUBSTRUCTURE | Rehabilitation Rehabilitation | 30,721.69 | 2024 2024 |
| Facilities | 84 | Adrian Museum | B SHELL B SHELL | Rehabilitation | 9,485.87 74,943.06 | 2024 |
| Facilities | 104 | Adrian Museum | D SERVICES | Rehabilitation | 510.13 | 2024 |
| Facilities Facilities | 106 108 | Adrian Museum Adrian Museum | G SITEWORK G SITEWORK | Rehabilitation Maintenance | 3,458.02 320.07 | 2024 2024 |
| Facilities | 109 | Adrian Museum | G SITEWORK | Rehabilitation | 2,297.38 | 2024 |
| Facilities Facilities | 131 134 | Combermere GoldenYears Combermere GoldenYears | C INTERIORS C INTERIORS | Rehabilitation Rehabilitation | 3,146.19 4,758.25 | 2024 2024 |
| Facilities | 138 | Combermere GoldenYears | C INTERIORS | Rehabilitation | 545.23 | 2024 |
| Facilities Facilities | 139 140 | Combermere GoldenYears Combermere GoldenYears | C INTERIORS D SERVICES | Rehabilitation Rehabilitation | 4,400.49 541.24 | 2024 2024 |
| Facilities | 155 | Combernere GoldenYears | D SERVICES | Rehabilitation | 218.09 | 2024 |
| Facilities Facilities | 195 199 | Combermere Outdoor Rink Combermere Outdoor Rink | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 1,016.07 1,652.17 | 2024 2024 |
| Facilities | 211 | Combernere Outdoor Rink | G SITEWORK | Rehabilitation | 1,053.99 | 2024 |
| Facilities | 231 | Library | B SHELL | Rehabilitation | 1,083.89 | 2024 |
| Facilities Facilities | 240 245 | Library Library | C INTERIORS C INTERIORS | Rehabilitation Rehabilitation | 5,730.51 238.43 | 2024 2024 |
| Facilities | 254 | Library | D SERVICES | Rehabilitation | 833.65 | 2024 |
| Facilities Facilities | 256 260 | Library Library | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 205.70 1,524.11 | 2024 2024 |
| Facilities | 261 | Library | D SERVICES | Rehabilitation | 314.62 | 2024 |
| Facilities Facilities | 262 264 | Library Library | D SERVICES D SERVICES | Reconstruction Rehabilitation | 4,600.00 413.04 | 2024 2024 |
| Facilities | 266 | Library | D SERVICES | Rehabilitation | 5,156.57 | 2024 |
| Facilities Facilities | 268 | Library | D SERVICES | Rehabilitation | 1,308.54 | 2024 |
| Facilities | 269 270 | Library Library | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 2,716.35 1,623.73 | 2024 2024 |
| Facilities | 285 | Library | G SITEWORK | Rehabilitation | 3,816.58 | 2024 |
| Facilities Facilities | 297 309 | MissionHouse MissionHouse | B SHELL B SHELL | Rehabilitation Rehabilitation | 17,305.93 460.94 | 2024 2024 |
| Facilities | 329 | MissionHouse | D SERVICES | Rehabilitation | 275.36 | 2024 |
| Facilities Facilities | 331 335 | MissionHouse MissionHouse | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 2,462.02 135.31 | 2024 2024 |
| Facilities | 344 | MissionHouse | G SITEWORK | Rehabilitation | 1,238.73 | 2024 |
| Facilities Facilities | 361 371 | Municipal Office Municipal Office | B SHELL C INTERIORS | Rehabilitation Reconstruction | 2,787.14 3,450.00 | 2024 2024 |
| Facilities | 390 | Municipal Office | D SERVICES | Rehabilitation | 1,354.77 | 2024 |
| Facilities Facilities | 391 392 | Municipal Office | D SERVICES | Rehabilitation | 8,781.41 | 2024 |
| Facilities | 393 | Municipal Office Municipal Office | D SERVICES D SERVICES | Rehabilitation Reconstruction | 9,438.58 9,775.00 | 2024 2024 |
| Facilities | 396 | Municipal Office | D SERVICES | Rehabilitation | 2,250.68 | 2024 |
| Facilities Facilities | 397 399 | Municipal Office Municipal Office | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 8,480.29 14,884.65 | 2024 2024 |
| Facilities | 400 | Municipal Office | D SERVICES | Rehabilitation | 760.58 | 2024 |
| Facilities Facilities | 401 443 | Municipal Office North Firehall | D SERVICES C INTERIORS | Rehabilitation Rehabilitation | 378.87 994.18 | 2024 2024 |
| Facilities | 452 | North Firehall | D SERVICES | Rehabilitation | 617.11 | 2024 |
| Facilities Facilities | 466 472 | North Firehall North Firehall | D SERVICES G SITEWORK | Rehabilitation Maintenance | 8,118.63 12,720.82 | 2024 2024 |
| Facilities | 517 | PW Garage1 | D SERVICES | Rehabilitation | 683.47 | 2024 |
| Facilities Facilities | 526 527 | PW Garage1 | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 164.13 | 2024 2024 |
| Facilities | 540 | PW Garage1 PW Garage1 | D SERVICES D SERVICES | Rehabilitation | 1,864.59 791.13 | 2024 |
| Facilities | 586 | PW Garage 2 | D SERVICES | Rehabilitation | 1,573.10 | 2024 |
| Facilities Facilities | 593 601 | PW Garage 2 PW Garage 2 | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 4,089.19 395.24 | 2024 2024 |
| Facilities | 611 | PW Garage 2 | E EQUIPMENT AND FURN | | 2,444.71 | 2024 |
| Facilities Facilities | 622 623 | Railway Museum Railway Museum | A SUBSTRUCTURE A SUBSTRUCTURE | Rehabilitation Rehabilitation | 62,301.36 5,141.21 | 2024 2024 |
| Facilities | 635 | Railway Museum | B SHELL | Rehabilitation | 4,257.65 | 2024 |
| Facilities Facilities | 648 653 | Railway Museum Railway Museum | C INTERIORS C INTERIORS | Rehabilitation Rehabilitation | 10,220.50 232.03 | 2024 2024 |
| Facilities | 666 | Railway Museum | D SERVICES | Rehabilitation | 368.90 | 2024 |
| Facilities | 723 726 | South Firehall South Firehall | C INTERIORS | Rehabilitation | 1,522.75 | 2024 |
| Facilities Facilities | 742 | South Firehall | C INTERIORS D SERVICES | Rehabilitation Rehabilitation | 1,380.17 271.63 | 2024 2024 |
| Facilities | 754 | South Firehall | D SERVICES | Rehabilitation | 719.77 | 2024 |
| Facilities | 778 | Wooden Water Tower | G SITEWORK | Rehabilitation | 683.47 | 2024 |
| | | | p approx | - 1 1 m · · · | , | |
| Facilities Facilities | 51 113 | CombermereCC Combermere GoldenYears | D SERVICES A SUBSTRUCTURE | Rehabilitation Rehabilitation | 11,297.51 57,040.81 | 2025 2025 |
| Facilities | 114 | Combermere GoldenYears | A SUBSTRUCTURE | Rehabilitation | 38,695.93 | 2025 |
| Facilities Facilities | 115 308 | Combermere GoldenYears MissionHouse | B SHELL B SHELL | Rehabilitation Rehabilitation | 25,545.89 9,126.53 | 2025 2025 |
| Facilities | 310 | MissionHouse | C INTERIORS | Rehabilitation | 1,986.90 | 2025 |
| Facilities | 311 | MissionHouse | C INTERIORS | Rehabilitation | 2,548.32 | 2025 |
| Facilities Facilities | 375 377 | Municipal Office Municipal Office | C INTERIORS C INTERIORS | Rehabilitation Rehabilitation | 8,288.22 5,648.76 | 2025 2025 |
| Facilities | 476 | North Firehall | G SITEWORK | Rehabilitation | 205.65 | 2025 |
| Facilities Facilities | 515 516 | PW Garage1 PW Garage1 | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 653.57 1,714.18 | 2025 2025 |
| Facilities | 524 | PW Garage1 | D SERVICES | Rehabilitation | 1,376.81 | 2025 |
| Facilities Facilities | 535 544 | PW Garage1 PW Garage1 | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 3,178.11 186.46 | 2025 2025 |
| Facilities | 566 | PW Garage 2 | B SHELL | Reconstruction | 43,125.00 | 2025 |
| Facilities | 687 | South Firehall | A SUBSTRUCTURE | Rehabilitation | 80,695.09 | 2025 |
| Facilities Facilities | 702 703 | South Firehall South Firehall | B SHELL B SHELL | Rehabilitation Rehabilitation | 12,074.22 1,408.58 | 2025 2025 |
| Facilities | 765 | Wooden Water Tower | A SUBSTRUCTURE | Rehabilitation | 10,243.04 | 2025 |
| Facilities | 767 | Wooden Water Tower | B SHELL | Rehabilitation | 84,943.94 | 2025 |
| Facilities | 21 | CombermereCC | C INTERIORS | Rehabilitation | 1,530.38 | 2026 |

| Fa | | | | | | | |
|----------------------------------|----------------------------------|------------|---|------------------------------------|----------------------------------|-----------------------|--------------|
| | cilities | 26 | CombermereCC | C INTERIORS | Rehabilitation | 8,118.63 | 2026 |
| Fa | cilities | 27 | CombermereCC | C INTERIORS | Rehabilitation | 16,713.15 | 2026 |
| | cilities | 85 | Adrian Museum | B SHELL | Rehabilitation | 2,571.17 | 2026 |
| | cilities | 94 | Adrian Museum | C INTERIORS | Rehabilitation | 2,319.56 | 2026 |
| Fa | cilities | 96 | Adrian Museum | D SERVICES | Rehabilitation | 958.01 | 2026 |
| | cilities | 97 | Adrian Museum | D SERVICES | Rehabilitation | 264.84 | 2026 |
| | cilities | 135 | Combermere GoldenYears | C INTERIORS | Rehabilitation | 3,952.42 | 2026 |
| | cilities | 154 | Combermere GoldenYears | D SERVICES | Rehabilitation | 2,610.43 | 2026 |
| | cilities | 156 | Combermere GoldenYears | D SERVICES | Rehabilitation | 162.98 | 2026 |
| | cilities | 160 | Combernere GoldenYears | G SITEWORK | Rehabilitation | 534.64 | 2026 |
| | cilities | 162 | Combermere GoldenYears | G SITEWORK | Rehabilitation | 397.26 | 2026 |
| | cilities cilities | 247 249 | Library | C INTERIORS | Rehabilitation Rehabilitation | 23,046.92 | 2026 |
| | cilities | 275 | Library | D SERVICES E EQUIPMENT AND FURN | | 2,809.81 794.53 | 2026 2026 |
| | cilities | 280 | Library Library | G SITEWORK | Rehabilitation | 988.91 | 2026 |
| | cilities | 281 | Library | G SITEWORK | Rehabilitation | 3,084.73 | 2026 |
| | cilities | 282 | Library | G SITEWORK | Rehabilitation | 1,642.61 | 2026 |
| | cilities | 283 | Library | G SITEWORK | Rehabilitation | 16,851.16 | 2026 |
| | cilities | 284 | Library | G SITEWORK | Rehabilitation | 5,307.88 | 2026 |
| | cilities | 286 | Library | G SITEWORK | Rehabilitation | 977.89 | 2026 |
| | cilities | 287 | Library | G SITEWORK | Rehabilitation | 568.30 | 2026 |
| | cilities | 290 | MissionHouse | A SUBSTRUCTURE | Rehabilitation | 9,623.48 | 2026 |
| | cilities | 339 | MissionHouse | D SERVICES | Rehabilitation | 798.34 | 2026 |
| | cilities | 345 | MissionHouse | G SITEWORK | Rehabilitation | 494.46 | 2026 |
| | cilities | 347 | MissionHouse | G SITEWORK | Rehabilitation | 255.06 | 2026 |
| Fa | cilities | 353 | Municipal Office | B SHELL | Rehabilitation | 10,351.37 | 2026 |
| | cilities | 378 | Municipal Office | C INTERIORS | Rehabilitation | 1,408.58 | 2026 |
| | cilities | 380 | Municipal Office | C INTERIORS | Rehabilitation | 8,406.96 | 2026 |
| | cilities | 382 | Municipal Office | C INTERIORS | Reconstruction | 81,995.00 | 2026 |
| | cilities | 385 | Municipal Office | C INTERIORS | Rehabilitation | 3,439.85 | 2026 |
| | cilities | 405 | Municipal Office | D SERVICES | Rehabilitation | 1,596.68 | 2026 |
| | cilities | 411 | Municipal Office | G SITEWORK | Rehabilitation | 65,070.30 | 2026 |
| | cilities | 418 | Municipal Office | G SITEWORK | Rehabilitation | 568.30 | 2026 |
| | cilities | 446 | North Firehall | D SERVICES | Rehabilitation | 3,643.01 | 2026 |
| | cilities | 447 | North Firehall | D SERVICES | Rehabilitation | 1,117.87 | 2026 |
| | cilities | 464 | North Firehall | D SERVICES | Rehabilitation | 218.09 | 2026 |
| | cilities | 469 | North Firehall | D SERVICES | Rehabilitation | 79.83 | 2026 |
| | cilities | 478 | North Firehall | G SITEWORK | Rehabilitation | 8,206.74 | 2026 |
| | cilities | 480 | PW Garage1 | A SUBSTRUCTURE | Rehabilitation | 37,893.17 | 2026 |
| | cilities | 489 | PW Garage1 | B SHELL | Maintenance | 1,353.54 | 2026 |
| | cilities | 509 | PW Garage1 | C INTERIORS | Rehabilitation | 1,820.76 | 2026 |
| Fa | cilities | 529 | PW Garage1 | D SERVICES | Rehabilitation | 2,173.08 | 2026 |
| Fa | cilities | 539 | PW Garage1 | D SERVICES | Rehabilitation | 3,468.44 | 2026 |
| Fa | cilities | 541 | PW Garage1 | D SERVICES | Rehabilitation | 411.30 | 2026 |
| Fa | cilities | 547 | PW Garage1 | G SITEWORK | Rehabilitation | 16,499.76 | 2026 |
| Fa | cilities | 550 | PW Garage1 | G SITEWORK | Rehabilitation | 1,871.23 | 2026 |
| Fa | cilities | 580 | PW Garage 2 | C INTERIORS | Rehabilitation | 4,815.79 | 2026 |
| Fa | cilities | 604 | PW Garage 2 | D SERVICES | Rehabilitation | 619.36 | 2026 |
| Fa | cilities | 610 | PW Garage 2 | D SERVICES | Rehabilitation | 1,144.97 | 2026 |
| Fa | cilities | 639 | Railway Museum | C INTERIORS | Rehabilitation | 1,404.91 | 2026 |
| Fa | cilities | 710 | South Firehall | C INTERIORS | Rehabilitation | 3,302.26 | 2026 |
| Fa | cilities | 725 | South Firehall | C INTERIORS | Rehabilitation | 7,040.78 | 2026 |
| Fa | cilities | 750 | South Firehall | D SERVICES | Maintenance | 187.99 | 2026 |
| Fa | cilities | 770 | Wooden Water Tower | B SHELL | Rehabilitation | 22,478.51 | 2026 |
| | | | | | | | |
| | | | | | | | |
| | cilities | 38 | CombermereCC | C INTERIORS | Rehabilitation | 1,020.25 | 2027 |
| | cilities | 77 | CombermereCC | G SITEWORK | Rehabilitation | 134.23 | 2027 |
| | cilities | 147 | Combermere GoldenYears | D SERVICES | Maintenance | 250.66 | 2027 |
| | cilities | 159 | Combermere GoldenYears | G SITEWORK | Rehabilitation | 32,216.17 | 2027 |
| | cilities | 161 | Combermere GoldenYears | G SITEWORK | Rehabilitation | 2,661.13 | 2027 |
| | cilities | 288 | MissionHouse | A SUBSTRUCTURE | Rehabilitation | 29,921.92 | 2027 |
| | cilities | 292 | MissionHouse | A SUBSTRUCTURE | Rehabilitation | 12,712.42 | 2027 |
| | cilities | 338 | MissionHouse | D SERVICES | Rehabilitation | 160.39 | 2027 |
| | cilities | 342 | MissionHouse | G SITEWORK | Maintenance | 751.97 | 2027 |
| | cilities | 348 | Municipal Office | A SUBSTRUCTURE | Rehabilitation | 135,684.70 | 2027 |
| | cilities | 354 | Municipal Office | B SHELL | Rehabilitation | 35,437.79 | 2027 |
| | cilities | 419 | North Firehall | A SUBSTRUCTURE | Rehabilitation | 73,322.19 | 2027 |
| | cilities | 467 | North Firehall | D SERVICES | Rehabilitation | 808.70 | 2027 |
| | cilities | 468 | North Firehall | D SERVICES | Rehabilitation | 160.39 | 2027 |
| | cilities | 485 | PW Garage1 | B SHELL | Rehabilitation | 15,557.97 | 2027 |
| | cilities | 534 | PW Garage1 | D SERVICES | Rehabilitation | 958.01 | 2027 |
| | cilities | 579 | PW Garage 2 | C INTERIORS | Rehabilitation | 389.04 | 2027 |
| | cilities | 603 | PW Garage 2 | D SERVICES | Rehabilitation | 310.22 | 2027 |
| | cilities | 613 | PW Garage 2 | G SITEWORK | Rehabilitation | 54,155.99 | 2027 |
| | cilities | 748 | South Firehall | D SERVICES | Rehabilitation | 2,648.42 | 2027 |
| | cilities | 756 | South Firehall | E EQUIPMENT AND FURN | | 491.85 | 2027 |
| | cilities | 764 | South Firehall | G SITEWORK | Rehabilitation | 199.64 | 2027 |
| Fa | cilities | 785 | Wooden Water Tower | G SITEWORK | Rehabilitation | 107.83 | 2027 |
| | | | | | | | |
| - | cilities | 07 | Adrian Manne | D CHELL | Maintonana | 25.055.55 | 2020 |
| | cilities | 82 | Adrian Museum | B SHELL C INTERIORS | Maintenance | 25,065.65 | 2028 |
| | cilities | 137 | Combermere Golden Years | C INTERIORS | Rehabilitation | 466.15 | 2028 |
| | cilities | 143 | Combermere GoldenYears Combermere Outdoor Rink | D SERVICES | Rehabilitation | 1,603.91 | 2028 |
| | cilities | 190 | | D SERVICES | Rehabilitation | 1,375.94 | 2028 |
| | cilities cilities | 198 | Combermere Outdoor Rink | D SERVICES C INTERIORS | Rehabilitation Rehabilitation | 331.47 1 285 30 | 2028 |
| | | 233 | Library | C INTERIORS | | 1,285.30 | 2028 |
| | cilities | 238 | Library | C INTERIORS | Maintenance Rehabilitation | 256.05 2 915 87 | 2028 |
| | cilities cilities | 242 | Library | C INTERIORS D SERVICES | Rehabilitation Rehabilitation | 2,915.87 | 2028 |
| | | 253 | Library | D SERVICES | | 1,950.79 | 2028 |
| | cilities cilities | 273 | Library MissionHouse | D SERVICES B SHELL | Rehabilitation Rehabilitation | 1,202.94 1 785 44 | 2028 |
| | | 299 | MissionHouse MissionHouse | | Rehabilitation | 1,785.44 | 2028 |
| | cilities | 303 | MissionHouse MissionHouse | B SHELL D SHELL | Maintenance Robabilitation | 1,664.34 | 2028 |
| | cilities | 307 | MissionHouse | B SHELL D SERVICES | Rehabilitation | 428.80 | 2028 |
| | cilities | 337 | MissionHouse | D SERVICES | Rehabilitation | 268.47 | 2028 |
| | cilities | 366 | Municipal Office | C INTERIORS | Rehabilitation | 2,969.28 | 2028 |
| Fa | cilities | 383 | Municipal Office | C INTERIORS | Rehabilitation | 14,413.58 | 2028 |
| Fa Fa | | 394 | Municipal Office | D SERVICES A SUBSTRUCTURE | Rehabilitation Rehabilitation | 1,160.14 57,720.64 | 2028 |
| Fa Fa | cilities | 420 | | | REPARENTATION | 57.770.64 | 2028 |
| Fa Fa Fa | cilities | 420 | North Firehall | | | | 2020 |
| Fa Fa Fa Fa | cilities cilities | 465 | North Firehall | D SERVICES | Rehabilitation | 108.65 | 2028 |
| Fa Fa Fa Fa Fa | cilities cilities cilities | 465 495 | North Firehall PW Garage1 | D SERVICES B SHELL | Rehabilitation Rehabilitation | 108.65 62,594.70 | 2028 |
| Fa Fa Fa Fa Fa Fa | cilities cilities | 465 | North Firehall | D SERVICES | Rehabilitation | 108.65 | |

| Facilities | 573 | PW Garage 2 | C INTERIORS | Rehabilitation | 563.43 | 2028 |
|---|---|--|--|---|---|--|
| Facilities | 624 | Railway Museum | A SUBSTRUCTURE | Rehabilitation | 13,199.53 | 2028 |
| Facilities | 633 | Railway Museum | B SHELL | Rehabilitation | 30,231.63 | 2028 |
| Facilities | 659 | Railway Museum | D SERVICES | Rehabilitation | 2,716.35 | 2028 |
| Facilities | 682 | Railway Museum | G SITEWORK | Rehabilitation | 529.68 | 2028 |
| Facilities | 689 | South Firehall | B SHELL | Rehabilitation | 1,530.38 | 2028 |
| Facilities | 734 | South Firehall | D SERVICES | Rehabilitation | 1,240.89 | 2028 |
| Facilities | 755 | South Firehall | D SERVICES | Rehabilitation | 510.13 | 2028 |
| Facilities | 758 | South Firehall | E EQUIPMENT AND FURN | | 715.44 | 2028 |
| | | | | | | |
| Facilities | 759 | South Firehall | G SITEWORK | Maintenance | 3,769.09 | 2028 |
| Facilities | 774 | Wooden Water Tower | C INTERIORS | Rehabilitation | 7,691.70 | 2028 |
| | | | | | | |
| Facilities | 24 | CombermereCC | C INTERIORS | Rehabilitation | 2,726.13 | 2029 |
| Facilities | 32 | CombermereCC | C INTERIORS | Rehabilitation | 10,961.45 | 2029 |
| Facilities | 105 | Adrian Museum | G SITEWORK | Rehabilitation | 103,547.89 | 2029 |
| Facilities | 107 | Adrian Museum | G SITEWORK | Rehabilitation | 3,100.24 | 2029 |
| Facilities | 130 | Combermere GoldenYears | C INTERIORS | Rehabilitation | 4,741.68 | 2029 |
| Facilities | 132 | Combermere GoldenYears | C INTERIORS | Reconstruction | 1,725.00 | 2029 |
| Facilities | 180 | Combermere Outdoor Rink | C INTERIORS | Rehabilitation | 1,192.14 | 2029 |
| Facilities | 191 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 2,057.02 | 2029 |
| Facilities | 192 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 2,050.42 | 2029 |
| Facilities | 200 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 274.47 | 2029 |
| Facilities | 214 | Combernere Outdoor Rink | G SITEWORK | Rehabilitation | 17,466.07 | 2029 |
| Facilities | 216 | Combermere Outdoor Rink | G SITEWORK | Rehabilitation | 719.77 | 2029 |
| Facilities | 217 | Combermere Outdoor Rink | G SITEWORK | Rehabilitation | 6,121.52 | 2029 |
| Facilities | 219 | Library | A SUBSTRUCTURE | Rehabilitation | 3,107.66 | 2029 |
| Facilities | 274 | Library | D SERVICES | Rehabilitation | 532.23 | 2029 |
| Facilities | 363 | Municipal Office | B SHELL | Rehabilitation | 19,125.31 | 2029 |
| Facilities | 388 | Municipal Office | D SERVICES | Rehabilitation | 6,132.30 | 2029 |
| Facilities | 402 | Municipal Office | D SERVICES | Rehabilitation | 1,347.83 | 2029 |
| Facilities | 404 | Municipal Office | D SERVICES | Rehabilitation | 1,871.23 | 2029 |
| Facilities | 458 | North Firehall | D SERVICES | Reconstruction | 2,300.00 | 2029 |
| Facilities | 463 | North Firehall | D SERVICES | Rehabilitation | 9,322.97 | 2029 |
| Facilities | 471 | North Firehall | E EQUIPMENT AND FURN | | 790.49 | 2029 |
| Facilities | 512 | PW Garage1 | C INTERIORS | Reconstruction | 2,484.00 | 2029 |
| Facilities | 531 | PW Garage1 | | Rehabilitation | 539.13 | 2029 |
| | 555 | PW Garage 2 | D SERVICES A SUBSTRUCTURE | | | |
| Facilities | | | | Rehabilitation | 85,311.38 | 2029 |
| Facilities | 565 | PW Garage 2 | B SHELL C INTERIORS | Rehabilitation Rehabilitation | 5,730.51 | 2029 |
| Facilities | 572 | PW Garage 2 | | Rehabilitation | 3,389.25 | 2029 |
| Facilities | 584 | PW Garage 2 | D SERVICES | Rehabilitation | 3,396.69 | 2029 |
| Facilities | 590 | PW Garage 2 | D SERVICES | Rehabilitation | 2,470.26 | 2029 |
| Facilities | 618 | PW Garage 2 | G SITEWORK | | 1,317.48 | 2029 |
| Facilities | 620 | PW Garage 2 | G SITEWORK | Rehabilitation | 620.45 | 2029 |
| Facilities | 621 | PW Garage 2 | G SITEWORK | Rehabilitation | 1,951.00 | 2029 |
| Facilities | 669 | Railway Museum | D SERVICES | Rehabilitation | 929.05 | 2029 |
| Facilities | 685 | Railway Museum | G SITEWORK | Rehabilitation | 186.13 | 2029 |
| Facilities | 686 | South Firehall | A SUBSTRUCTURE | Rehabilitation | 82,994.80 | 2029 |
| Facilities | 727 | South Firehall | C INTERIORS | Rehabilitation | 4,043.50 | 2029 |
| Facilities | 751 | South Firehall | D SERVICES | Rehabilitation | 2,171.56 | 2029 |
| Facilities | 760 | South Firehall | G SITEWORK | Rehabilitation | 1,148.69 | 2029 |
| | | | | | | |
| | | | | | | |
| Facilities | 4 | CombermereCC | B SHELL | Rehabilitation | 27.447.33 | 2030 |
| Facilities Facilities | • | CombermereCC CombermereCC | B SHELL C INTERIORS | Rehabilitation Rehabilitation | 27,447.33 3.855.91 | |
| Facilities | 20 | CombermereCC | C INTERIORS | Rehabilitation | 3,855.91 | 2030 |
| Facilities Facilities | 20 48 | CombermereCC CombermereCC | C INTERIORS D SERVICES | Rehabilitation Rehabilitation | 3,855.91 1,991.70 | 2030 2030 |
| Facilities Facilities Facilities | 20 48 57 | CombermereCC CombermereCC CombermereCC | C INTERIORS D SERVICES D SERVICES | Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 | 2030 2030 2030 |
| Facilities Facilities Facilities Facilities | 20 48 57 100 | CombermereCC CombermereCC CombermereCC Adrian Museum | C INTERIORS D SERVICES D SERVICES D SERVICES | Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 | 2030 2030 2030 2030 |
| Facilities Facilities Facilities Facilities Facilities | 20 48 57 100 129 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS | Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 | 2030 2030 2030 2030 2030 |
| Facilities Facilities Facilities Facilities Facilities Facilities | 20 48 57 100 129 141 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES | Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 | 2030 2030 2030 2030 2030 2030 |
| Facilities Facilities Facilities Facilities Facilities Facilities Facilities Facilities | 20 48 57 100 129 141 142 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES | Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 | 2030 2030 2030 2030 2030 2030 2030 |
| Facilities Facilities Facilities Facilities Facilities Facilities Facilities Facilities Facilities | 20 48 57 100 129 141 142 168 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere Golden Sears Combermere Golden Sears Combermere Outdoor Rink | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES D SERVICES B SHELL | Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Gutdoor Rink Combermere Outdoor Rink | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES D SERVICES B SHELL B SHELL | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink Combermere Outdoor Rink | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS D SERVICES | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS D SERVICES D SERVICES D SERVICES | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL C INTERIORS D SERVICES D SHEVICES D SHEVICES D SERVICES D SERVICES D SERVICES D SERVICES G STIEWORK | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS D SERVICES D SERVICES D SERVICES G SHELL G STEWORK G SITEWORK | Rehabilitation Maintenance | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS D SERVICES B SHELL S SHELL S SHELL G INTERIORS D SERVICES G SITEWORK B SHEUNCES | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES D SERVICES B SHELL C INTERIORS D SERVICES G STIEWORK G SITEWORK G SITEWORK B SHELL B SHELL B SHELL | Rehabilitation Maintenance Rehabilitation Maintenance | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS D SERVICES D SERVICES G SHELL B SHELL G STIEWORK G STIEWORK B SHELL D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,631.89 5,593.78 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere Golden Years Combermere Golden Years Combermere Golden Years Combermere Outdoor Rink Library Library Library Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS D SERVICES D SERVICES D SERVICES D SERVICES G SITEWORK G SITEWORK B SHELL B SHELL D SHELL D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library Library Library Library Library Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL C INTERIORS D SERVICES G STIEWORK G SITEWORK G SITEWORK G SITEWORK B SHELL D SERVICES D SHELL D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 277 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES B SERVICES B SERVICES D SERVICES C SITEWORK C SITEWORK D SHELL D SHELL D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Maintenance | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,691.89 5,593.78 1,886.97 805.40 8,948.44 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library Library Library Library Library Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL C INTERIORS D SERVICES G STIEWORK G SITEWORK G SITEWORK G SITEWORK B SHELL D SERVICES D SHELL D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere Golden Years Combermere Golden Years Combermere Golden Years Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL B SHELL C INTERIORS D SERVICES D SERVICES G STEWORK G SITEWORK G SITEWORK B SHELL D SERVICES D SERVICES D SERVICES D SERVICES C SITEWORK C SITEWORK D SHELL D SERVICES E EQUIPMENT AND FURN C INTERIORS C INTERIORS | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,699.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 677.56 679.81.23 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 333 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library Library Library Library Library Library Library MissionHouse MissionHouse MissionHouse | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SERVICES B SHELL B SHELL C INTERIORS D SERVICES D SERVICES D SERVICES G SITEWORK G SHEWORK B SHELL B SHELL D SERVICES E EQUIPMENT AND FURN. C INTERIORS D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere Golden Years Combermere Golden Years Combermere Golden Years Combermere Golden Years Combermere Outdoor Rink Library Library Library Library Library Library Library Library Library MissionHouse MissionHouse MissionHouse MissionHouse | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL C INTERIORS D SERVICES D SERVICES D SERVICES D SERVICES G SITEWORK G SITEWORK B SHELL B SHELL B SHELL B SHELL C INTERIORS C SITEWORK C S | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 360 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Lübrary | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES D SERVICES B SERVICES D SERVICES C INTERIORS D SERVICES D SERVIC | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,691.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 369 369 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library Library Library Library Library Library Library MissionHouse MissionHouse MissionHouse MissionHouse MissionHouse Municipal Office Municipal Office | C INTERIORS D SERVICES D SERVICES O SERVICES O SERVICES C INTERIORS D SERVICES B SERVICES D SEQUIPMENT AND FURN D SERVICES D SERVICES D SERVICES D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 360 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere Golden Years Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES D SERVICES B SERVICES D SERVICES C INTERIORS D SERVICES D SERVIC | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 272 277 315 321 333 340 369 369 379 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SERVICES B SERVICES D SERVICES D SERVICES D SERVICES G STEWORK G STIEWORK G STIEWORK B SHELL D SERVICES E EQUIPMENT AND FURN C INTERIORS D SERVICES D SERVICES D SERVICES D SERVICES E EQUIPMENT AND FURN D SERVICES D SIERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,696.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 360 369 379 381 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere Golden Years Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES O SERVICES C INTERIORS D SERVICES B SERVICES D SERVICES C SITEWORK D SHELL D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES C SERVICES D SERVICES E QUIPMENT AND FURN. C INTERIORS | Rehabilitation Maintenance Rehabilitation Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 272 277 315 321 333 340 360 369 379 381 414 426 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere Golden Years Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES G SITEWORK G SITEWORK B SHELL D SHELL D SERVICES D SERVICES D SERVICES D SERVICES C SITEWORK C STITEWORK D SERVICES C INTERIORS G SITEWORK D SHELL | Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 360 369 379 381 414 426 427 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Librar | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SERVICES D SERVICES E COUPMENT AND FURN C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS G SITEWORK B SHELL B SHELL | Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 1,252.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 272 277 315 321 333 340 360 369 379 381 414 426 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere Golden Years Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES O SERVICES C INTERIORS D SERVICES B SERVICES D SERVICES C SITEWORK D SERVICES C SUITERIORS C INTERIORS C STIEWORK D SHELL D | Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 3,096.82 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 360 369 379 381 414 426 427 428 456 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES O SERVICES D SERVICES C INTERIORS D SERVICES D S SERVICES D S S S S S S S S S S S S S S S S S S | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 5,71.12 5,863.22 3,096.82 3,096.82 3,096.82 3,096.82 3,096.82 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 321 333 340 369 379 381 414 426 427 428 456 457 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library Library Library Library Library Library Library MissionHouse MissionH | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SERVICES B SERVICES D SERVICES E EQUIPMENT AND FURN. C INTERIORS D SERVICES D SERVICES C INTERIORS G SITEWORK B SHELL C INTERIORS G SITEWORK B SHELL B | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 315 321 333 340 360 369 379 381 414 426 427 428 456 457 473 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES O SITEWORK O SHELL O SERVICES O SITEWORK O INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS O SITEWORK O SHELL O SERVICES O SITEWORK O SHELL O SERVICES O SHELL O SERVICES O SHELL O SERVICES O SHELL O SERVICES O SHEUCES O SHEUCES O SHEUCES | Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,669.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 3,708.41 508.04 2,359.65 4,343.12 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 227 277 271 272 277 271 333 340 360 369 379 381 414 426 427 428 456 457 473 492 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library L | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES C INTERIORS D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 7272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 3,708.41 508.04 2,359.65 4,343.11 508.04 2,359.65 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 315 333 340 369 379 381 414 426 427 428 456 457 473 492 503 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library MissionHouse Missi | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES D SERVICES B SERVICES D SERVICES E EQUIPMENT AND FURN. C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS G SITEWORK B SHELL D SHELL D SERVICES D SERVICES D SERVICES D SERVICES C SITEWORK D SHELL D SERVICES D SHELL D SERVICES D SERVICES D SERVICES D SITEWORK D SIEUL D SERVICES D SITEWORK D SHELL C INTERIORS | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.12 2,472.28 1,426.02 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 375 321 333 340 360 369 379 381 414 426 427 428 456 457 473 492 503 504 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library MissionHouse MissionHouse MissionHouse MissionHouse MissionHouse MissionHouse MissionHouse MissionHouse MissionHouse Minicipal Office Municipal Office Municipal Office Municipal Office Municipal Office North Firehall PW Garage1 PW Garage1 | C INTERIORS D SERVICES D SERVICES D SERVICES O SERVICES C INTERIORS D SERVICES D SERVICES B SHELL B SHELL D SERVICES D SERVICES D SERVICES G SITEWORK G SHEWORK G SHEWORK D SERVICES C INTERIORS C SERVICES D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES C INTERIORS C INTERIORS C INTERIORS C INTERIORS C SITEWORK D SHELL D SERVICES D SHELL D SERVICES D SHELL D SERVICES C SITEWORK D SHELL D SERVICES D SERVICES D SERVICES D SERVICES C SITEWORK D SHELL C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS | Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,399.65 4,343.12 2,472.28 1,472.28 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 227 277 315 331 340 360 369 379 381 414 426 427 428 426 457 473 492 503 504 533 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES G STIEWORK G STIEWORK D SERVICES C INTERIORS D SERVICES | Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 1,0,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 7,272.61 3,726.61 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.12 2,472.28 1,426.02 1,365.74 935.62 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 315 333 340 369 379 381 414 426 427 428 456 457 473 492 503 504 5533 536 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Library Library Library Library Library Library Library MissionHouse MissionH | C INTERIORS D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES O SERVICES O SERVICES O SERVICES D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES E QUIPMENT AND FURN. C INTERIORS D SERVICES E CQUIPMENT AND FURN. C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS G SITEWORK D SHELL D SERVICES D SHELL D SERVICES D SERVICES O SITEWORK D SHELL D SERVICES O SITEWORK D SHELL D SERVICES O SITEWORK D SHELL C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS D SITEWORK D SHELL D SERVICES O SITEWORK D SHELL C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS D SERVICES D SERVICES D SERVICES | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.12 2,472.28 1,426.02 1,365.74 935.62 4,742.94 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 315 321 333 340 360 369 379 381 414 426 427 428 456 457 473 492 503 504 533 5504 5536 570 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES G STIEWORK G SITEWORK C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS C INTERIORS G SITEWORK G S | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 677.56 7,981.23 772.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 3,708.41 508.04 2,359.65 4,434.31 2,2472.28 1,446.02 1,365.74 935.62 4,742.94 4,825.34 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 277 315 333 340 369 379 381 414 427 428 456 457 473 473 492 503 504 5533 536 570 570 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Librar | C INTERIORS D SERVICES D SERVICES O SERVICES C INTERIORS D SERVICES C INTERIORS D SERVICES D SIEBUL D SHELL D SHELL D SHELL D SHELL D SHELL D SIEBUL D SERVICES | Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,533.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.12 2,472.28 1,426.02 1,365.74 935.62 4,742.94 4,825.34 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 315 321 333 340 369 379 381 414 426 427 428 456 457 473 492 503 504 553 504 570 571 558 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library MissionHouse Missi | C INTERIORS D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES D SERVICES O SERVICES O SERVICES O SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES D SERVICES D SERVICES O SITEWORK O SHELL O SERVICES O SITEWORK O SHELL O SERVICES | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.12 2,472.28 1,426.02 1,365.74 94,825.34 849.44 1,104.90 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 227 277 315 331 340 360 369 381 414 426 427 428 426 427 428 456 457 473 492 503 504 505 507 570 571 588 592 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 3,708.41 508.04 2,359.65 4,434.31 2,2472.28 1,426.02 1,365.74 935.62 4,742.94 4,825.34 849.44 1,104.90 2,330.74 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 227 271 272 277 315 333 340 369 379 379 381 414 426 427 428 456 457 473 473 492 503 504 570 571 588 570 571 588 592 594 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library Librar | C INTERIORS D SERVICES D SERVICES O SERVICES C INTERIORS D SERVICES D SIERVICES D SIERVICES D SIERVICES D SIERVICES D SERVICES | Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,531.89 5,531.89 5,531.89 5,531.89 1,086.97 805.40 8,948.44 672.56 7,981.23 272.61 337.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.12 2,962.35 547.12 5,863.22 3,708.41 508.04 2,359.65 4,343.12 2,472.28 1,426.02 1,365.74 935.62 4,742.94 4,825.34 849.44 1,104.90 2,330.74 162.98 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 315 321 333 340 360 369 379 381 414 426 427 428 456 457 473 492 503 504 533 504 533 504 533 504 533 504 533 504 533 505 570 571 588 592 594 605 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library MissionHouse Missi | C INTERIORS D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES O SERVICES D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES O SERVICES D SERVICES D SERVICES D SERVICES D SERVICES O SERVICES O SERVICES D SERVICES D SERVICES D SERVICES D SERVICES D SERVICES O SITEWORK O SHELL O SERVICES O SITEWORK O SHELL O SERVICES O SITEWORK O SHELL O SERVICES | Rehabilitation | 3,855.91 1,991.70 12,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,396.82 3,708.41 508.04 2,399.65 4,343.12 2,472.28 1,426.02 1,365.74 935.62 4,742.94 4,825.34 849.44 4,104.90 2,330.74 162.98 1,780.04 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 227 271 272 277 315 333 340 360 369 381 414 426 427 428 426 427 428 456 457 473 492 503 504 533 536 570 571 588 592 594 605 608 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES | Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 7272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 3,708.41 508.04 2,359.65 4,343.11 2,472.28 1,426.02 1,365.74 935.62 4,742.94 4,825.34 849.44 1,104.90 2,330.74 162.98 1,780.04 1,780.04 1,780.04 1,780.04 1,780.04 1,780.04 1,780.04 1,780.04 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 229 267 271 272 277 315 333 340 369 379 381 414 426 427 428 456 457 473 492 503 504 553 536 570 571 588 592 594 605 608 6612 | CombermereCC CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library MissionHouse Missi | C INTERIORS D SERVICES D SERVICES O SERVICES C INTERIORS D SERVICES C INTERIORS C INTERIORS C INTERIORS C INTERIORS D SIFELL D SHELL D SHELL D SHELL D SHELL D SHELL D SIFELL D SERVICES D | Rehabilitation Maintenance Rehabilitation Maintenance Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,539.78 1,886.97 805.40 8,948.44 672.56 7,981.23 272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,708.41 508.04 2,395.65 4,343.12 2,472.28 1,426.02 1,365.74 935.62 4,742.94 4,825.34 849.44 1,104.90 2,330.74 162.98 1,780.04 3,282.69 541.24 | 2030 2030 2030 2030 2030 2030 2030 2030 |
| Facilities | 20 48 57 100 129 141 142 168 174 179 201 203 210 212 226 227 271 272 277 315 333 340 360 369 381 414 426 427 428 426 427 428 456 457 473 492 503 504 533 536 570 571 588 592 594 605 608 | CombermereCC CombermereCC CombermereCC Adrian Museum Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere GoldenYears Combermere Outdoor Rink Library | C INTERIORS D SERVICES D SERVICES D SERVICES C INTERIORS D SERVICES | Rehabilitation | 3,855.91 1,991.70 1,262.13 1,085.78 2,547.52 539.13 1,073.87 2,313.55 1,723.04 1,934.80 492.40 2,398.99 1,059.37 10,276.91 2,969.82 2,631.89 5,593.78 1,886.97 805.40 8,948.44 672.56 7,981.23 7272.61 397.26 6,282.02 10,768.98 1,433.01 2,962.35 547.12 5,863.22 3,096.82 3,708.41 508.04 2,359.65 4,343.11 2,472.28 1,426.02 1,365.74 935.62 4,742.94 4,825.34 849.44 1,104.90 2,330.74 162.98 1,780.04 1,780.04 1,780.04 1,780.04 1,780.04 1,780.04 | 2030 2030 2030 2030 2030 2030 2030 2030 |

| Facilities | 695 | South Firehall | B SHELL | Rehabilitation | 4,125.97 | 2030 |
|--------------------------|------------|--|--------------------------|----------------------------------|--------------------------|--------------|
| Facilities | 696 | South Firehall | B SHELL | Reconstruction | 4,600.00 | 2030 |
| Facilities | 700 | South Firehall | B SHELL | Rehabilitation | 6,131.01 | 2030 |
| Facilities | 735 | South Firehall | D SERVICES | Rehabilitation | 1,858.09 | 2030 |
| Facilities | 736 | South Firehall | D SERVICES | Rehabilitation | 741.68 | 2030 |
| Facilities | 753 | South Firehall | D SERVICES | Rehabilitation | 7,416.83 | 2030 |
| racincies | ,55 | Double French | D SERVICED | Trendomedion | 7,120.03 | 2000 |
| | | | | | | |
| Facilities | 58 | CombermereCC | D SERVICES | Rehabilitation | 833.65 | 2031 |
| Facilities | 60 | CombermereCC | D SERVICES | Rehabilitation | 1,131.36 | 2031 |
| Facilities | 99 | Adrian Museum | D SERVICES | Maintenance | 501.31 | 2031 |
| Facilities | 144 | Combermere GoldenYears | D SERVICES | Rehabilitation | 798.34 | 2031 |
| Facilities | 157 | Combermere GoldenYears | E EQUIPMENT AND FURN | Rehabilitation | 1,623.73 | 2031 |
| Facilities | 204 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 271.63 | 2031 |
| Facilities | 374 | Municipal Office | C INTERIORS | Rehabilitation | 11,381.16 | 2031 |
| Facilities | 542 | PW Garage1 | D SERVICES | Rehabilitation | 3,468.86 | 2031 |
| Facilities | 568 | PW Garage 2 | B SHELL | Rehabilitation | 3,764.69 | 2031 |
| Facilities | 595 | PW Garage 2 | D SERVICES | Rehabilitation | 162.37 | 2031 |
| Facilities | 672 | Railway Museum | D SERVICES | Rehabilitation | 841.71 | 2031 |
| Facilities | 701 | South Firehall | B SHELL | Rehabilitation | 36,695.78 | 2031 |
| Facilities | 738 | South Firehall | D SERVICES | Rehabilitation | 1,020.25 | 2031 |
| racincies | 750 | South I licitati | D SERVICES | Renabilitation | 1,020.23 | 2031 |
| | | | | | | |
| Facilities | 65 | CombermereCC | D SERVICES | Rehabilitation | 675.49 | 2032 |
| Facilities | 75 | CombermereCC | G SITEWORK | Rehabilitation | 541.24 | 2032 |
| Facilities | 149 | Combermere GoldenYears | D SERVICES | Rehabilitation | 185.81 | 2032 |
| Facilities | 205 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 405.93 | 2032 |
| Facilities | 243 | Library | C INTERIORS | Rehabilitation | 19,165.71 | 2032 |
| Facilities | 257 | Library | D SERVICES | Rehabilitation | 2,563.03 | 2032 |
| Facilities | 502 | PW Garage1 | C INTERIORS | Rehabilitation | 571.74 | 2032 |
| Facilities | 545 | PW Garage1 | E EQUIPMENT AND FURN | | 1,363.06 | 2032 |
| Facilities | 712 | South Firehall | C INTERIORS | Rehabilitation | 1,640.34 | 2032 |
| Facilities | 741 | South Firehall | D SERVICES | Rehabilitation | 1,635.68 | 2032 |
| Facilities | 762 | South Firehall | | | | |
| racilities | 702 | South Firehali | G SITEWORK | Reconstruction | 3,450.00 | 2032 |
| | | | | | | |
| Facilities | 265 | Library | D SERVICES | Rehabilitation | 2,676.11 | 2033 |
| Facilities | 336 | MissionHouse | D SERVICES | Rehabilitation | 673.92 | 2033 |
| Facilities | 493 | PW Garage1 | B SHELL | Rehabilitation | 3,855.91 | 2033 |
| Facilities | 673 | Railway Museum | D SERVICES | Rehabilitation | 820.67 | 2033 |
| Facilities | 709 | South Firehall | C INTERIORS | Rehabilitation | 1,389.42 | 2033 |
| Facilities | 761 | South Firehall | G SITEWORK | Rehabilitation | 2,750.64 | 2033 |
| racincies | 701 | South Fireham | O SITE WORK | Renabilitation | 2,750.04 | 2033 |
| | | | | | | |
| Facilities | 148 | Combermere GoldenYears | D SERVICES | Rehabilitation | 1,861.34 | 2034 |
| Facilities | 714 | South Firehall | C INTERIORS | Rehabilitation | 1,698.35 | 2034 |
| Facilities | 757 | South Firehall | E EQUIPMENT AND FURN | Rehabilitation | 1,613.74 | 2034 |
| Facilities | 787 | Paul J. Yakabuski Community C | A Substructure | Reconstruction | 58,784.38 | 2034 |
| Facilities | 788 | Paul J. Yakabuski Community C | A Substructure | Reconstruction | 4,216.14 | 2034 |
| Facilities | 790 | Paul J. Yakabuski Community C | | Reconstruction | 1,570.17 | 2034 |
| Facilities | 791 | Paul J. Yakabuski Community C | | Reconstruction | 5,160.52 | 2034 |
| Facilities | 792 | Paul J. Yakabuski Community C | | Reconstruction | 4,405.54 | 2034 |
| Facilities | 793 | Paul J. Yakabuski Community C | | Reconstruction | 50,974.54 | 2034 |
| Facilities | 794 | Paul J. Yakabuski Community C | | Reconstruction | 58,784.38 | 2034 |
| Facilities | 795 | Paul J. Yakabuski Community C | | Reconstruction | 21,433.36 | 2034 |
| Facilities | 796 | | | Reconstruction | | 2034 |
| | | Paul J. Yakabuski Community C | | | 17,437.71 | |
| Facilities | 798 | Paul J. Yakabuski Community C | | Reconstruction | 24,076.69 | 2034 |
| Facilities | 799 | Paul J. Yakabuski Community C | | Reconstruction | 9,984.86 | 2034 |
| Facilities | 800 | Paul J. Yakabuski Community C | | Reconstruction | 55,699.00 | 2034 |
| Facilities | 808 | Paul J. Yakabuski Community C | | Reconstruction | 23,000.00 | 2034 |
| Facilities | 809 | Paul J. Yakabuski Community C | D Services | Reconstruction | 169,050.00 | 2034 |
| Facilities | 810 | Paul J. Yakabuski Community C | | Reconstruction | 23,000.00 | 2034 |
| Facilities | 818 | Paul J. Yakabuski Community C | D Services | Reconstruction | 54,894.84 | 2034 |
| | | | | | | |
| Facilities | 434 | North Firehall | C INTERIORS | Maintenance | 800.16 | 2035 |
| Facilities | 551 | PW Garage1 | G SITEWORK | Rehabilitation | 133.06 | 2035 |
| Facilities | 674 | Railway Museum | D SERVICES | Rehabilitation | 932.30 | 2035 |
| Facilities | | * | D SERVICES | Rehabilitation | 408.92 | 2035 |
| Facilities | 675 743 | Railway Museum South Firehall | D SERVICES D SERVICES | Rehabilitation | 811.86 | 2035 |
| Facilities | 802 | Paul J. Yakabuski Community C | | Reconstruction | 1,281.25 | 2035 |
| Facilities | 803 | | | | | |
| | | Paul J. Yakabuski Community C | | Reconstruction | 4,123.97 | 2035 |
| Facilities Facilities | 812 | Paul J. Yakabuski Community C | | Reconstruction | 10,044.62 | 2035 |
| Facilities | 820 821 | Paul J. Yakabuski Community C Paul J. Yakabuski Community C | | Reconstruction Reconstruction | 126,993.72 118,649.78 | 2035 2035 |
| i aciitics | J21 | . u.a. s. 1 araouski Commulity C | . D GOLVICOS | cconstruction | 110,045.76 | 2000 |
| | | | | | | |
| Facilities | 150 | Combermere GoldenYears | D SERVICES | Rehabilitation | 1,483.37 | 2036 |
| Facilities | 436 | North Firehall | C INTERIORS | Rehabilitation | 573.05 | 2036 |
| Facilities | 596 | PW Garage 2 | D SERVICES | Rehabilitation | 161.74 | 2036 |
| Facilities | 804 | Paul J. Yakabuski Community C | | Reconstruction | 53,590.00 | 2036 |
| Facilities | 805 | Paul J. Yakabuski Community C | | Reconstruction | 71,415.00 | 2036 |
| Facilities | 806 | Paul J. Yakabuski Community C | | Reconstruction | 23,000.00 | 2036 |
| Facilities | 814 | Paul J. Yakabuski Community C | | Reconstruction | 201,042.57 | 2036 |
| Facilities | 815 | Paul J. Yakabuski Community C | | Reconstruction | 48,868.06 | 2036 |
| Facilities | 822 | Paul J. Yakabuski Community C | | Reconstruction | 2,921.24 | 2036 |
| Facilities | 823 | Paul J. Yakabuski Community C | | Reconstruction | 9,402.66 | 2036 |
| Facilities | 824 | Paul J. Yakabuski Community C | | Reconstruction | 115,000.00 | 2036 |
| i aciiicles | 327 | J. 1 akabuski Collillullity C | . D GOLVICO | | 113,000.00 | 2030 |
| | | | | | | |
| Facilities | 9 | CombermereCC | B SHELL | Rehabilitation | 3,788.69 | 2037 |
| Facilities | 74 | CombermereCC | G SITEWORK | Rehabilitation | 10,865.40 | 2037 |
| Facilities | 202 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 3,418.42 | 2037 |
| Facilities | 410 | Municipal Office | E EQUIPMENT AND FURN | | 5,171.69 | 2037 |
| Facilities | 552 | PW Garage1 | G SITEWORK | Rehabilitation | 264.84 | 2037 |
| Facilities | 649 | Railway Museum | C INTERIORS | Rehabilitation | 1,019.01 | 2037 |
| Facilities | 745 | South Firehall | D SERVICES | Rehabilitation | 402.70 | 2037 |
| Facilities | 807 | Paul J. Yakabuski Community C | | Reconstruction | 111,895.00 | 2037 |
| Facilities | 817 | Paul J. Yakabuski Community C | | Reconstruction | 20,352.51 | 2037 |
| Facilities | 825 | Paul J. Yakabuski Community C | | Reconstruction | 110,406.36 | 2037 |
| Facilities | 826 | Paul J. Yakabuski Community C | | Reconstruction | 110,406.36 | 2037 |
| Facilities | 827 | Paul J. Yakabuski Community C | | Reconstruction | | 2037 |
| | | | | | 110,406.36 | |
| Facilities | 828 | Paul J. Yakabuski Community C | . D Services | Reconstruction | 110,406.36 | 2037 |
| | | | | | | |
| | | | | | | |

| Facilities | 830 | Paul J. Yakabuski Community | C E Equipment and Furnishings | Reconstruction | 110,406.36 | 2037 |
|--------------------------|------------|------------------------------------|-------------------------------|----------------------------------|-----------------------|--------------|
| F!!!*! | 0 | CombermereCC | D CHELL | D-h-hilit-ti | 02.255.06 | 2020 |
| Facilities Facilities | 8 43 | CombermereCC | B SHELL D SERVICES | Rehabilitation Rehabilitation | 92,355.86 574.35 | 2038 2038 |
| Facilities | 73 | CombernereCC | G SITEWORK | Rehabilitation | 545.23 | 2038 |
| Facilities | 152 | Combernere GoldenYears | D SERVICES | Rehabilitation | 382.59 | 2038 |
| Facilities | 263 | Library | D SERVICES | Rehabilitation | 414.34 | 2038 |
| Facilities | 343 | MissionHouse | G SITEWORK | Rehabilitation | 9,306.70 | 2038 |
| Facilities | 370 | Municipal Office | C INTERIORS | Rehabilitation | 1,432.63 | 2038 |
| Facilities | 398 | Municipal Office | D SERVICES | Rehabilitation | 310.77 | 2038 |
| Facilities | 406 | Municipal Office | D SERVICES | Rehabilitation | 7,945.26 | 2038 |
| Facilities | 442 | North Firehall | C INTERIORS | Rehabilitation | 4,077.31 | 2038 |
| Facilities | 462 | North Firehall | D SERVICES | Rehabilitation | 3,282.69 | 2038 |
| Facilities | 470 | North Firehall | D SERVICES | Rehabilitation | 158.91 | 2038 |
| Facilities Facilities | 500 501 | PW Garage1 | C INTERIORS | Rehabilitation | 859.58 | 2038 |
| Facilities | 525 | PW Garage1 PW Garage1 | C INTERIORS D SERVICES | Reconstruction Rehabilitation | 1,150.00 2,195.79 | 2038 2038 |
| Facilities | 829 | Paul J. Yakabuski Community | | Reconstruction | 110,406.36 | 2038 |
| Facilities | 831 | | C E Equipment and Furnishings | | 115,000.00 | 2038 |
| Facilities | 832 | | C E Equipment and Furnishings | | 11,869.19 | 2038 |
| Facilities | 833 | Paul J. Yakabuski Community | C E Equipment and Furnishings | Reconstruction | 10,132.73 | 2038 |
| Facilities | 92 | Adrian Museum | C INTERIORS | Rehabilitation | 1,082.48 | 2039 |
| Facilities | 145 | Combermere GoldenYears | D SERVICES | Rehabilitation | 1,589.05 | 2039 |
| Facilities | 599 | PW Garage 2 | D SERVICES | Rehabilitation | 4,790.03 | 2039 |
| Facilities | 678 | Railway Museum | G SITEWORK | Rehabilitation | 2,426.10 | 2039 |
| Facilities | 749 | South Firehall | D SERVICES | Rehabilitation | 4,479.44 | 2039 |
| Facilities | 834 | | C E Equipment and Furnishings | Reconstruction | 117,241.45 | 2039 |
| Facilities | 835 | Paul J. Yakabuski Community | C E Equipment and Furnishings | Reconstruction | 135,204.07 | 2039 |
| Facilities | 7 | CombermereCC | B SHELL | Rehabilitation | 39,528.84 | 2040 |
| Facilities | 23 | CombernereCC | C INTERIORS | Rehabilitation | 4,661.49 | 2040 |
| Facilities | 62 | CombermereCC | D SERVICES | Rehabilitation | 613.23 | 2040 |
| Facilities | 70 | CombermereCC | G SITEWORK | Rehabilitation | 1,097.89 | 2040 |
| Facilities | 208 | Combermere Outdoor Rink | E Equipment and Furnishings | | 1,603.91 | 2040 |
| Facilities | 395 | Municipal Office | D SERVICES | Rehabilitation | 3,717.38 | 2040 |
| Facilities | 461 | North Firehall | D SERVICES | Rehabilitation | 11,527.88 | 2040 |
| Facilities | 600 | PW Garage 2 | D SERVICES | Rehabilitation | 3,972.63 | 2040 |
| Facilities | 717 | South Firehall | C INTERIORS | Rehabilitation | 1,887.72 | 2040 |
| Facilities | 719 | South Firehall | C INTERIORS | Rehabilitation | 8,535.35 | 2040 |
| Facilities | 722 | South Firehall | C INTERIORS | Rehabilitation | 7,933.18 | 2040 |
| Facilities | 6 | CombermereCC | B SHELL | Rehabilitation | 31,076.57 | 2041 |
| Facilities | 14 | CombermereCC | C INTERIORS | Rehabilitation | 2,118.74 | 2041 |
| Facilities | 61 | CombermereCC | D SERVICES | Rehabilitation | 2,050.42 | 2041 |
| Facilities | 136 | Combermere GoldenYears | C INTERIORS | Rehabilitation | 5,129.21 | 2041 |
| Facilities | 326 | MissionHouse | D SERVICES | Rehabilitation | 1,730.41 | 2041 |
| Facilities Facilities | 327 460 | MissionHouse North Firehall | D SERVICES | Reconstruction | 1,150.00 | 2041 2041 |
| Facilities | 528 | PW Garage1 | D SERVICES D SERVICES | Rehabilitation Rehabilitation | 4,956.51 4,089.19 | 2041 |
| Facilities | 530 | PW Garage1 | D SERVICES D SERVICES | Rehabilitation | 1,217.79 | 2041 |
| Facilities | 591 | PW Garage 2 | D SERVICES | Rehabilitation | 6,565.39 | 2041 |
| Facilities | 658 | Railway Museum | C INTERIORS | Rehabilitation | 10,277.50 | 2041 |
| Facilities | 716 | South Firehall | C INTERIORS | Rehabilitation | 506.62 | 2041 |
| Facilities | 721 | South Firehall | C INTERIORS | Rehabilitation | 7,300.99 | 2041 |
| Facilities | 5 | CombermereCC | B SHELL | Rehabilitation | 8,753.85 | 2042 |
| Facilities | 102 | Adrian Museum | D SERVICES | Rehabilitation | 296.67 | 2042 |
| Facilities | 334 | MissionHouse | D SERVICES | Rehabilitation | 2,716.35 | 2042 |
| Facilities | 350 | Municipal Office | B SHELL | Rehabilitation | 73,278.30 | 2042 |
| Facilities | 625 | Railway Museum | B SHELL | Rehabilitation | 32,151.62 | 2042 |
| Facilities | 646 | Railway Museum | C INTERIORS | Rehabilitation | 8,502.34 | 2042 |
| Facilities | 657 | Railway Museum | C INTERIORS | Rehabilitation | 8,763.59 | 2042 |
| Facilities | 660 | Railway Museum | D SERVICES | Rehabilitation | 405.93 | 2042 |
| Facilities | 720 | South Firehall South Firehall | C INTERIORS | Rehabilitation Rehabilitation | 2,202.89 | 2042 |
| Facilities Facilities | 724 797 | Paul J. Yakabuski Community | C INTERIORS C B Shell | Reconstruction | 21,263.79 8,926.54 | 2042 2042 |
| | | | | | | |
| Facilities | 101 | Adrian Museum | D SERVICES | Rehabilitation | 154.84 | 2043 |
| Facilities | 146 | Combermere GoldenYears | D SERVICES | Rehabilitation | 4,347.69 | 2043 |
| Facilities | 167 | Combernere Outdoor Rink | B SHELL D CERVICES | Rehabilitation | 4,450.10 | 2043 |
| Facilities | 196 197 | Combermere Outdoor Rink | D SERVICES | Rehabilitation Reconstruction | 629.24 | 2043 |
| Facilities Facilities | 197 246 | Combermere Outdoor Rink Library | D SERVICES C INTERIORS | Reconstruction Rehabilitation | 5,750.00 10,759.57 | 2043 2043 |
| Facilities | 305 | MissionHouse | B SHELL | Rehabilitation | 1,432.63 | 2043 |
| Facilities | 325 | MissionHouse | C INTERIORS | Rehabilitation | 13,208.97 | 2043 |
| Facilities | 376 | Municipal Office | C INTERIORS | Rehabilitation | 5,662.93 | 2043 |
| Facilities | 440 | North Firehall | C INTERIORS | Rehabilitation | 495.08 | 2043 |
| Facilities | 521 | PW Garage1 | D SERVICES | Rehabilitation | 1,573.10 | 2043 |
| Facilities | 522 | PW Garage1 | D SERVICES | Reconstruction | 4,025.00 | 2043 |
| Facilities | 581 | PW Garage 2 | C INTERIORS | Rehabilitation | 8,913.74 | 2043 |
| Facilities | 589 | PW Garage 2 | D SERVICES | Rehabilitation | 4,130.42 | 2043 |
| Facilities | 636 | Railway Museum | B SHELL C INTERIORS | Rehabilitation | 21,235.99 | 2043 |
| Facilities Facilities | 651 715 | Railway Museum South Firehall | C INTERIORS C INTERIORS | Rehabilitation Rehabilitation | 7,708.17 338.69 | 2043 2043 |
| Facilities | 715 | South Firehall | C INTERIORS C INTERIORS | Reconstruction | 64,032.00 | 2043 |
| Facilities | 731 | South Firehall | C INTERIORS | Rehabilitation | 158.91 | 2043 |
| Facilities | 801 | Paul J. Yakabuski Community | | Reconstruction | 52,039.38 | 2043 |
| Facilities | 811 | Paul J. Yakabuski Community | | Reconstruction | 11,765.98 | 2043 |
| Facilities | 819 | Paul J. Yakabuski Community | | Reconstruction | 22,765.48 | 2043 |
| Facilities | 3 | CombermereCC | B SHELL | Rehabilitation | 16,521.69 | 2044 |
| Facilities | 118 | Combermere GoldenYears | B SHELL | Rehabilitation | 845.15 | 2044 |
| Facilities | 128 | Combermere GoldenYears | C INTERIORS | Rehabilitation | 4,088.20 | 2044 |
| Facilities | 151 | Combermere GoldenYears | D SERVICES | Rehabilitation | 385.59 | 2044 |
| Facilities | 187 | Combermere Outdoor Rink | C INTERIORS | Reconstruction | 6,727.50 | 2044 |

| Facilities | 194 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 2,717.35 | 2044 |
|------------|------------|--------------------------------------|--------------------|----------------------------------|-----------------------|--------------|
| Facilities | 279 | Library | G SITEWORK | Rehabilitation | 929.05 | 2044 |
| | | | | | | |
| Facilities | 322 | MissionHouse | C INTERIORS | Rehabilitation | 1,312.27 | 2044 |
| Facilities | 324 | MissionHouse | C INTERIORS | Rehabilitation | 978.25 | 2044 |
| Facilities | 332 | MissionHouse | D SERVICES | Rehabilitation | 186.46 | 2044 |
| Facilities | 389 | Municipal Office | D SERVICES | Rehabilitation | 2,377.69 | 2044 |
| Facilities | 455 | North Firehall | D SERVICES | Rehabilitation | 12,907.44 | 2044 |
| Facilities | 511 | PW Garage1 | C INTERIORS | Rehabilitation | 1,106.69 | 2044 |
| Facilities | 520 | PW Garage1 | D SERVICES | Rehabilitation | 677.38 | 2044 |
| Facilities | 575 | PW Garage 2 | C INTERIORS | Rehabilitation | 3,923.25 | 2044 |
| Facilities | 607 | | | Rehabilitation | | 2044 |
| | | PW Garage 2 | D SERVICES | | 2,295.57 | |
| Facilities | 645 | Railway Museum | C INTERIORS | Rehabilitation | 3,302.26 | 2044 |
| Facilities | 647 | Railway Museum | C INTERIORS | Rehabilitation | 2,050.42 | 2044 |
| Facilities | 650 | Railway Museum | C INTERIORS | Rehabilitation | 14,733.08 | 2044 |
| Facilities | 705 | South Firehall | C INTERIORS | Rehabilitation | 4,550.97 | 2044 |
| Facilities | 713 | South Firehall | C INTERIORS | Rehabilitation | 1,703.42 | 2044 |
| Facilities | 769 | Wooden Water Tower | B SHELL | Rehabilitation | 53,582.46 | 2044 |
| Facilities | 782 | Wooden Water Tower | G SITEWORK | Rehabilitation | 2,202.34 | 2044 |
| | | | | | _, | |
| | | | | | | |
| Facilities | 31 | CombermereCC | C INTERIORS | Rehabilitation | 10.069.63 | 2045 |
| | | | | | 19,068.63 | |
| Facilities | 117 | Combermere GoldenYears | B SHELL | Rehabilitation | 33,892.53 | 2045 |
| Facilities | 119 | Combermere GoldenYears | B SHELL | Rehabilitation | 53,386.47 | 2045 |
| Facilities | 166 | Combermere Outdoor Rink | B SHELL | Rehabilitation | 52,026.59 | 2045 |
| Facilities | 244 | Library | C INTERIORS | Rehabilitation | 1,024.30 | 2045 |
| Facilities | 248 | Library | D SERVICES | Rehabilitation | 25,354.48 | 2045 |
| Facilities | 306 | MissionHouse | B SHELL | Reconstruction | 1,725.00 | 2045 |
| Facilities | 330 | MissionHouse | D SERVICES | Rehabilitation | 2,744.73 | 2045 |
| Facilities | 373 | Municipal Office | C INTERIORS | Rehabilitation | 5,704.08 | 2045 |
| Facilities | | North Firehall | | Rehabilitation | | |
| | 439 | | C INTERIORS | | 14,260.20 | 2045 |
| Facilities | 441 | North Firehall | C INTERIORS | Rehabilitation | 1,907.43 | 2045 |
| Facilities | 483 | PW Garage1 | B SHELL | Rehabilitation | 11,052.24 | 2045 |
| Facilities | 557 | PW Garage 2 | B SHELL | Rehabilitation | 6,007.63 | 2045 |
| Facilities | 574 | PW Garage 2 | C INTERIORS | Rehabilitation | 6,743.55 | 2045 |
| Facilities | 634 | Railway Museum | B SHELL | Rehabilitation | 3,414.35 | 2045 |
| | | Railway Museum | | | | |
| Facilities | 654 | | C INTERIORS | Rehabilitation | 330.43 | 2045 |
| Facilities | 655 | Railway Museum | C INTERIORS | Rehabilitation | 10,375.09 | 2045 |
| Facilities | 664 | Railway Museum | D SERVICES | Rehabilitation | 3,193.36 | 2045 |
| Facilities | 665 | Railway Museum | D SERVICES | Rehabilitation | 2,648.42 | 2045 |
| Facilities | 679 | Railway Museum | G SITEWORK | Rehabilitation | 805.40 | 2045 |
| Facilities | 704 | South Firehall | B SHELL | Rehabilitation | 1,966.87 | 2045 |
| Facilities | 732 | South Firehall | C INTERIORS | Rehabilitation | 671.92 | 2045 |
| | 744 | South Firehall | | | | |
| Facilities | | | D SERVICES | Rehabilitation | 8,087.01 | 2045 |
| Facilities | 768 | Wooden Water Tower | B SHELL | Rehabilitation | 32,056.69 | 2045 |
| | | | | | | |
| | | | | | | |
| Facilities | 40 | CombermereCC | D SERVICES | Rehabilitation | 23,053.44 | 2046 |
| Facilities | 127 | Combermere GoldenYears | C INTERIORS | Rehabilitation | 738.15 | 2046 |
| Facilities | 169 | Combermere Outdoor Rink | B SHELL | Rehabilitation | 2,295.57 | 2046 |
| Facilities | 186 | Combermere Outdoor Rink | C INTERIORS | Rehabilitation | 754.56 | 2046 |
| Facilities | 193 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 1,362.73 | 2046 |
| Facilities | 323 | MissionHouse | C INTERIORS | Rehabilitation | 1,185.58 | 2046 |
| | 341 | | | | | |
| Facilities | | MissionHouse | G SITEWORK | Rehabilitation | 9,296.16 | 2046 |
| Facilities | 349 | Municipal Office | A SUBSTRUCTURE | Rehabilitation | 83,533.83 | 2046 |
| Facilities | 351 | Municipal Office | B SHELL | Rehabilitation | 1,086.54 | 2046 |
| Facilities | 387 | Municipal Office | D SERVICES | Rehabilitation | 13,669.49 | 2046 |
| Facilities | 407 | Municipal Office | D SERVICES | Rehabilitation | 2,634.96 | 2046 |
| Facilities | 454 | North Firehall | D SERVICES | Rehabilitation | 11,242.55 | 2046 |
| Facilities | 482 | PW Garage1 | B SHELL | Rehabilitation | 2,706.21 | 2046 |
| Facilities | 510 | PW Garage1 | C INTERIORS | Rehabilitation | 22,429.76 | 2046 |
| Facilities | 519 | | | Rehabilitation | | 2046 |
| | | PW Garage1 | D SERVICES | | 2,038.02 | |
| Facilities | 523 | PW Garage1 | D SERVICES | Rehabilitation | 5,524.50 | 2046 |
| Facilities | 559 | PW Garage 2 | B SHELL | Rehabilitation | 81,620.26 | 2046 |
| Facilities | 576 | PW Garage 2 | C INTERIORS | Rehabilitation | 335.36 | 2046 |
| Facilities | 582 | PW Garage 2 | C INTERIORS | Rehabilitation | 93,977.78 | 2046 |
| Facilities | 606 | PW Garage 2 | D SERVICES | Rehabilitation | 1,799.42 | 2046 |
| Facilities | 644 | Railway Museum | C INTERIORS | Rehabilitation | 1,778.46 | 2046 |
| Facilities | 656 | Railway Museum | C INTERIORS | Rehabilitation | 12,036.55 | 2046 |
| Facilities | 677 | Railway Museum | G SITEWORK | Rehabilitation | 1,082.48 | 2046 |
| | | | | | | |
| Facilities | 711 | South Firehall | C INTERIORS | Rehabilitation | 1,645.61 | 2046 |
| Facilities | 740 | South Firehall | D SERVICES | Rehabilitation | 3,729.19 | 2046 |
| Facilities | 771 | Wooden Water Tower | B SHELL | Rehabilitation | 6,445.33 | 2046 |
| Facilities | 781 | Wooden Water Tower | G SITEWORK | Rehabilitation | 541.91 | 2046 |
| | | | | | | |
| | | | | | | |
| Facilities | 10 | CombermereCC | B SHELL | Rehabilitation | 6,847.00 | 2047 |
| Facilities | 30 | CombermereCC | C INTERIORS | Rehabilitation | 4,949.70 | 2047 |
| Facilities | 36 | CombermereCC | C INTERIORS | Rehabilitation | 7,802.50 | 2047 |
| Facilities | 45 | CombermereCC | D SERVICES | Reconstruction | 1,150.00 | 2047 |
| Facilities | 76 | CombermereCC | G SITEWORK | Rehabilitation | | 2047 |
| | | | | | 134.78 | |
| Facilities | 116 | Combernere GoldenYears | B SHELL | Rehabilitation | 25,483.18 | 2047 |
| Facilities | 185 | Combermere Outdoor Rink | C INTERIORS | Rehabilitation | 1,401.16 | 2047 |
| Facilities | 206 | Combermere Outdoor Rink | D SERVICES | Rehabilitation | 539.13 | 2047 |
| Facilities | 228 | Library | B SHELL | Rehabilitation | 1,612.60 | 2047 |
| Facilities | 241 | Library | C INTERIORS | Reconstruction | 1,380.00 | 2047 |
| Facilities | 258 | Library | D SERVICES | Rehabilitation | 511.02 | 2047 |
| Facilities | 294 | MissionHouse | B SHELL | Maintenance | 3,759.85 | 2047 |
| | | | | | | |
| Facilities | 314 | MissionHouse | C INTERIORS | Rehabilitation | 11,239.26 | 2047 |
| Facilities | 386 | Municipal Office | D SERVICES | Rehabilitation | 30,855.26 | 2047 |
| Facilities | 403 | Municipal Office | D SERVICES | Rehabilitation | 1,879.28 | 2047 |
| Facilities | 425 | North Firehall | B SHELL | Maintenance | 100.26 | 2047 |
| Facilities | 429 | North Firehall | B SHELL | Rehabilitation | 18,508.37 | 2047 |
| Facilities | 484 | PW Garage1 | B SHELL | Rehabilitation | 91,399.96 | 2047 |
| | | | | | | |
| Facilities | 508 | PW Garage1 | C INTERIORS | Rehabilitation | 608.51 | 2047 |
| Facilities | 518 | PW Garage1 | D SERVICES | Rehabilitation | 681.37 | 2047 |
| Facilities | 569 | PW Garage 2 | C INTERIORS | Rehabilitation | 1,138.12 | 2047 |
| Facilities | 583 | PW Garage 2 | D SERVICES | Rehabilitation | 17,034.17 | 2047 |
| Facilities | 680 | Railway Museum | G SITEWORK | Rehabilitation | 801.96 | 2047 |
| Facilities | | | | | | |
| | 699 | South Firehall | B SHELI. | Rehabilitation | 3.414 35 | 2047 |
| Facilities | 699 766 | South Firehall Wooden Water Tower | B SHELL B SHELL | Rehabilitation Rehabilitation | 3,414.35 35.196.56 | 2047 2047 |
| Facilities | 699 766 | South Firehall Wooden Water Tower | B SHELL B SHELL | Rehabilitation Rehabilitation | 3,414.35 35,196.56 | 2047 2047 |

| Asset | | | Treatment | Forecast | Forecast |
|-------|----------|-------------------------|----------------|-----------|----------|
| Class | Asset ID | Description | Description | Cost (\$) | Year |
| fire | 1 | Misc Equipment | Maintenance | 12,500.00 | 2024 |
| fire | 5 | Communication Equipment | Reconstruction | 4,105.50 | 2024 |
| fire | 6 | Communication Equipment | Reconstruction | 4,105.50 | 2024 |
| fire | 9 | Uniform | Reconstruction | 8,211.00 | 2026 |
| fire | 10 | Uniform | Reconstruction | 8,211.00 | 2026 |
| c | | | | 44.075.00 | 2027 |
| fire | 8 | Turnout (Bunker) Gear | Reconstruction | 14,076.00 | 2027 |
| fire | 11 | Oxygen tanks | Reconstruction | 8,879.36 | 2029 |
| fire | 2 | Misc Equipment | Maintenance | 12,500.00 | 2030 |
| fire | 12 | Oxygen tanks | Reconstruction | 15,105.24 | 2030 |
| fire | 1 | Misc Equipment | Maintenance | 12,500.00 | 2031 |
| fire | 3 | Extracation Equipment | Reconstruction | 58,650.00 | 2031 |
| fire | 7 | Turnout (Bunker) Gear | Reconstruction | 14,076.00 | 2033 |
| | | | | | |
| fire | 5 | Communication Equipment | Reconstruction | 4,105.50 | 2036 |
| fire | 6 | Communication Equipment | Reconstruction | 4,105.50 | 2036 |
| fire | 2 | Misc Equipment | Maintenance | 12,500.00 | 2037 |
| fire | 1 | Misc Equipment | Maintenance | 12,500.00 | 2038 |
| fire | 9 | Uniform | Reconstruction | 8,211.00 | 2038 |
| fire | 10 | Uniform | Reconstruction | 8,211.00 | 2038 |
| fire | 8 | Turnout (Bunker) Gear | Reconstruction | 14,076.00 | 2039 |
| fire | 4 | Extracation Equipment | Reconstruction | 58,650.00 | 2040 |
| fire | 11 | Oxygen tanks | Reconstruction | 8,879.36 | 2041 |
| fire | 12 | Oxygen tanks | Reconstruction | 15,105.24 | 2042 |
| fire | 2 | Misc Equipment | Maintenance | 12,500.00 | 2044 |
| fire | 1 | Misc Equipment | Maintenance | 12,500.00 | 2045 |
| fire | 7 | Turnout (Bunker) Gear | Reconstruction | 14,076.00 | 2045 |
| fire | 3 | Extracation Equipment | Reconstruction | 58,650.00 | 2048 |
| fire | 5 | Communication Equipment | Reconstruction | 4,105.50 | 2048 |
| fire | 6 | Communication Equipment | Reconstruction | 4,105.50 | 2048 |

| Asset | | | | Treatment | Forecast | Forecast |
|----------------|----------|----------------|-----------------------|-------------------------------|-----------------------|--------------|
| Class | Asset ID | Description | Location | Description | Cost (\$) | Year |
| Fleet | 5 | EQ017 | Vehicles | Reconstruction | 17,595.00 | 2024 |
| Fleet | 6 | EQ018 | Vehicles | Reconstruction | 42,064.68 | 2024 |
| Fleet | 23 | EQ050 | Vehicles | Reconstruction | 76,245.00 | 2024 |
| Fleet | 24 | EQ051 | Vehicles | Reconstruction | 82,124.10 | 2024 |
| Fleet | 29 | EQ059 | Vehicles | Reconstruction | 44,519.44 | 2024 |
| Fleet | 34 | EQ064 | Vehicles | Reconstruction | 29,473.81 | 2024 |
| | | | | | | |
| Fleet | 7 | EQ020 | Vehicles | Reconstruction | 207,653.84 | 2025 |
| Fleet | 16 | EQ041 | Vehicles | Reconstruction | 71,196.49 | 2025 |
| Fleet | 32 | EQ062 | Vehicles | Rehabilitation | 35,016.41 | 2025 |
| Fleet | 33 | EQ063 | Vehicles | Maintenance | 35,344.05 | 2025 |
| | | | | | | |
| Fleet | 9 | EQ023 | Vehicles | Reconstruction | 277,417.21 | 2026 |
| Fleet | 10 | EQ027 | Vehicles | Reconstruction | 39,494.43 | 2026 |
| Fleet | 25 | EQ052 | Vehicles | Maintenance | 13,912.95 | 2026 |
| | | | | | | |
| Fleet | 1 | EQ006 | Vehicles | Reconstruction | 287,500.00 | 2027 |
| Fleet | 35 | EQ065 | Vehicles | Rehabilitation | 20,634.55 | 2027 |
| | | | | | | |
| Fleet | 12 | EQ036 | Vehicles | Reconstruction | 164,024.01 | 2028 |
| Fleet | 15 | EQ030 EQ040 | Vehicles | Reconstruction | 44,329.31 | 2028 |
| Fleet | 39 | EQ069 | Vehicles | Maintenance | 57,596.82 | 2028 |
| ricct | 33 | 2000 | Venices | Wallteflatice | 37,330.02 | 2020 |
| Floor | 4 | F0014 | V.1.1.1. | Doogoatuustiaa | 00 562 01 | 2020 |
| Fleet Fleet | 4 19 | EQ014 EQ045 | Vehicles Vehicles | Reconstruction Reconstruction | 90,562.01 5,750.00 | 2029 2029 |
| Fleet | 31 | EQ043 EQ061 | Vehicles | Reconstruction | 263,355.58 | 2029 |
| rieet | 31 | LQ001 | Venicles | Reconstruction | 203,333.36 | 2023 |
| Floor | 0 | E0021 | V.1.1 | D | 207.652.04 | 2020 |
| Fleet | 8 18 | EQ021 | Vehicles | Reconstruction | 207,653.84 | 2030 2030 |
| Fleet | 10 | EQ044 | Vehicles | Reconstruction | 85,215.89 | 2030 |
| -1 . | | F0011 | ***** | | 0.40 === 4.0 | 2001 |
| Fleet | 3 | EQ011 | Vehicles | Reconstruction | 248,576.18 | 2031 |
| | | | | | | |
| Fleet | 27 | EQ055 | Vehicles | Maintenance | 5,750.00 | 2032 |
| Fleet | 28 | EQ057 | Vehicles | Reconstruction | 412,197.31 | 2032 |
| | | | | | | |
| Fleet | 30 | EQ060 | Vehicles | Maintenance | 68,888.82 | 2033 |
| Fleet | 43 | EQ074 | Vehicles | Reconstruction | 287,817.85 | 2033 |
| | | | | | | |
| Fleet | 44 | EQ076 | Vehicles | Rehabilitation | 262,285.54 | 2034 |
| Fleet | 64 | EQ090 | Vehicles | Reconstruction | 69,802.00 | 2034 |
| Fleet | 69 | MAC2102 | Machinery & Equipment | Reconstruction | 11,000.00 | 2034 |
| | | | | | , | |
| Fleet | 13 | EQ038 | Vehicles | Reconstruction | 224,843.98 | 2035 |
| Fleet | 36 | EQ038 EQ066 | Vehicles | Reconstruction | 97,280.49 | 2035 |
| ricet | 50 | £2000 | · cincles | Acconstruction | 57,200.49 | 2033 |
| Eleat | วา | E0049 | Val.:alaa | Pacanetrustia = | 220 000 74 | 2020 |
| Fleet | 22 | EQ048 | Vehicles | Reconstruction | 330,908.71 | 2036 |
| | | | | | | |
| Fleet | 6 | EQ018 | Vehicles | Reconstruction | 42,064.68 | 2037 |
| Fleet | 29 | EQ059 | Vehicles | Reconstruction | 44,519.44 | 2037 |
| Fleet | 34 | EQ064 | Vehicles | Reconstruction | 29,473.81 | 2037 |

| Fleet | 51 | MAC10 | Machinery & Equipment | Maintenance | 22,053.95 | 2037 |
|-------|---------|----------------|--|-------------------------------|------------|------|
| Fleet | 65 | EQ091 | Vehicles | Reconstruction | 37,604.00 | 2037 |
| Fleet | 66 | EQ091 EQ092 | Vehicles | Reconstruction | 60,497.00 | 2037 |
| Fleet | 68 | EQ092 EQ094 | Vehicles | Reconstruction | 61,844.00 | 2037 |
| rieet | 00 | EQ094 | venicles | Reconstruction | 01,844.00 | 2037 |
| Fleet | 20 | EQ046 | Vehicles | Reconstruction | 278,529.79 | 2038 |
| Fleet | 52 | MAC71 | Machinery & Equipment | Reconstruction | 39,440.08 | 2038 |
| Fleet | 53 | MAC72 | Machinery & Equipment | Reconstruction | 34,646.06 | 2038 |
| rieet | 33 | MAC/2 | Machinery & Equipment | Reconstruction | 34,040.00 | 2036 |
| Fleet | 14 | EO039 | Vehicles | Reconstruction | 125,260.03 | 2039 |
| Fleet | 21 | EQ047 | Vehicles | Reconstruction | 203,931.35 | 2039 |
| | | 240.11 | , cincies | | 200,502.00 | 2005 |
| Fleet | 7 | EQ020 | Vehicles | Reconstruction | 207,653.84 | 2040 |
| Fleet | 35 | EQ065 | Vehicles | Rehabilitation | 20,634.55 | 2040 |
| Fleet | 48 | EQ081 | Vehicles | Maintenance | 48,569.46 | 2040 |
| Fleet | 54 | MAC74 | Machinery & Equipment | Rehabilitation | 22,892.37 | 2040 |
| Fleet | 55 | MAC75 | Machinery & Equipment | Rehabilitation | 20,566.84 | 2040 |
| | | | | | | |
| Fleet | 1 | EQ006 | Vehicles | Reconstruction | 287,500.00 | 2041 |
| Floor | 27 | E0067 | Validae | Doognotyvetion | 260 175 24 | 2042 |
| Fleet | 37 | EQ067 | Vehicles | Reconstruction | 360,175.24 | 2042 |
| Fleet | 24 | EQ051 | Vehicles | Reconstruction | 82,124.10 | 2043 |
| Fleet | 41 | EQ072 | Vehicles | Reconstruction | 231,017.28 | 2043 |
| Fleet | 56 | MAC76 | Machinery & Equipment | Reconstruction | 19,186.86 | 2043 |
| | | MIIO, O | nationally to Equipment | | 23,250.65 | 20.0 |
| Fleet | 31 | EQ061 | Vehicles | Reconstruction | 263,355.58 | 2044 |
| Fleet | 45 | EQ078 | Vehicles | Maintenance | 50,597.54 | 2044 |
| Fleet | 58 | MAC78 | Machinery & Equipment | Rehabilitation | 9,191.21 | 2044 |
| | | | | | | |
| Fleet | 40 | EQ070 | Vehicles | Reconstruction | 276,860.46 | 2045 |
| Fleet | 50 | EQ083 | Vehicles | Rehabilitation | 32,184.77 | 2045 |
| Fleet | 57 | MAC77 | Machinery & Equipment | Reconstruction | 15,460.66 | 2045 |
| | | | | | | |
| Fleet | 43 | EQ074 | Vehicles | Reconstruction | 287,817.85 | 2046 |
| Fleet | 67 | EQ093 | Vehicles | Reconstruction | 25,950.00 | 2046 |
| Fleet | 69 | MAC2102 | Machinery & Equipment | Reconstruction | 11,000.00 | 2046 |
| Elec+ | 2 | EQ009 | Vehicles | Reconstruction | 17,595.00 | 2047 |
| Fleet | 2 46 | * | | | | |
| Fleet | 64 | EQ079 | Vehicles Vehicles | Reconstruction Reconstruction | 234,340.50 | 2047 |
| Fleet | 04 | EQ090 | venicles | Reconstruction | 69,802.00 | 2047 |
| Fleet | 44 | EQ076 | Vehicles | Rehabilitation | 262,285.54 | 2048 |
| Fleet | 59 | MAC37 | Vehicles | Reconstruction | 24,150.00 | 2048 |
| Fleet | 60 | MAC87 | Vehicles | Reconstruction | 12,075.00 | 2048 |
| Fleet | 61 | TBD 1 | Vehicles | Rehabilitation | 10,925.00 | 2048 |
| Fleet | 70 | MAC2180 | Machinery & Equipment | Reconstruction | 23,000.00 | 2048 |
| | . 3 | | and the second s | | 25,000.00 | _0.0 |
| Fleet | 16 | EQ041 | Vehicles | Reconstruction | 71,196.49 | 2049 |
| Fleet | 36 | EQ066 | Vehicles | Reconstruction | 97,280.49 | 2049 |
| Fleet | 38 | EQ085 | Vehicles | Reconstruction | 115,000.00 | 2049 |
| Fleet | 62 | EQ086 | Vehicles | Reconstruction | 25,300.00 | 2049 |
| | | | | | | |

| Asset | 4 | 5 | | Treatment | Forecast | Forecast |
|----------------------|----------|--------------------|----------|----------------|-----------|----------|
| Class | Asset ID | Description | Location | Description | Cost (\$) | Year |
| IT IT | IT1 | General Government | Software | Reconstruction | 10,409.53 | 2024 |
| IT IT | IT4 | General Government | Hardware | Reconstruction | 11,610.63 | 2024 |
| IT | IT8 | Library | Software | Reconstruction | 17,158.57 | 2024 |
| IT | IT5 | General Government | Hardware | Reconstruction | 19,087.76 | 2025 |
| IT | IT7 | Library | Hardware | Reconstruction | 14,968.44 | 2025 |
| IT | IT3 | General Government | Hardware | Reconstruction | 21,849.30 | 2027 |
| IT | IT2 | General Government | Hardware | Reconstruction | 9,384.13 | 2029 |
| IT | IT6 | General Government | Hardware | Reconstruction | 10,171.11 | 2030 |
| IT | IT4 | General Government | Hardware | Reconstruction | 11,610.63 | 2032 |
| IT | IT9 | General Government | Software | Reconstruction | 46,920.00 | 2032 |
| IT | IT1 | General Government | Software | Reconstruction | 10,409.53 | 2036 |
| IT | IT3 | General Government | Hardware | Reconstruction | 21,849.30 | 2036 |
| IT | IT8 | Library | Software | Reconstruction | 17,158.57 | 2036 |
| IT | IT5 | General Government | Hardware | Reconstruction | 19,087.76 | 2037 |
| IT | IT7 | Library | Hardware | Reconstruction | 14,968.44 | 2037 |
| IT | IT4 | General Government | Hardware | Reconstruction | 11,610.63 | 2040 |
| IT | IT2 | General Government | Hardware | Reconstruction | 9,384.13 | 2041 |
| IT | IT6 | General Government | Hardware | Reconstruction | 10,171.11 | 2042 |
| IT | IT9 | General Government | Software | Reconstruction | 46,920.00 | 2044 |
| IT | IT3 | General Government | Hardware | Reconstruction | 21,849.30 | 2045 |
| IT | IT1 | General Government | Software | Reconstruction | 10,409.53 | 2048 |
| IT . - | IT4 | General Government | Hardware | Reconstruction | 11,610.63 | 2048 |
| IT | IT8 | Library | Software | Reconstruction | 17,158.57 | 2048 |
| IT | IT5 | General Government | Hardware | Reconstruction | 19,087.76 | 2049 |
| IT | IT7 | Library | Hardware | Reconstruction | 14,968.44 | 2049 |
| | | | | | | |

| Asset | | | | Treatment | Forecast | Forecast |
|-------|----------|----------------------------------|-------------------------------|------------------|------------|----------|
| Class | Asset ID | Description | Location | Description | Cost (\$) | Year |
| Parks | 1 | Playground Equipment | Mill St., Combermere | Reconstruction | 138,000.00 | 2024 |
| | | | | | | |
| Parks | 4 | Life Size Stuatue-Zurakowski pa | a Opeongo Line | Maintenance | 865.07 | 2025 |
| Parks | 5 | 1.4 scale model Avro Arrow | Opeongo Line | Maintenance | 3,382.13 | 2025 |
| Parks | 7 | Playground Equipment | Lakeshore Park (Lions Park) | Reconstruction | 138,000.00 | 2025 |
| Parks | 6 | Parking lot | Old Barry's Bay Rd (crooked s | s Rehabilitation | 5,175.00 | 2030 |
| Parks | 11 | Rink Lighting | Farmer Rd - CO Rink | Rehabilitation | 17,250.00 | 2030 |
| Parks | 9 | General | Public Realm | Maintenance | 5,750.00 | 2035 |
| Parks | 10 | Ballfield - Lighting & Bleachers | : PIYCC - Murray Memorial Pa | Rehabilitation | 65,570.70 | 2038 |
| Parks | 12 | Changeroom | Wadsworth Beach | Rehabilitation | 4,600.00 | 2038 |
| rains | 12 | Changeroom | wadswordi Beach | Renabilitation | 4,000.00 | 2038 |
| Parks | 3 | Public Boat Launch | 39249 Combermere Rd | Maintenance | 13,776.17 | 2039 |
| Parks | 8 | Tennis Court | Lakeshore Park (Lions Park) | Maintenance | 8,625.00 | 2039 |
| Parks | 13 | Dock Fingers | 39249 Combermere Rd | Maintenance | 5,987.75 | 2042 |
| Parks | 2 | Boat Launch & Wharf Lake Kan | n Island Lane | Maintenance | 14,405.94 | 2043 |
| Parks | 1 | Playground Equipment | Mill St., Combermere | Reconstruction | 138,000.00 | 2045 |
| Parks | 4 | Life Size Stuatue-Zurakowski pa | a Opeongo Line | Maintenance | 865.07 | 2045 |
| Parks | 5 | 1.4 scale model Avro Arrow | Opeongo Line | Maintenance | 3,382.13 | 2045 |
| Parks | 7 | Playground Equipment | Lakeshore Park (Lions Park) | Reconstruction | 138,000.00 | 2046 |
| Parks | 14 | Retaining Wall | Lakeshore Park (Lions Park) | Maintenance | 2,000.00 | 2046 |
| Parks | 6 | Parking lot | Old Barry's Bay Rd (crooked : | s Rehabilitation | 5,175.00 | 2049 |
| Parks | 11 | Rink Lighting | Farmer Rd - CO Rink | Rehabilitation | 17,250.00 | 2049 |
| | | | | | | |

| Asset | | | | Treatment | Forecast | Forecast |
|----------------------------------|----------|-------------|---|----------------------------------|------------------------|--------------|
| Class | Asset ID | Description | Location | Description | Cost (\$) | Year |
| transportation | 5 | T5 | sidewalks | Reconstruction | 57,500.00 | 2025 |
| transportation | 6 | T6 | sidewalks | Reconstruction | 57,500.00 | 2026 |
| transportation | 7 | Т7 | sidewalks | Reconstruction | 57,500.00 | 2027 |
| transportation | 8 | Т8 | sidewalks | Reconstruction | 52,210.00 | 2028 |
| transportation | 16 | T16 | Public Parking Lot #3 | Rehabilitation | 12,075.16 | 2035 |
| transportation | 13 | T13 | Streetlights | Maintenance | 36,303.29 | 2037 |
| transportation | 4 | T4 | Madawaska Valley Entrance | S Maintenance | 3,057.64 | 2040 |
| transportation transportation | 14 15 | T14 T15 | Public Parking Lot #1 Public Parking Lot #2 | Rehabilitation Rehabilitation | 11,320.46 10,817.33 | 2042 2042 |
| transportation transportation | 2 | T2 T3 | Paved Walking Trail Paugh Lake Boat Launch/Pub | Maintenance Maintenance | 2,989.13 3,018.68 | 2043 2043 |
| transportation | 1 | TI | Paved Walking Trail | Maintenance | 2,996.26 | 2045 |
| transportation | 17 | T17 | Digital Sign - LED | Maintenance | 7,200.00 | 2048 |

| Asset | | | | Treatment | Forecast | Forecast |
|---------------|----------|-------------|------------------------|----------------|-----------|----------|
| Class | Asset ID | Description | Location | Description | Cost (\$) | Year |
| waste disposa | 4 | W4 | Wilno Site | Maintenance | 12,433.80 | 2024 |
| waste disposa | 5 | W5 | Radcliffe Site | Maintenance | 12,433.80 | 2024 |
| waste disposa | 1 | W1 | Public Realm Equipment | Rehabilitation | 64,515.00 | 2027 |
| waste disposa | 7 | W7 | Paugh lake Site | Maintenance | 12,433.80 | 2029 |
| waste disposa | 6 | W6 | Bark Lake Site | Maintenance | 12,433.80 | 2032 |
| waste disposa | 4 | W4 | Wilno Site | Maintenance | 12,433.80 | 2040 |
| waste disposa | 5 | W5 | Radcliffe Site | Maintenance | 12,433.80 | 2040 |
| waste disposa | 2 | W2 | Landfill Equipment | Reconstruction | 70,380.00 | 2042 |
| waste disposa | 1 | W1 | Public Realm Equipment | Rehabilitation | 64,515.00 | 2044 |
| waste disposa | 7 | W7 | Paugh lake Site | Maintenance | 12,433.80 | 2045 |
| waste disposa | 6 | W6 | Bark Lake Site | Maintenance | 12,433.80 | 2048 |